Project No.: 03.14.859.054

Client: United States Army Corps of Engineers

Project: Beltway 8 PA Lab Testing
Contract No. DACW64-03-D-0008, Delivery Order No. 0054

Boring No.	Sample No.	Soil Description	USCS	Water Content (%)	Dry Density (pcf)	Liquid Limit	Plastic Limit	Plast. Index	Finer than #200 Sieve (%)	Uc/UU. Compr. (tsf)	Cell Press. (psi)	Failure Strain (%)	Failure Type
	7	Gray and tan FAT CLAY; traces of ferrous nodules	CH	29.4									
06-05													
	2	Gray and tan SANDY FAT CLAY; few ferrous and calcareous nodules	CH	16.8									
	4	Gray and tan FAT CLAY; sand seams, traces of ferrous nodules	CH	16.1									
	7	Tan and light gray FAT CLAY	CH	28.9	95.6	77	32	45	98.8				
	9	Gray and tan FAT CLAY; sand pockets, traces of ferrous and calcareous nodules	CH	35.5									
06-06													
	1	Gray and brown LEAN CLAY; traces of ferrous nodules	CL	15.8									
	2	Gray and tan LEAN CLAY with SAND; traces of ferrous nodules	CL	16.8		44	15	29	73.8				
	3	Gray and tan SANDY FAT CLAY; traces of ferrous nodules	CH	19.4									
	4	Tan and light gray FAT CLAY with SAND; few calcareous nodules	CH	16.9	113.4	60	18	42	72.6	3.30	13	14.4	Bulge
	5	Gray and tan FAT CLAY; few calcareous nodules and traces of ferrous nodules	CH	18.9									
	6	Gray and tan FAT CLAY; traces of ferrous nodules	CH	23.3		72	23	49	93.3				
06-07													
	2	Dark gray and brown SANDY LEAN CLAY; sand pockets and traces of ferrous nodules	CL	19.6	110.7	33	16	17	68.1	2.48	21	3.9	Vertical shear
	4	Gray and reddish-brown FAT CLAY; traces of ferrous and calcareous nodules	CH	20.1		54	18	36					
	6	Gray and tan FAT CLAY; few calcareous nodules and traces of ferrous nodules	CH	20.5		55	18	37					
06-08													
	2	Gray and tan SANDY FAT CLAY; traces of ferrous nodules	CH	22.9									
	3	Gray and tan SANDY FAT CLAY; traces of ferrous nodules	CH	14.8		62	18	44	65.5				
	4	Gray and reddish-brown FAT CLAY; vertical sand seams and traces of ferrous nodules	CH	13.0									
	5	Gray and tan FAT CLAY; traces of ferrous and calcareous nodules	CH	25.5									
	6	Gray and tan FAT CLAY; traces of ferrous and calcareous nodules	CH	23.6									
06-09													
	3	Gray FAT CLAY with SAND	CH	17.7	106.6	50	19	31	74.0				
	5	Gray and tan FAT CLAY; traces of ferrous nodules and few calcareous nodules	CH	22.0		58	18	40					
	7	Gray and tan FAT CLAY; traces of ferrous and calcareous nodules	CH	27.9		70	25	45					

Our letters and reports are for the exclusive use of the CLIENT. This document shall not be reproduced, except in full, without our prior written approval.

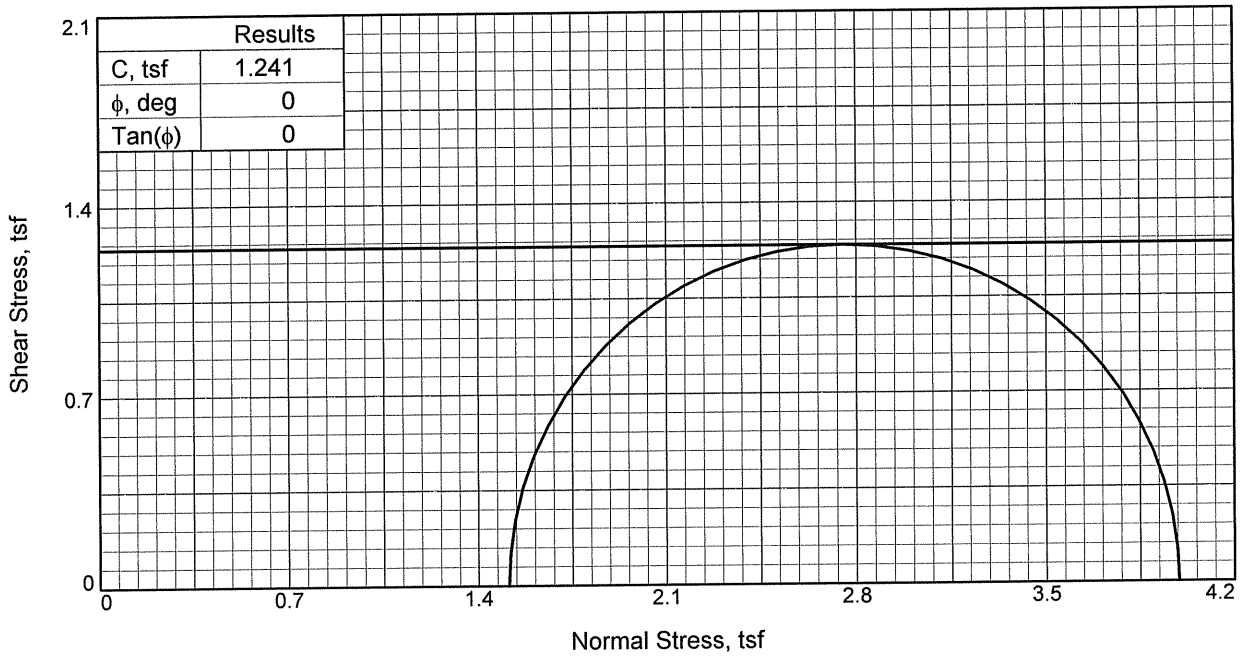

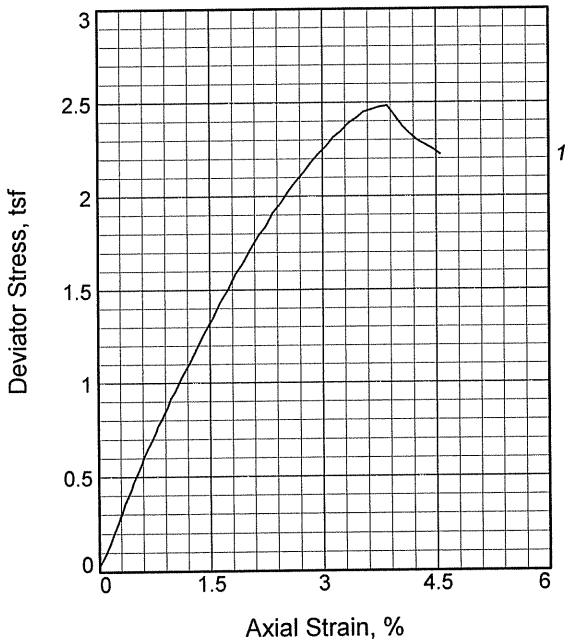

Sample No.		1
Initial	Water Content, %	19.6
	Dry Density, pcf	110.8
	Saturation, %	99.9
	Void Ratio	0.5332
	Diameter, in.	2.84
	Height, in.	5.90
At Test	Water Content, %	19.6
	Dry Density, pcf	110.8
	Saturation, %	99.9
	Void Ratio	0.5332
	Diameter, in.	2.84
	Height, in.	5.90
Strain rate, %/min.		1.00
Back Pressure, psi		0.00
Cell Pressure, psi		21.00
Fail. Stress, tsf		2.48
Strain, %		3.9
Ult. Stress, tsf		2.22
Strain, %		
σ_1 Failure, tsf		3.99
σ_3 Failure, tsf		1.51

Type of Test:
Unconsolidated Undrained

Sample Type: Undisturbed

Description: Dark gray and brown SANDY LEAN CLAY; sand pockets and traces of ferrous nodules

LL= 33 **PL=** 16 **PI=** 17

Assumed Specific Gravity= 2.72

Remarks:
Failure Type: Vertical shear
Test Method: ASTM D 2850

Client: United States Army Corps of Engineers

Project: Beltway 8 PA Lab Testing
Contract No. DACW64-03-D-0008, Delivery Order No. 0054

Source of Sample: 06-07

Sample Number: 2

Proj. No.: 03.14.859.054 **Date Sampled:** 10/5/06

TRIAXIAL SHEAR TEST REPORT

Tolunay-Wong Engineers, Inc.