


Hole No. 3ST-8						
DRILLING LOG						
DIVISION So1 western						
INSTALLATION Galv Dist, Eng Div						
SHEET OF SHEETS						
1. PROJECT Port Aransas-Corpus Christi WW						
2. LOCATION (Coordinates or Station)						
3. DRILLING AGENCY U. S. Army Corps of Engineers						
4. HOLE NO. (As shown on drawing title and file number) 3ST-8						
5. NAME OF DRILLER Black						
6. DIRECTION OF HOLE ☐ VERTICAL ☐ INCLINED _____ DEG. FROM VERT.						
7. THICKNESS OF OVERBURDEN						
8. DEPTH DRILLED INTO ROCK						
9. TOTAL DEPTH OF HOLE 52.0						
10. SIZE AND TYPE OF BIT						
11. DATUM FOR ELEVATION SHOWN (TBM or MSL) Tide +2.0 @ 12:20 PM						
12. MANUFACTURER'S DESIGNATION OF DRILL						
13. TOTAL NO. OF OVER-BURDEN SAMPLES TAKEN 1 Jar 4 Cont						
14. TOTAL NUMBER CORE BOXES						
15. ELEVATION GROUND WATER						
16. DATE HOLE STARTED 29 Apr COMPLETED 29 Apr 1964						
17. ELEVATION TOP OF HOLE						
18. TOTAL CORE RECOVERY FOR BORING %						
19. SIGNATURE OF INSPECTOR						
ELEVATION	DEPTH	LEGEND	CLASSIFICATION OF MATERIALS (Description)	% CORE RECOVERY	BOX OR SAMPLE NO.	REMARKS (Drilling time, water loss, depth of weathering, etc., if significant)
a	b	c	d	e	f	g
0.0	37.5		Water			
37.5	42.5		Black oily muck sandy clay v/soft, unable to pickup in tube had to catch from next push, weight 5 rods and tube, no resistance			
42.5	45.0		Green to light brown sandy clay w/cal nod, hard			Cont. 1 4.0
45.0	47.5		Light brown sandy clay w/cal nod, brickle, v/stiff			Cont. 2 3.75
47.5	50.0		Tan silty clay, v/stiff			Cont. 3 3.75
50.0	52.0		Tan clay v/brickle, hard			Cont. 4 4.25
			Bottomed			

PORT ARANSAS
CORPUS CHRISTI
WATERWAYS

LOG OF BORING NO. 35T-8
Tide +2.0 @ 12:20 PM

TYPE: 3" 56-161 TOL

LOCATION:

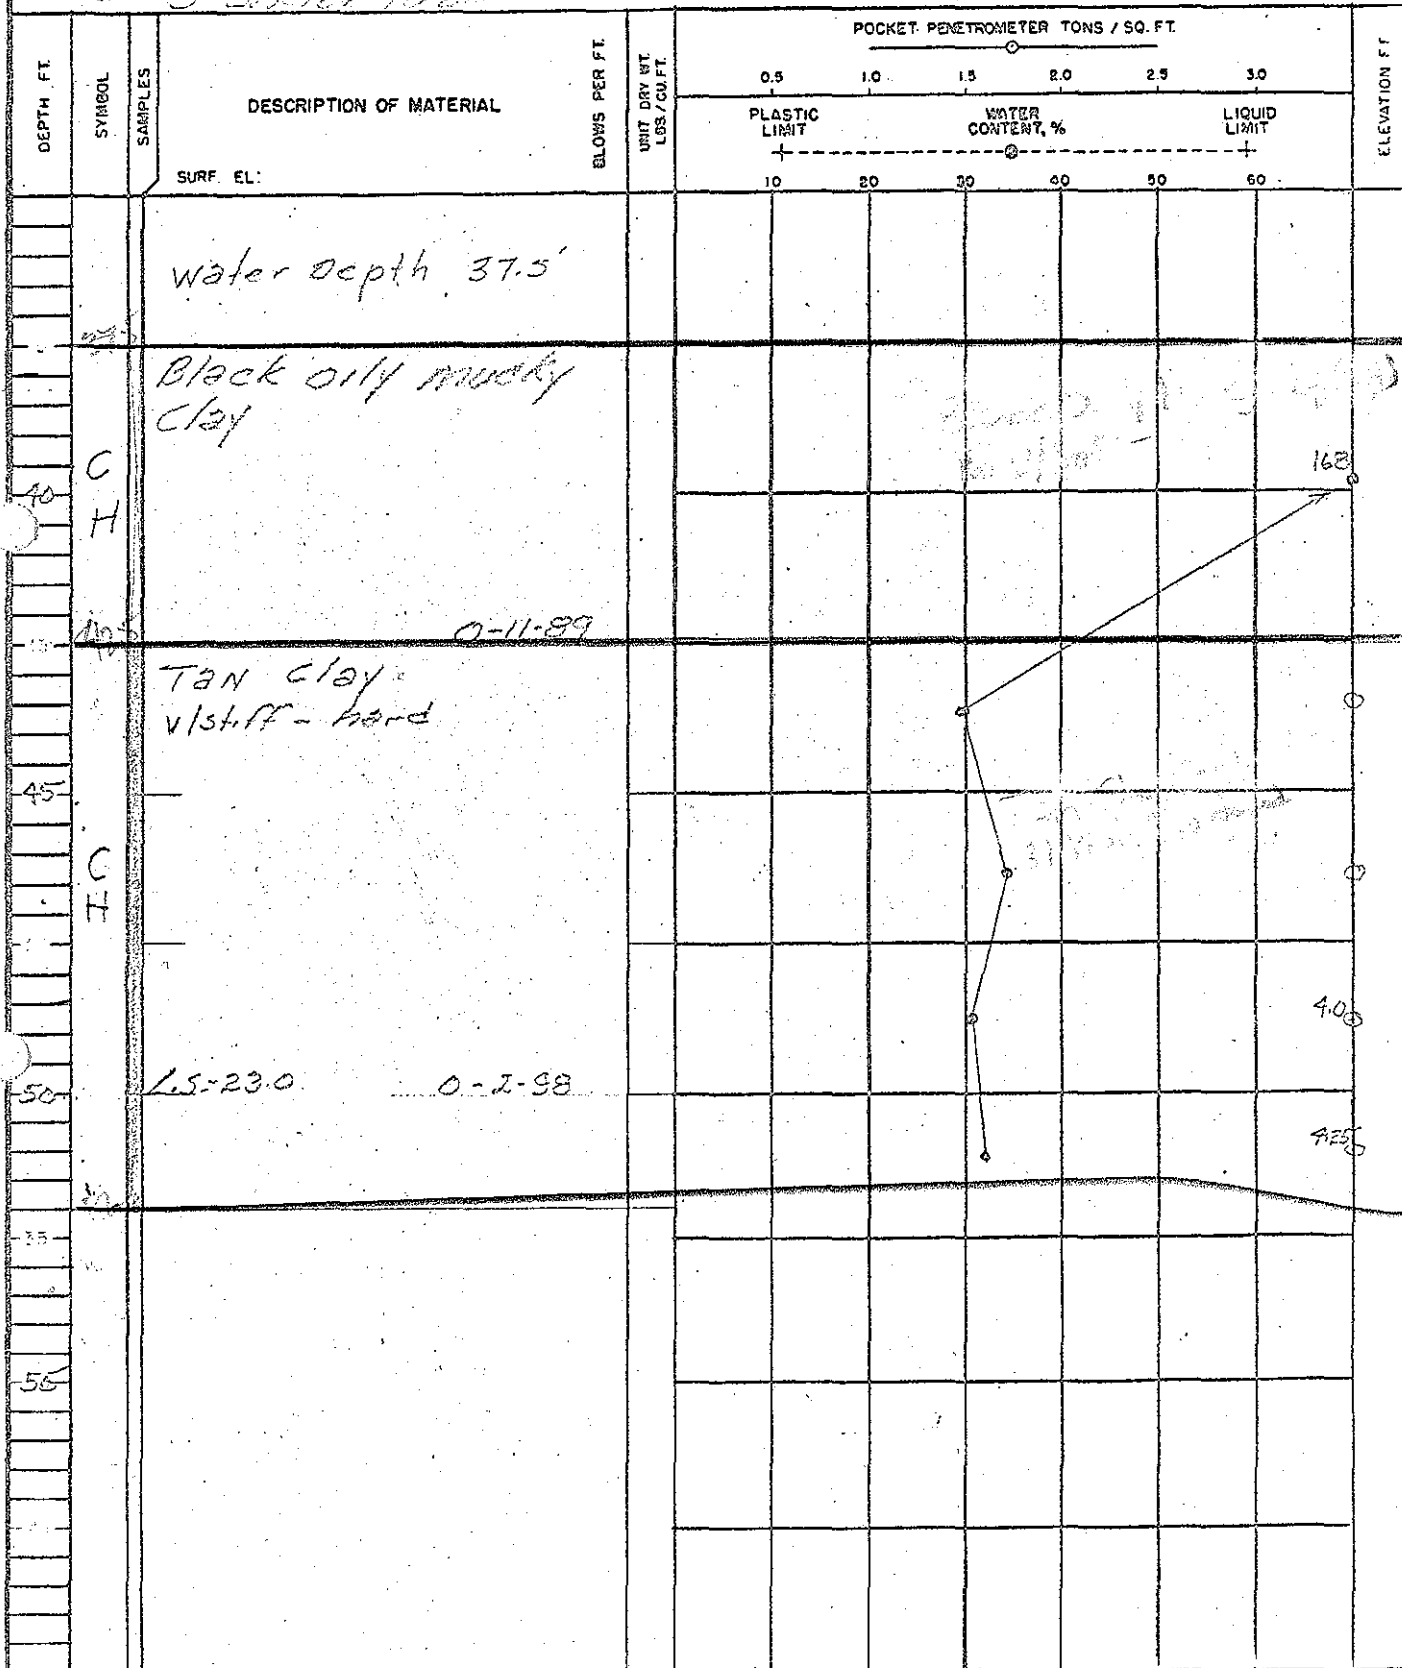

COMPLETION DEPTH 52.0
DATE 29 April '69

DEPTH TO WATER
IN BORING

DATE