

October 22, 2008

Attn.: Mr. Daniel Heilman, P.E.

RETL Job No.: G108558

WEST GALVESTON ISLAND LG. SCALE BEACH NOURISHMENT PROJECT


South Jetty Borrow Source Area

Galveston, Texas

BORING NO.	GPS COORDINATES	
C-01	N. 29.33841	W. 94.72652
C-02	N. 29.33981	W. 94.72643
C-03	N. 29.33892	W. 94.72394
C-04	N. 29.33793	W. 94.72235
C-05	N. 29.33645	W. 94.72380
C-06	N. 29.33628	W. 94.72204
C-07	N. 29.33395	W. 94.72095
C-08	N. 29.33927	W. 94.71980
C-09	N. 29.33801	W. 94.72057
C-10	N. 29.33691	W. 94.71941
C-11	N. 29.33475	W. 94.71779
C-12	N. 29.33336	W. 94.71779
C-13	N. 29.33744	W. 94.71832
C-14	N. 29.33970	W. 94.71677
C-15	N. 29.33820	W. 94.71687
C-16	N. 29.33661	W. 94.71597
C-17	N. 29.33607	W. 94.71563
C-18	N. 29.33411	W. 94.71399
C-19	N. 29.33955	W. 94.71420
C-20	N. 29.33748	W. 94.71338
C-21	N. 29.33338	W. 94.71127
C-22	N. 29.33564	W. 94.71037
C-23	N. 29.33239	W. 94.70724
C-24	N. 29.33759	W. 94.70845
C-25	N. 29.33560	W. 94.70621
C-26	N. 29.33506	W. 94.71728
C-27	N. 29.33483	W. 94.71611
C-28	N. 29.33711	W. 94.72358
C-29	N. 29.33742	W. 94.71455
C-30	N. 29.33811	W. 94.72344
C-31	N. 29.33493	W. 94.72033
C-32	N. 29.33541	W. 94.73054

In addition, forty surface grab samples from onshore and offshore of the Gulf beach along west Galveston Island were obtained and delivered to RETL by a representative of HDR, Inc. The ground surface elevations at the offshore grab sample locations are provided in the table below:

C:\P\Working\DAL\dms93560\00V101.DWG, 10/20/2008 4:00:32 PM

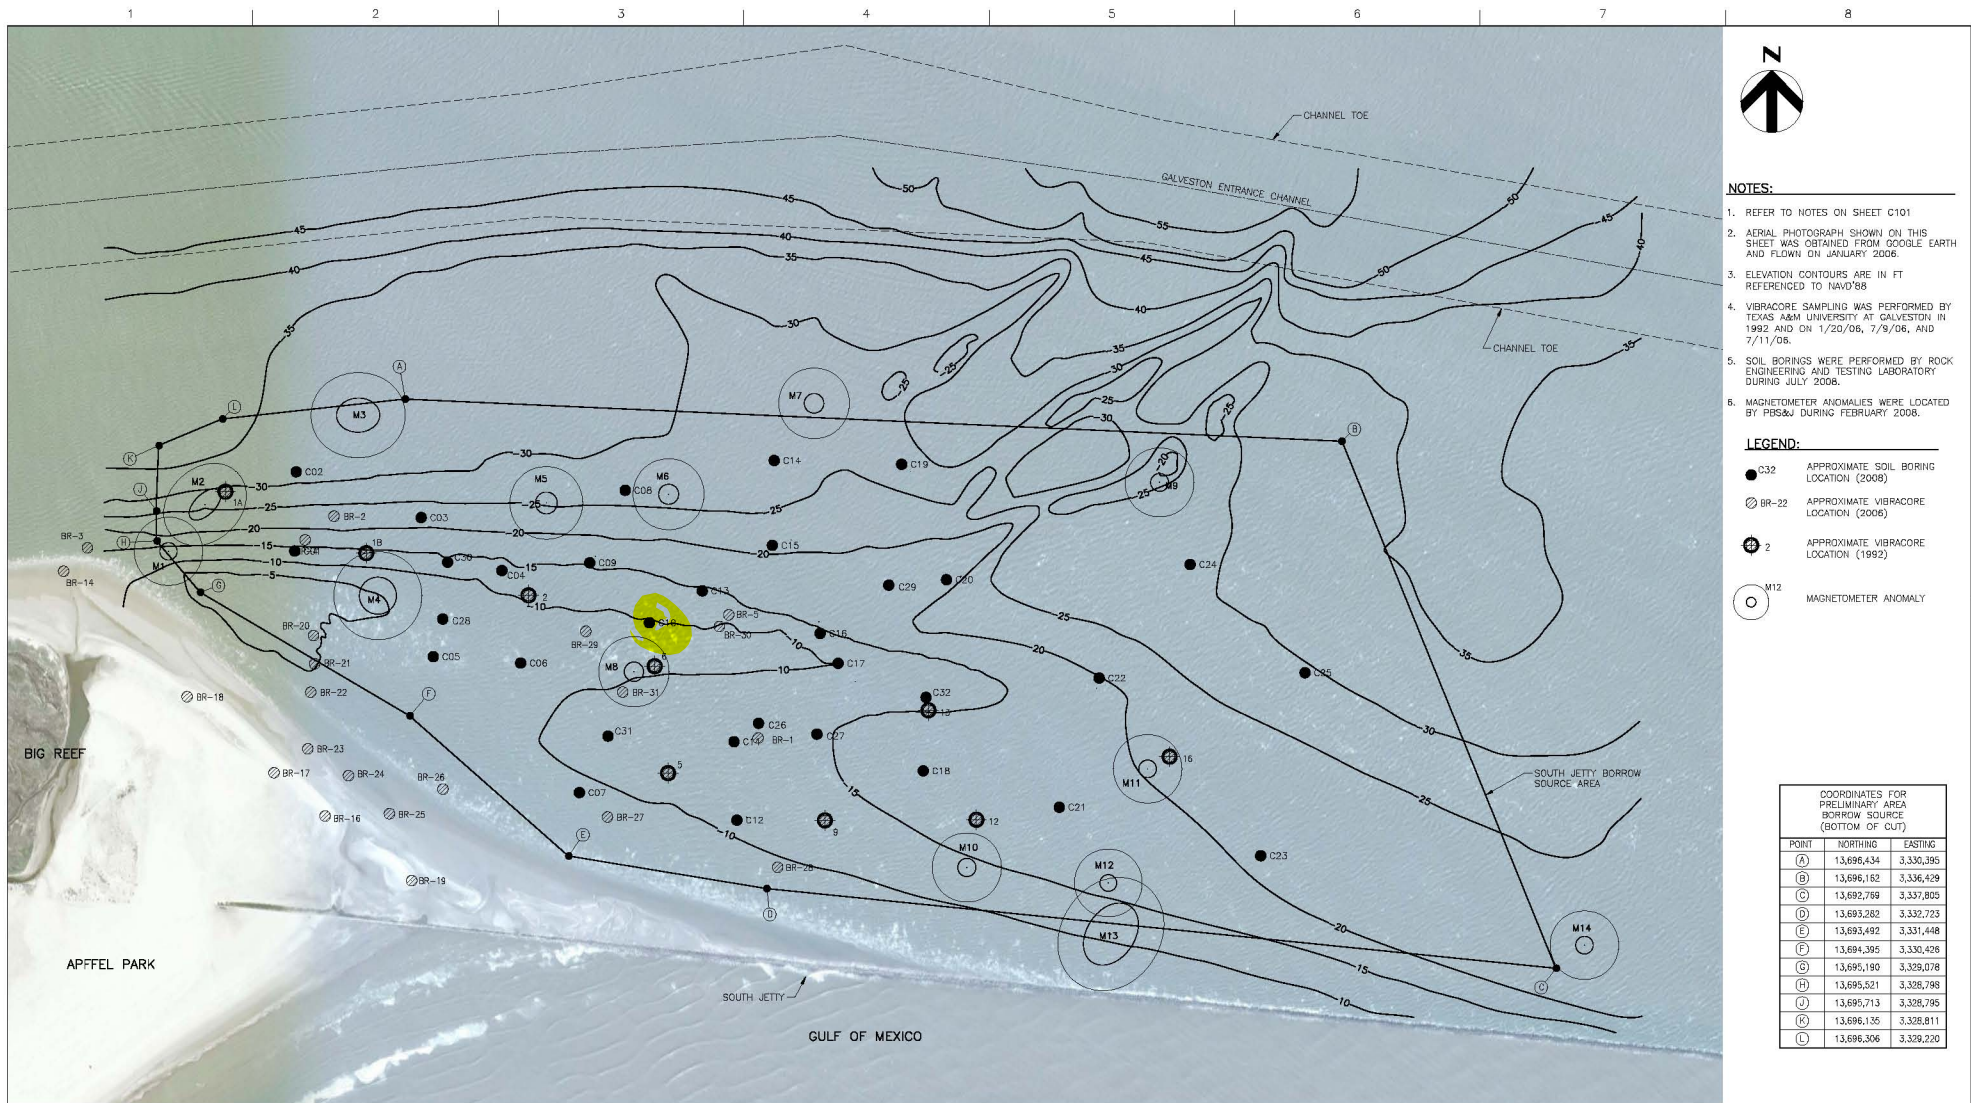

- NOTES:**
1. REFER TO NOTES ON SHEET C101
 2. AERIAL PHOTOGRAPH SHOWN ON THIS SHEET WAS OBTAINED FROM GOOGLE EARTH AND FLOWN ON JANUARY 2006.
 3. ELEVATION CONTOURS ARE IN FT REFERENCED TO NAVD'88
 4. VIBRACORE SAMPLING WAS PERFORMED BY TEXAS A&M UNIVERSITY AT GALVESTON IN 1992 AND ON 1/20/06, 7/9/06, AND 7/11/06.
 5. SOIL BORINGS WERE PERFORMED BY ROCK ENGINEERING AND TESTING LABORATORY DURING JULY 2008.
 6. MAGNETOMETER ANOMALIES WERE LOCATED BY PGS&J DURING FEBRUARY 2008.
- LEGEND:**
- C32 APPROXIMATE SOIL BORING LOCATION (2008)
 - ⊗ BR-22 APPROXIMATE VIBRACORE LOCATION (2006)
 - ⊗ 2 APPROXIMATE VIBRACORE LOCATION (1992)
 - M12 MAGNETOMETER ANOMALY

COORDINATES FOR PRELIMINARY AREA BORROW SOURCE (BOTTOM OF CUT)		
POINT	NORTHING	EASTING
(A)	13,696,434	3,330,395
(B)	13,696,162	3,336,429
(C)	13,692,769	3,337,805
(D)	13,693,282	3,332,723
(E)	13,693,492	3,331,448
(F)	13,694,395	3,330,428
(G)	13,695,190	3,329,078
(H)	13,695,521	3,328,798
(J)	13,695,713	3,328,795
(K)	13,696,135	3,328,811
(L)	13,696,306	3,329,220

SOUTH JETTY BORROW SOURCE AREA

SCALE: 0 400' 800'



					PROJECT MANAGER DANIEL J. HELLMAN	PRELIMINARY THIS DOCUMENT IS RELEASED FOR THE PURPOSE OF INTERIM REVIEW AND IS NOT INTENDED TO BE USED FOR CONSTRUCTION, BIDDING OR PERMIT PURPOSES.	WEST GALVESTON ISLAND END OF SEAWALL BEACH NOURISHMENT 	BORROW SOURCE AREA	FILENAME 00V101.DWG	SHEET
		1	10/20/08	REVISED SOIL BORING LOCATIONS AND SCALE					SCALE AS SHOWN	V101
		2	10/17/08	ISSUED TO TGLD	CHECKED BY LAUREN AUGUSTIN					
		ISSUE	DATE	DESCRIPTION	PROJECT NUMBER 88091					



- Geotechnical Engineering
- Construction Materials Testing

PROJECT NAME: West Galveston Island Large Scale Beach Nourishment Project

CLIENT: HDR, Inc.

BORING ID.: C-10

DESCRIPTION: South Jetty Borrow Source Area

PERCENT SHELL BY WEIGHT (BASED ON #10 SIEVE)			
-9.4' TO -11.4' NAVD	-13.4' TO -15.4' NAVD	-15.4' TO -17.4' NAVD	-17.4' TO -19.4' NAVD
0.86	0.74	0.27	0.25

ASTM MESH	% FINER BY WEIGHT AFTER REMOVING SHELL			
	-9.4' TO -11.4' NAVD	-13.4' TO -15.4' NAVD	-15.4' TO -17.4' NAVD	-17.4' TO -19.4' NAVD
#10	100.00	100.00	100.00	100.00
#18	98.80	98.50	99.20	99.80
#35	97.20	97.60	99.10	99.30
#60	93.80	95.90	98.10	98.10
#70	73.55	93.16	72.34	93.05
#100	23.14	38.00	26.58	49.77
#120	8.10	9.70	15.40	19.70
#170	3.00	2.90	7.80	6.50
#200	2.40	2.30	6.70	5.00
STATISTICS (EXCLUDING SHELL)				
MEDIAN GRAIN SIZE (mm)	0.19	0.17	0.18	0.16
MEAN GRAIN SIZE (mm)	0.19	0.17	0.18	0.16
SORTING (σ)	0.39	0.28	N/A	0.36

*The -#10 material was utilized as the total sample for Grain Size Distribution Curve calculations.



- Geotechnical Engineering
- Construction Materials Testing

PROJECT NAME: West Galveston Island Large Scale Beach Nourishment Project

CLIENT: HDR, Inc.

BORING ID.: C-10


DESCRIPTION: South Jetty Borrow Source Area

PERCENT SHELL BY WEIGHT (BASED ON #10 SIEVE)				
-21.4' TO -23.4' NAVD	-23.4' TO -25.4' NAVD	-25.4' TO -27.4' NAVD	-29.4' TO -31.4' NAVD	-31.4' TO -33.4' NAVD
0.56	0.07	0.03	0.07	N/A

ASTM MESH	% FINER BY WEIGHT AFTER REMOVING SHELL				
	-21.4' TO -23.4' NAVD	-23.4' TO -25.4' NAVD	-25.4' TO -27.4' NAVD	-29.4' TO -31.4' NAVD	-31.4' TO -33.4' NAVD
#10	100.00	100.00	100.00	100.00	N/A
#18	99.50	99.20	99.70	99.90	N/A
#35	99.20	98.50	99.40	99.80	N/A
#60	98.00	97.40	98.40	99.50	N/A
#120	54.70	35.80	64.70	82.40	N/A
#170	40.30	18.00	48.10	52.80	N/A
#200	34.60	14.80	39.30	41.50	75.40
STATISTICS (EXCLUDING SHELL)					
MEDIAN GRAIN SIZE (mm)	0.11	0.16	0.09	0.09	N/A
MEAN GRAIN SIZE (mm)	N/A	0.14	N/A	N/A	N/A
SORTING (σ)	N/A	N/A	N/A	N/A	N/A

*C-10; -31.4' to -33.4' NAVD was only passed through the -#200 sieve.

*The -#10 material was utilized as the total sample for Grain Size Distribution Curve calculations.

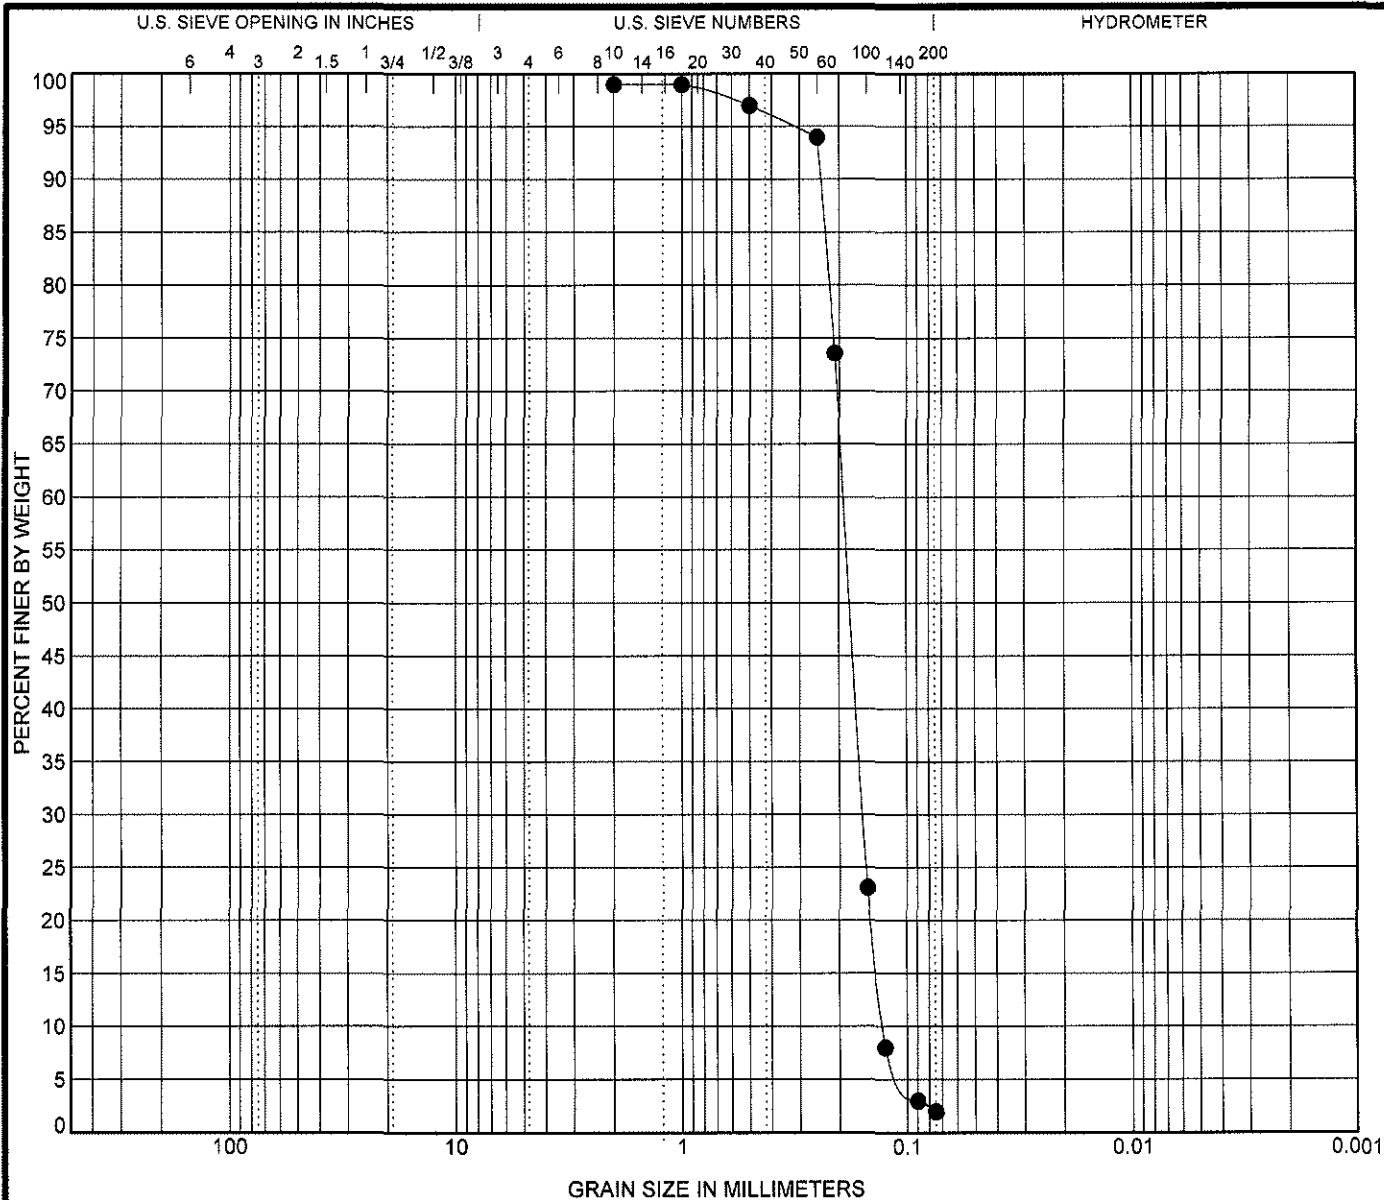

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	


Specimen ID	Depth	Classification				LL	PL	PI	Cc	Cu
● C-10	(-9.4' to 11.4' NAVD)	Borrow Area (-9.4' to -11.4' NAVD)							1.00	1.50
Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay	
● C-10	(-9.4' to 11.4' NAVD)	2	0.192	0.157	0.128	0.0	97.0	2.0		



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Prop. Large Scale Beach Nourishment Project
Location: South Jetty Borrow Source Area; Galveston, Texas
Number: G108558

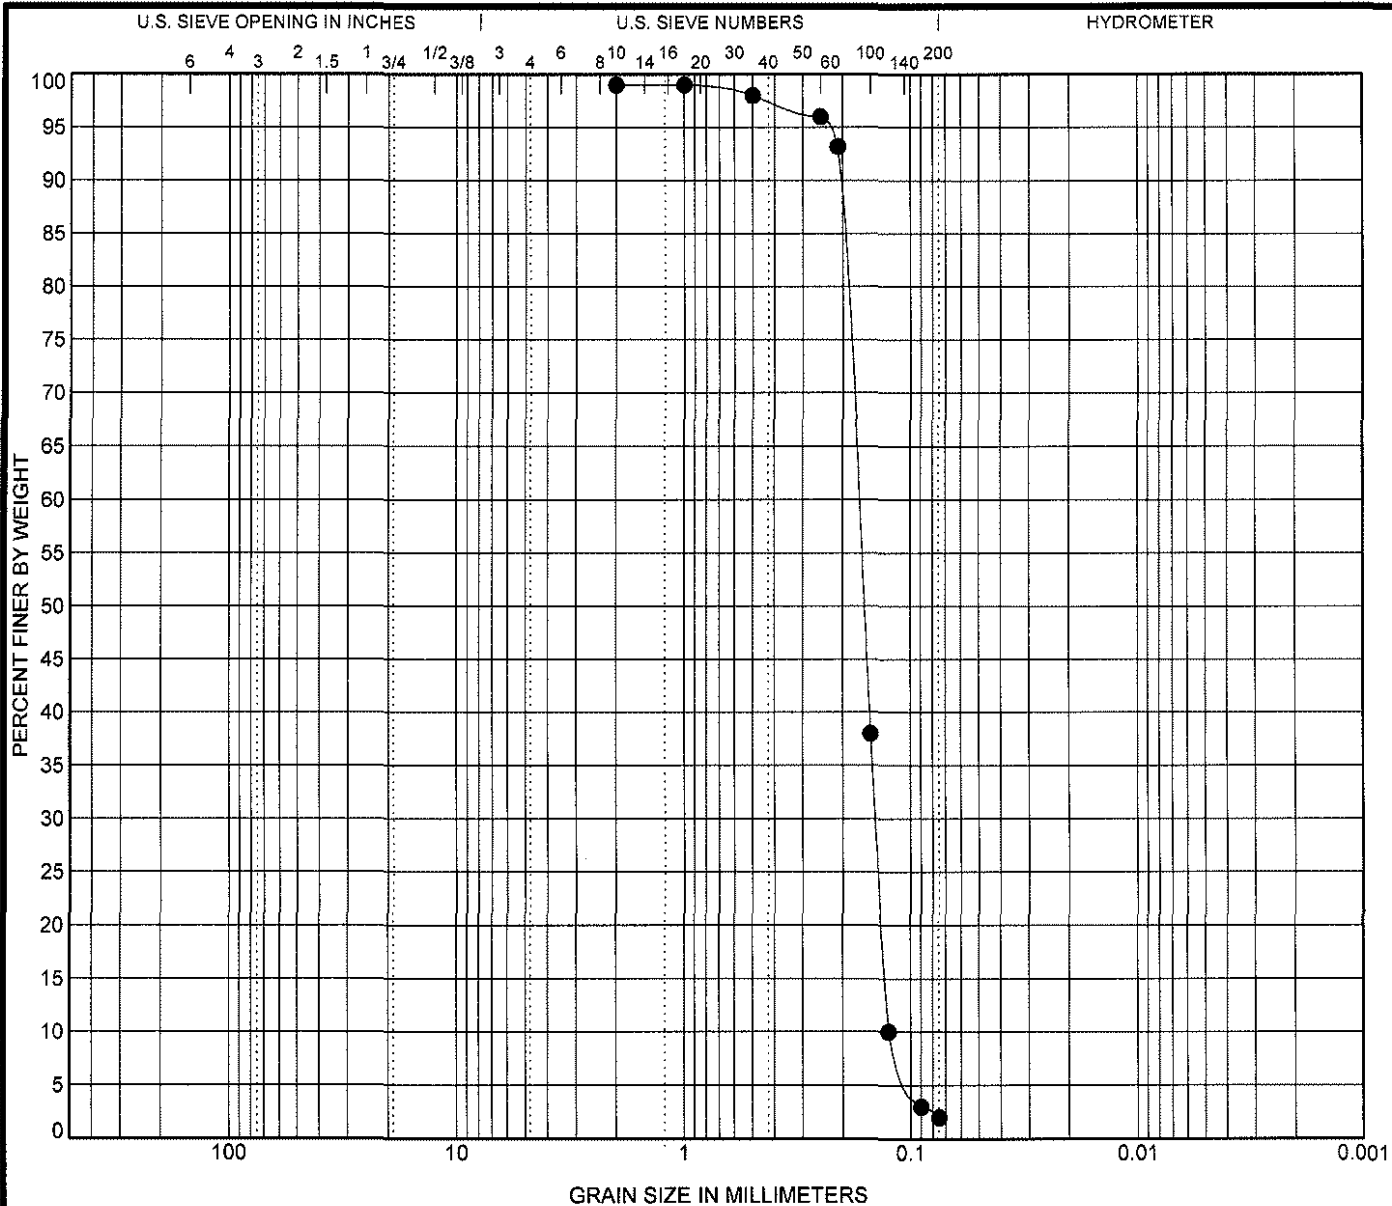

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	


Specimen ID	Depth	Classification					LL	PL	PI	Cc	Cu
● C-10 (-13.4' to -15.4' NAVD)		Borrow Area (-13.4' to -15.4' NAVD)								0.95	1.37
Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay		
● C-10 (-13.4' to -15.4' NAVD)		2	0.172	0.142	0.125	0.0	97.0	2.0			



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Prop. Large Scale Beach Nourishment Project
Location: South Jetty Borrow Source Area; Galveston, Texas
Number: G108558

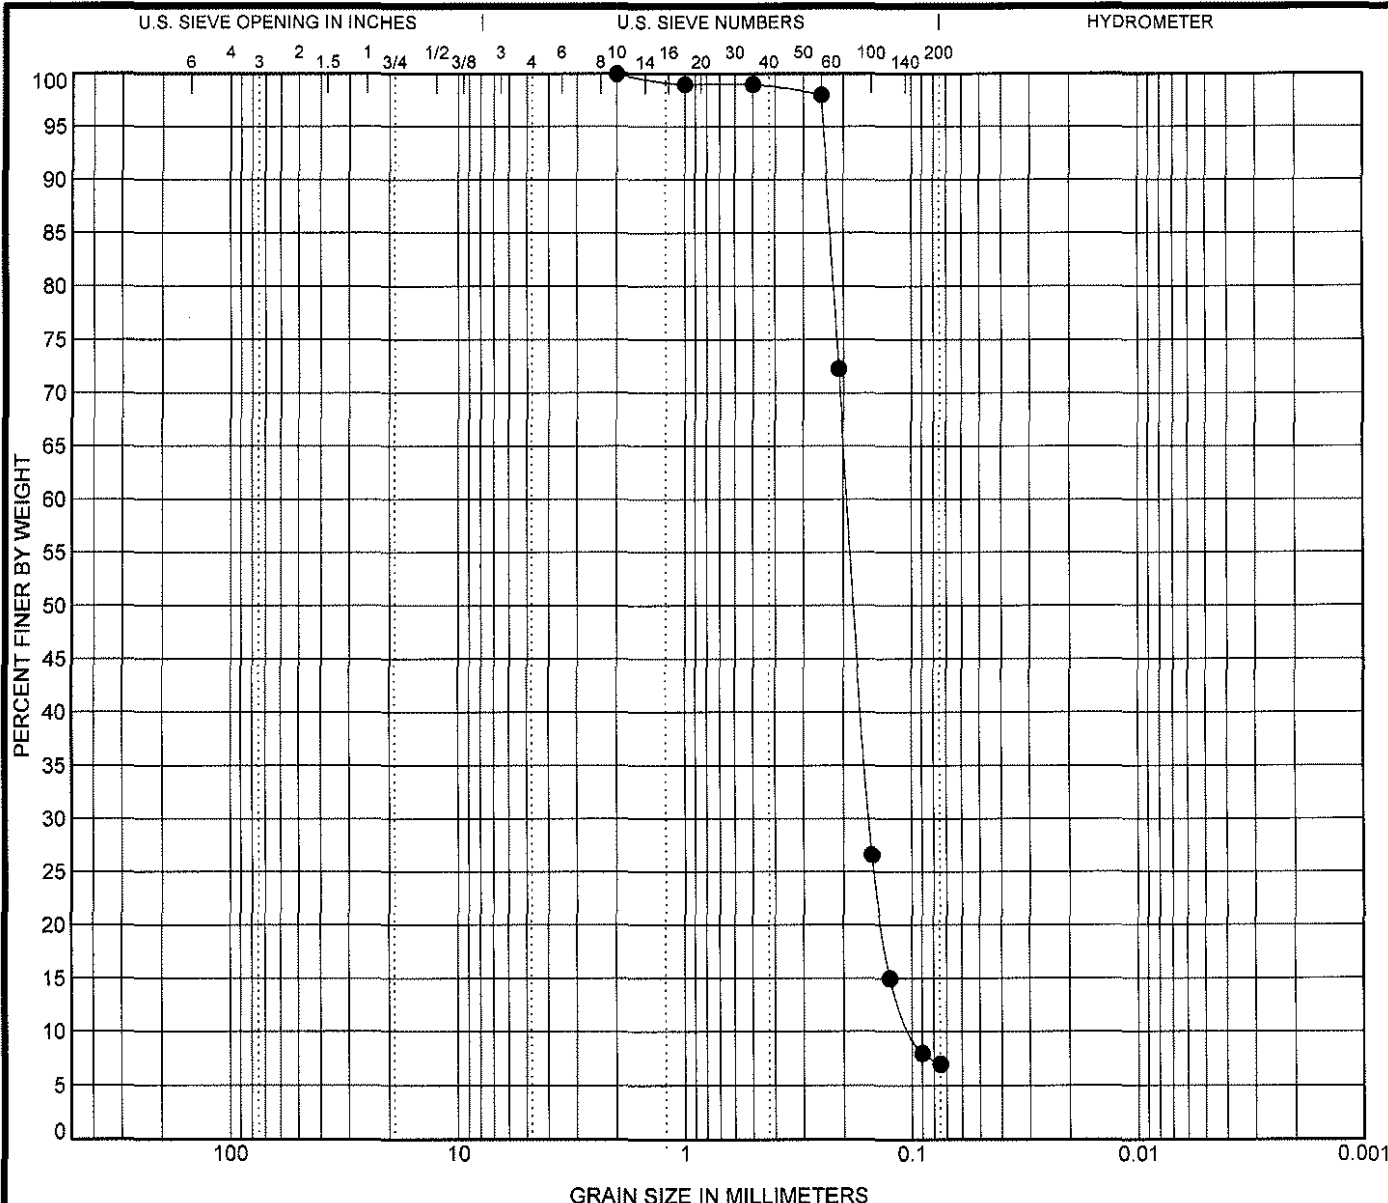

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● C-10 (-15.4' to -17.4' NAVD)		Borrow Area (-15.4' to -17.4' NAVD)				1.25	1.94


Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● C-10 (-15.4' to -17.4' NAVD)		2	0.192	0.154	0.099	0.0	93.0	7.0	



Rock Engineering & Testing Lab., Inc.
 6817 Leopard St.
 Corpus Christi, TX 78409
 Telephone: (361) 883-4555
 Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Prop. Large Scale Beach Nourishment Project
 Location: South Jetty Borrow Source Area; Galveston, Texas
 Number: G108558

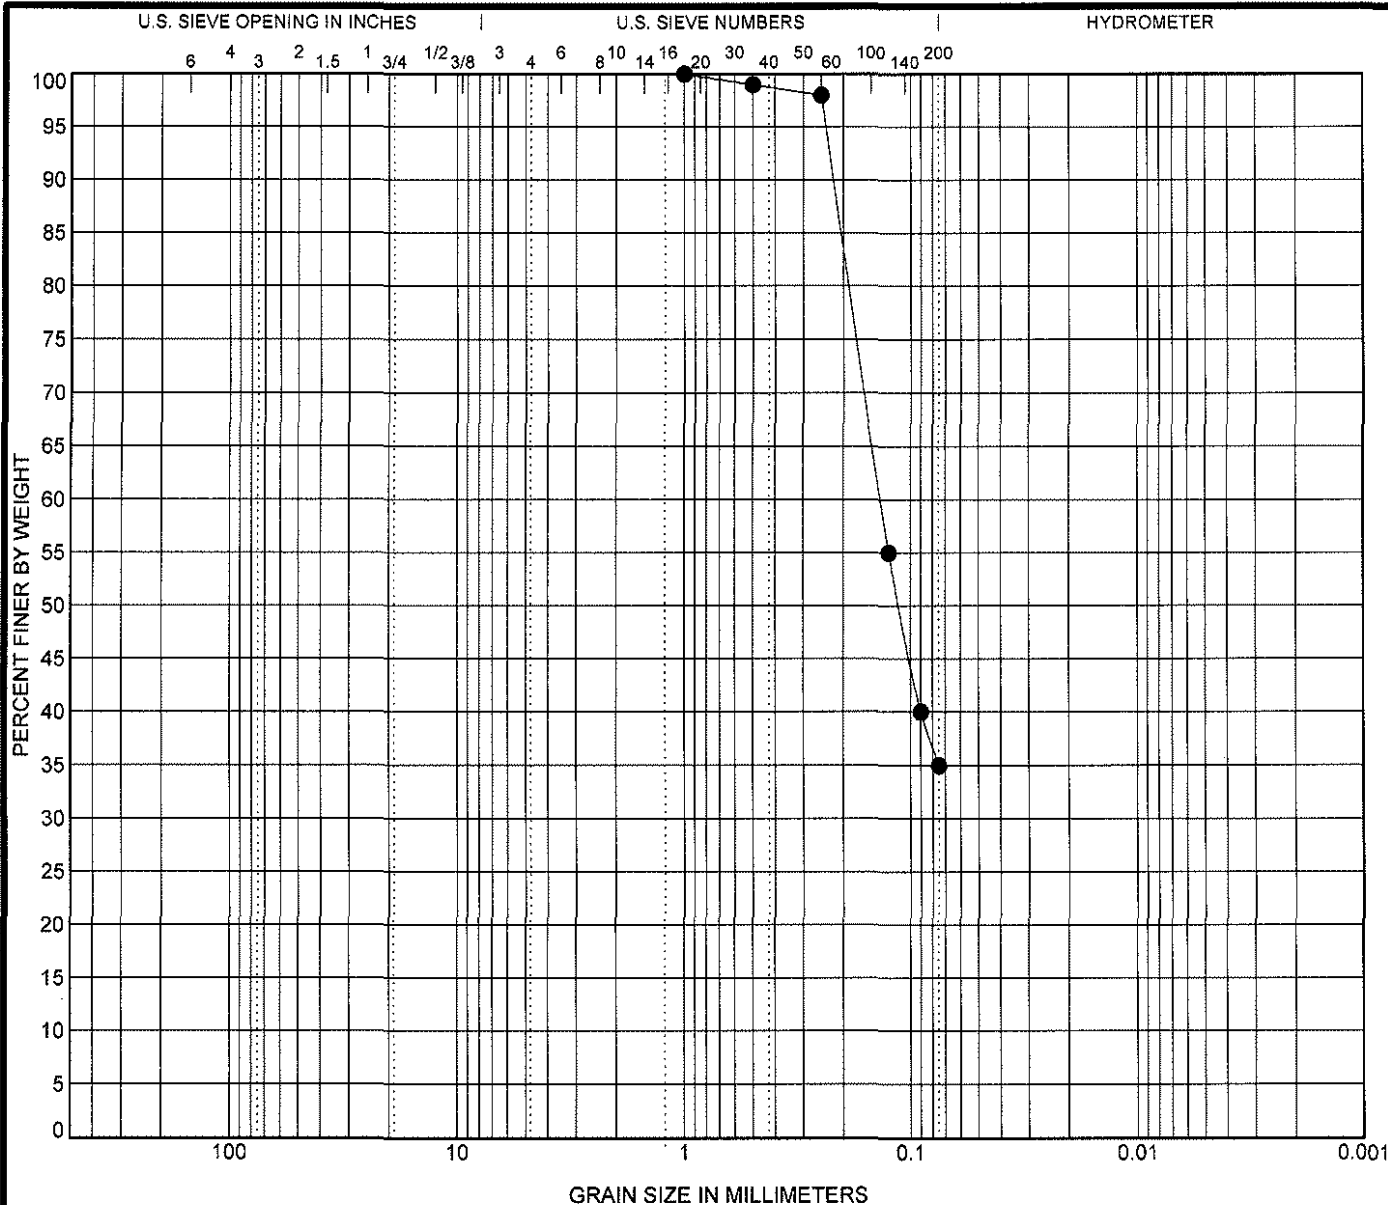

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	


Specimen ID	Depth	Classification					LL	PL	PI	Cc	Cu
● C-10	(21.4' to -23.4' NAVD)	Borrow Area (-21.4' to -23.4' NAVD)									
Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt		%Clay	
● C-10	(21.4' to -23.4' NAVD)	1	0.135			0.0	65.0	35.0			



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Prop. Large Scale Beach Nourishment Project
Location: South Jetty Borrow Source Area; Galveston, Texas
Number: G108558

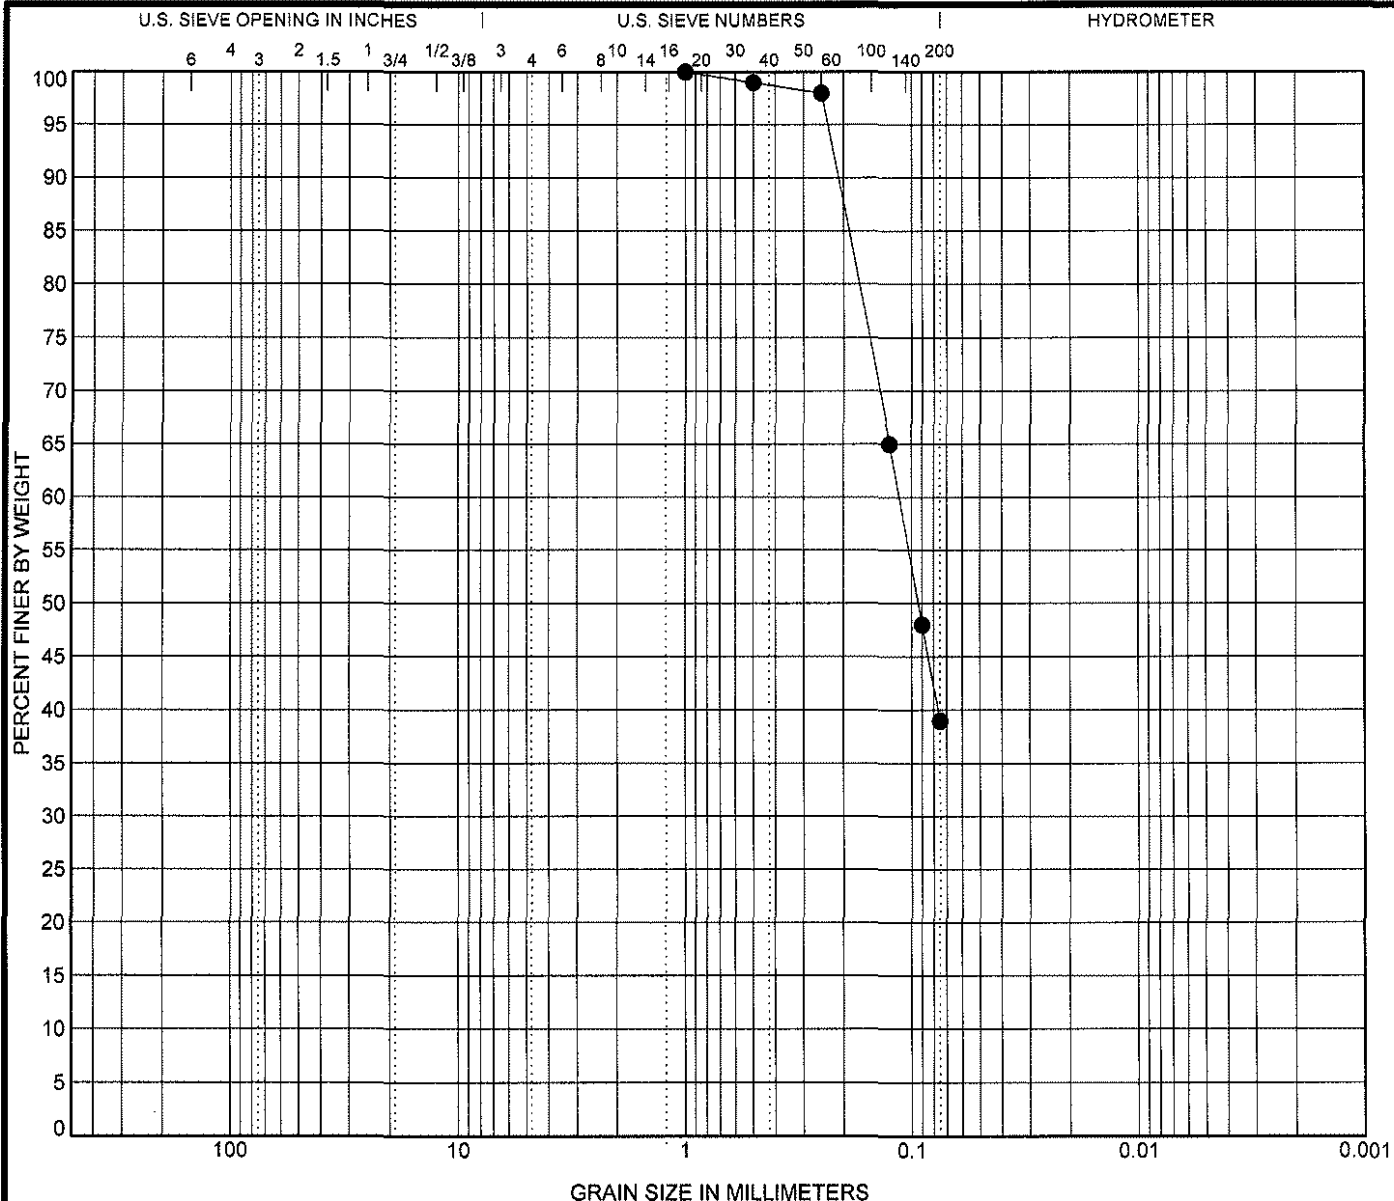

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● C-10 (-25.4' to -27.4' NAVD)		Borrow Area (-25.4' to -27.4' NAVD)					


Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● C-10 (-25.4' to -27.4' NAVD)		1	0.113			0.0	61.0	39.0	



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Prop. Large Scale Beach Nourishment Project
Location: South Jetty Borrow Source Area; Galveston, Texas
Number: G108558

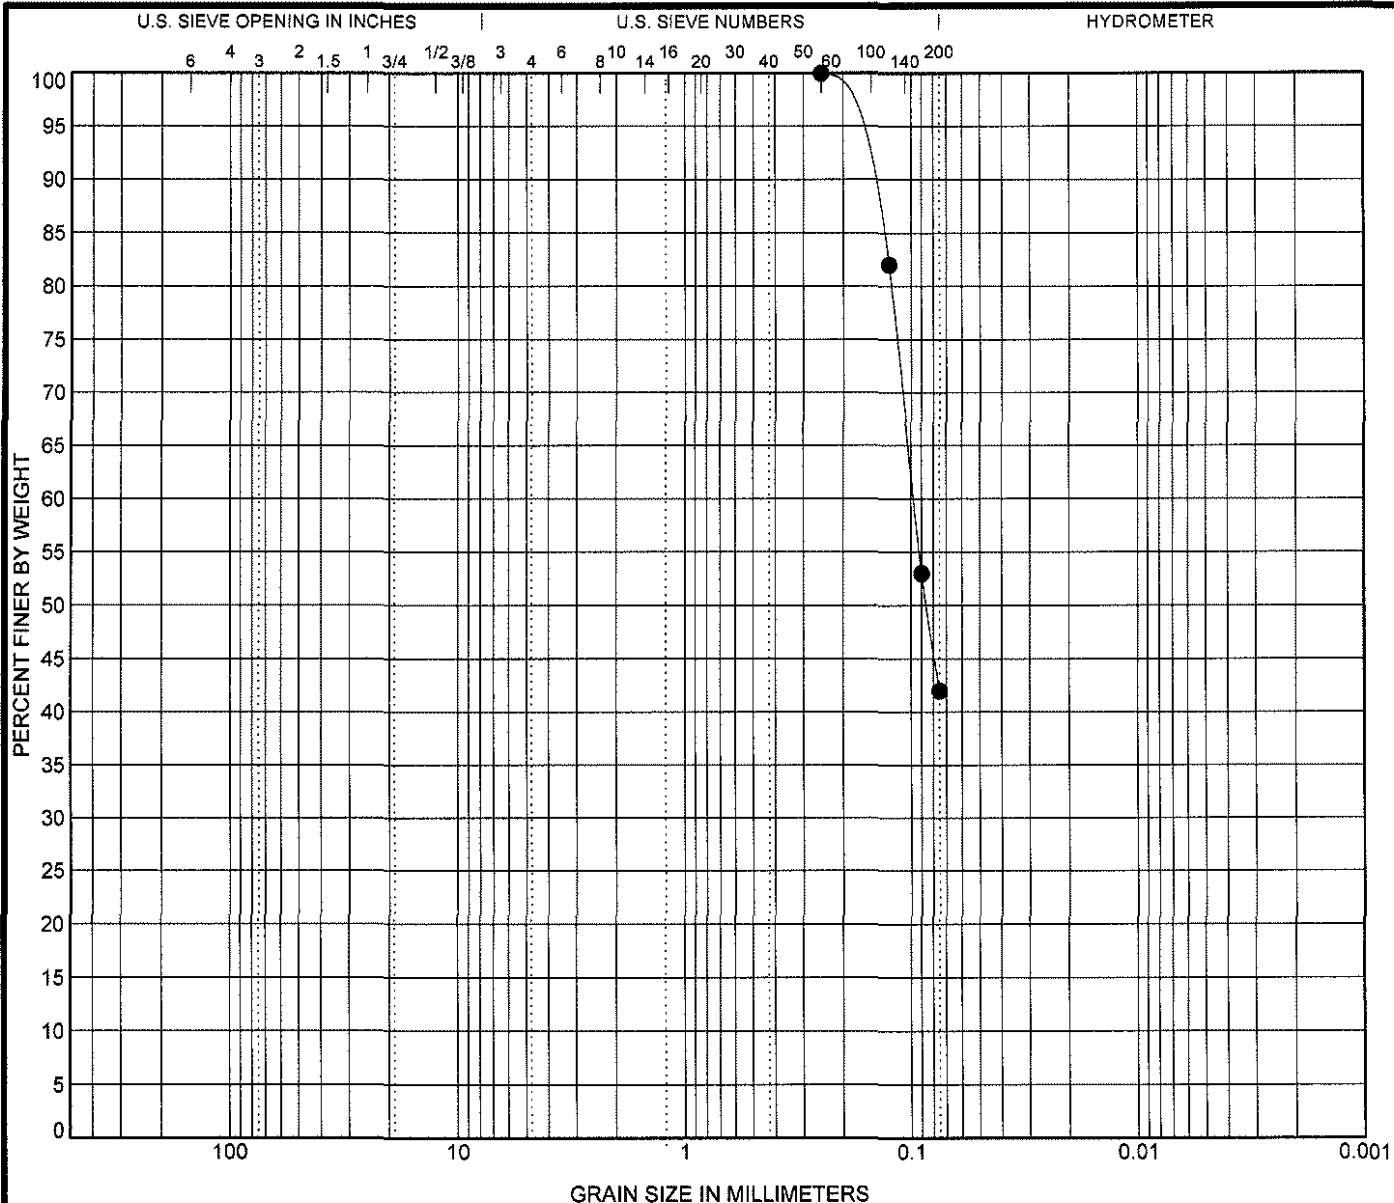

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● C-10 (-29.4' to -31.4' NAVD)		Borrow Area (-29.4' to -31.4' NAVD)					

Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● C-10 (-29.4' to -31.4' NAVD)		0.25	0.097			0.0	58.0	42.0	



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Prop. Large Scale Beach Nourishment Project
Location: South Jetty Borrow Source Area; Galveston, Texas
Number: G108558