



- Geotechnical Engineering
- Construction Materials Testing

PROJECT NAME: Anchorage Basin Sand Source Investigation

CLIENT: HDR Engineering, Inc.

BORING ID.: AA-07


DESCRIPTION: Anchorage Basin Borrow Source Area

PERCENT SHELL BY WEIGHT (BASED ON #10 SIEVE)				
-26' to -27'	-29' to -30'	-32' to -33'	-34' to -35'	-35' to -36'
NAVD	NAVD	NAVD	NAVD	NAVD
72.72	4.46	3.89	20.73	0.00

ASTM MESH	% FINER BY WEIGHT AFTER REMOVING SHELL				
	-26' to -27'	-29' to -30'	-32' to -33'	-34' to -35'	-35' to -36'
	NAVD	NAVD	NAVD	NAVD	NAVD
#10	100.00	100.00	100.00	100.00	100.00
#18	N/A	88.72	90.74	67.05	99.98
#35	N/A	75.21	79.74	57.27	99.91
#60	N/A	53.27	57.46	44.68	99.69
#70	N/A	44.34	43.65	38.68	99.26
#100	N/A	29.94	19.20	23.96	60.02
#120	N/A	14.00	8.57	15.77	30.01
#170	N/A	7.22	3.29	10.00	14.00
#200	N/A	6.25	3.11	9.35	11.38
STATISTICS (EXCLUDING SHELL)					
MEDIAN GRAIN SIZE (mm)	N/A	0.25	0.25	0.30	0.16
MEAN GRAIN SIZE (mm)	N/A	0.30	0.30	0.34	0.15
SORTING (σ)	N/A	N/A	1.12	N/A	N/A

*AA-07; -26' to -27' NAVD was only passed through the #10 sieve.

*The -#10 material was utilized as the total sample for Grain Size Distribution Curve calculations.

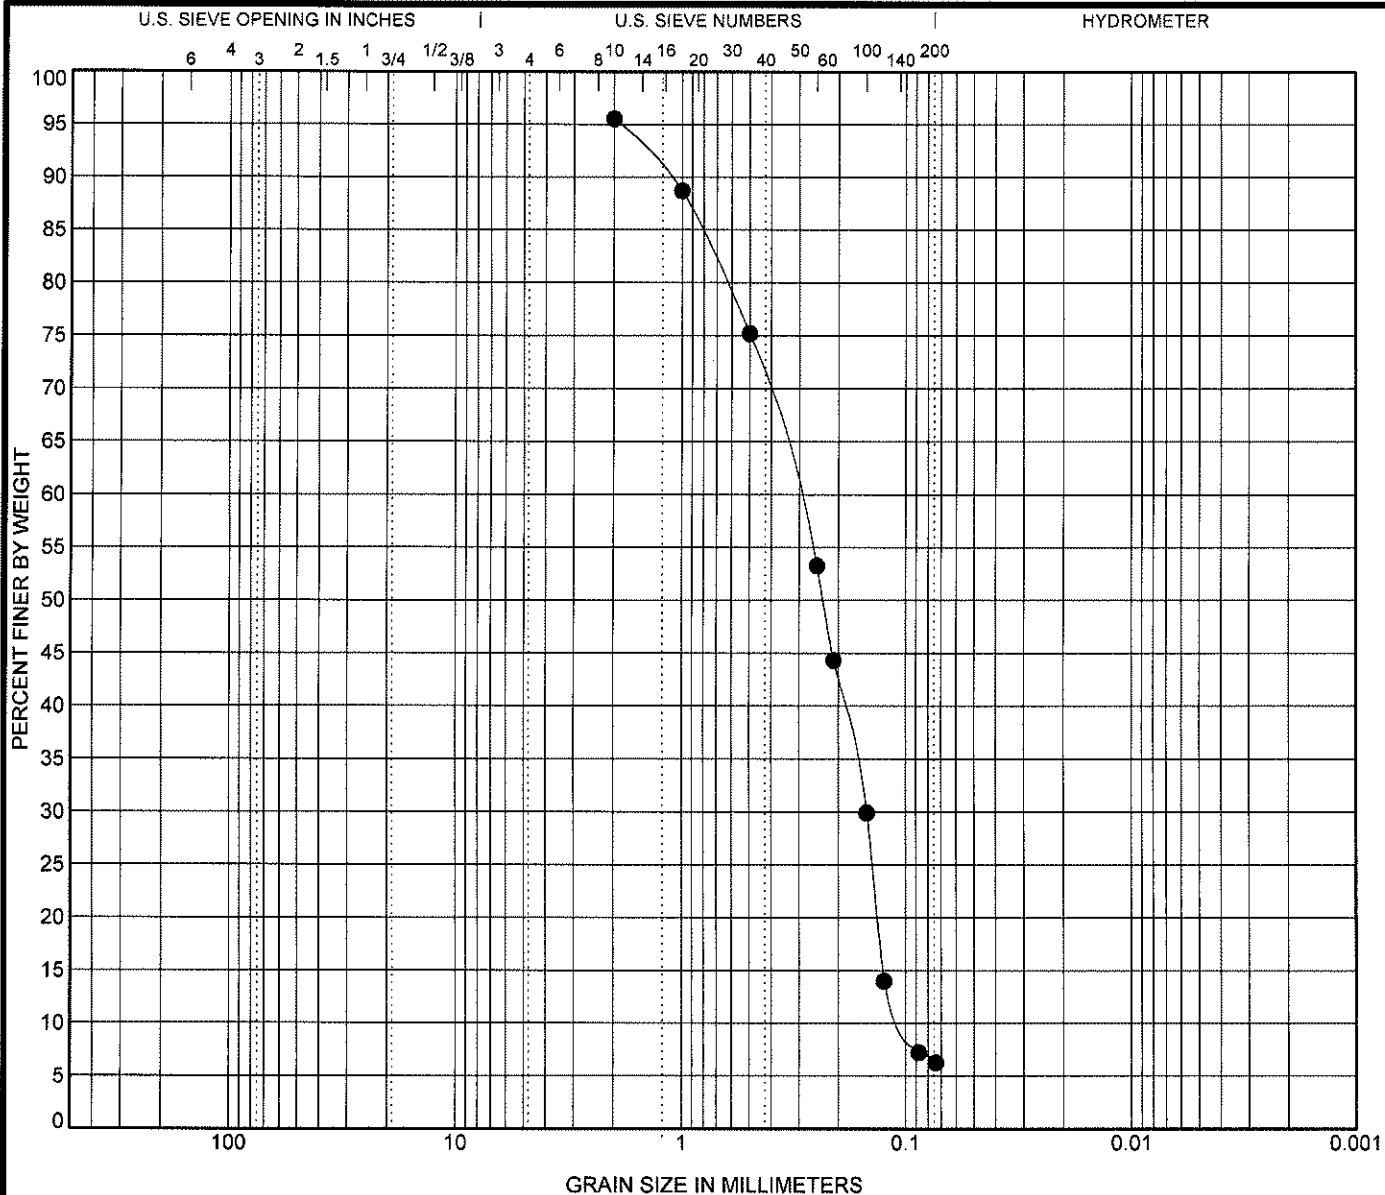

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● AA-07 (-29' to -30' NAVD)		Borrow Area (-29' to -30' NAVD)				0.71	3.04


Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● AA-07 (-29' to -30' NAVD)	2	0.309	0.149	0.102	0.0				



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Anchorage Basin Sand Source Investigation
Location: Anchorage Basin; Galveston, Texas
Number: G109112

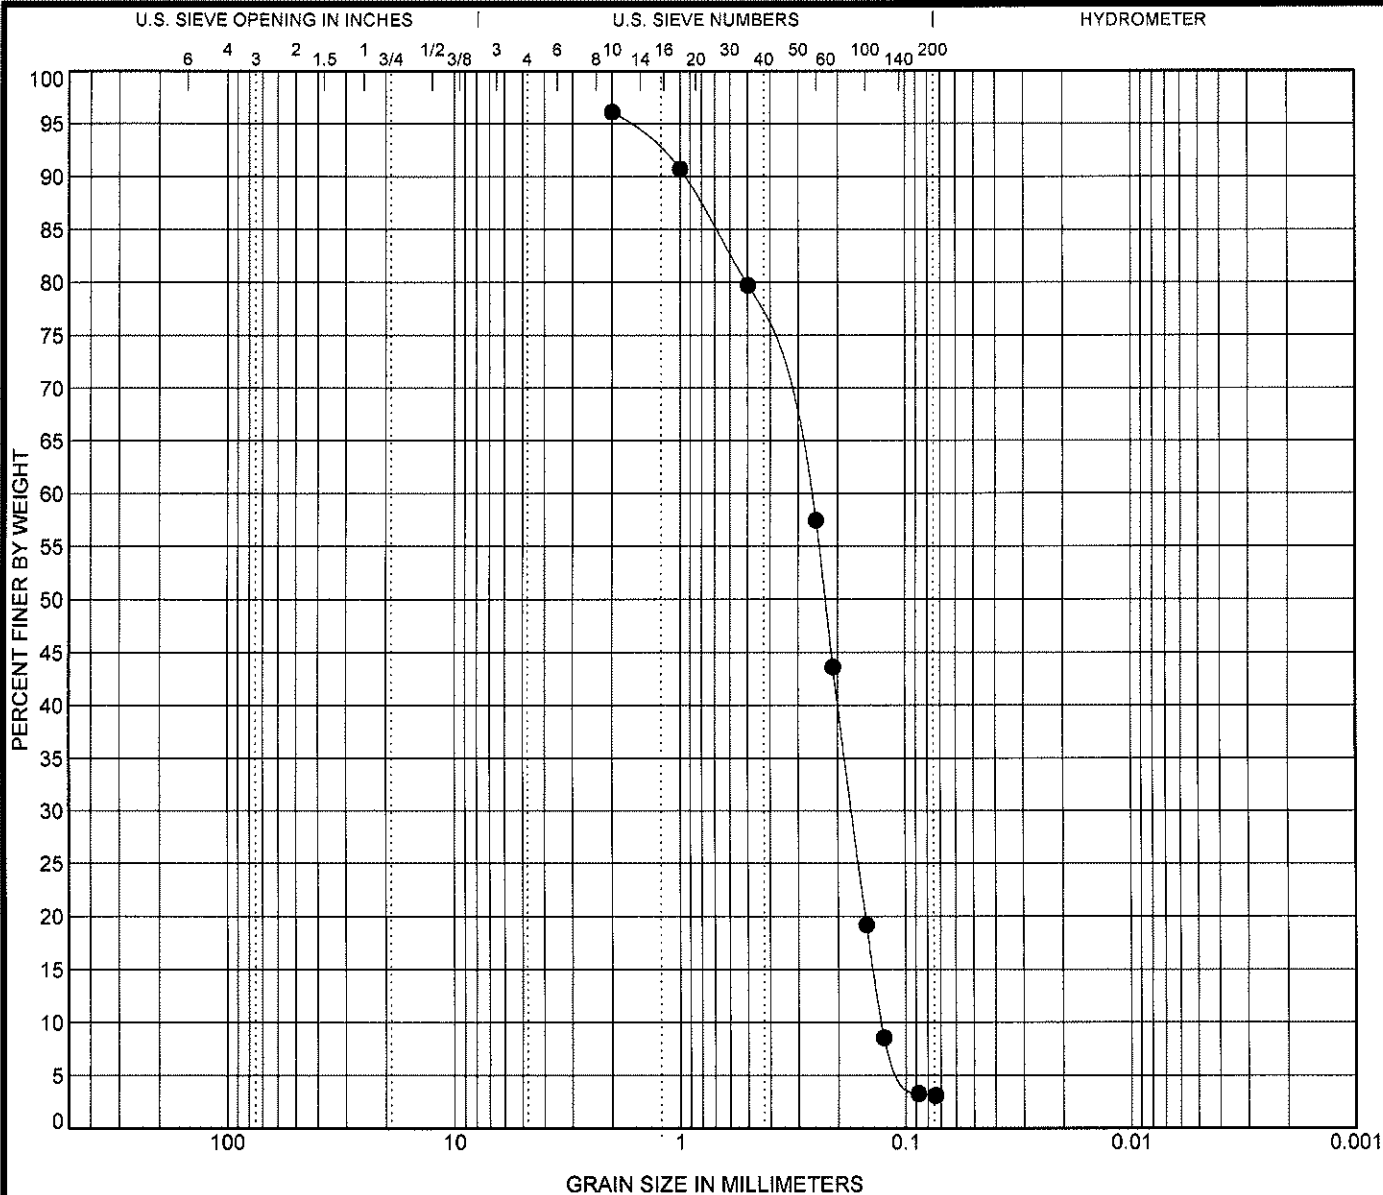

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● AA-07	(-32' to -33' NAVD)	Borrow Area (-32' to -33' NAVD)				0.87	2.11

Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● AA-07	(-32' to -33' NAVD)	2	0.271	0.173	0.128	0.0			





Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Anchorage Basin Sand Source Investigation
Location: Anchorage Basin; Galveston, Texas
Number: G109112

US GRAIN SIZE G109112 PROP. ANCHORAGE BASIN SAND SOURCE GPJ US LAB GDT 4/6/09

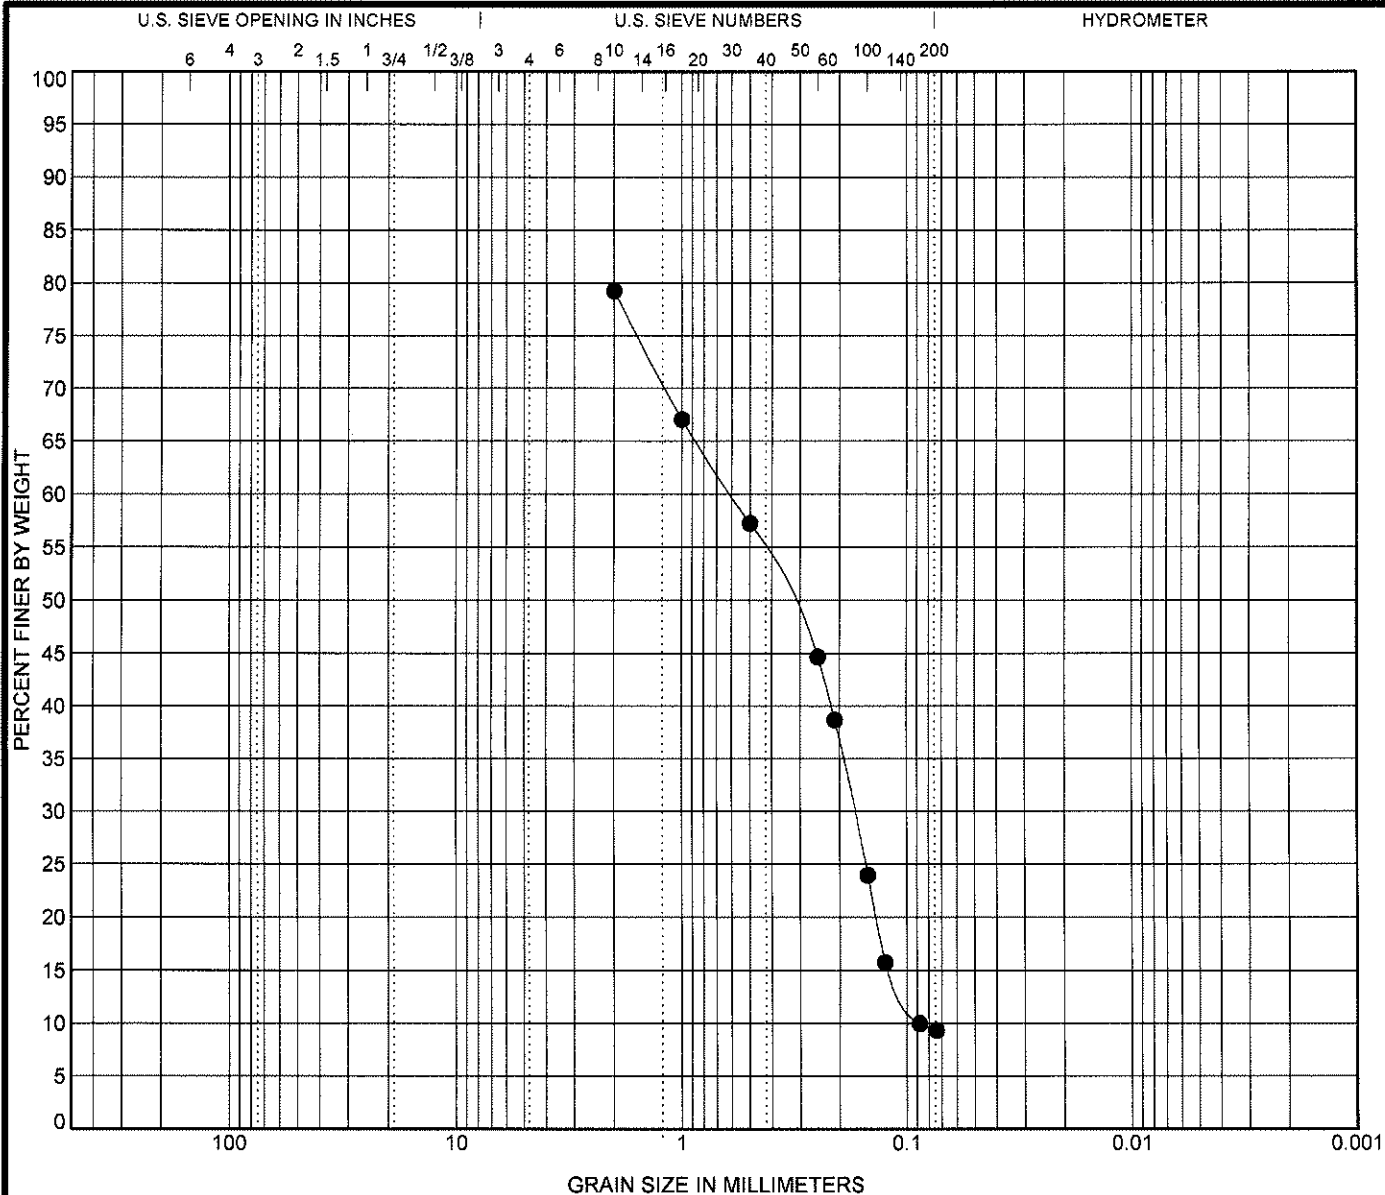

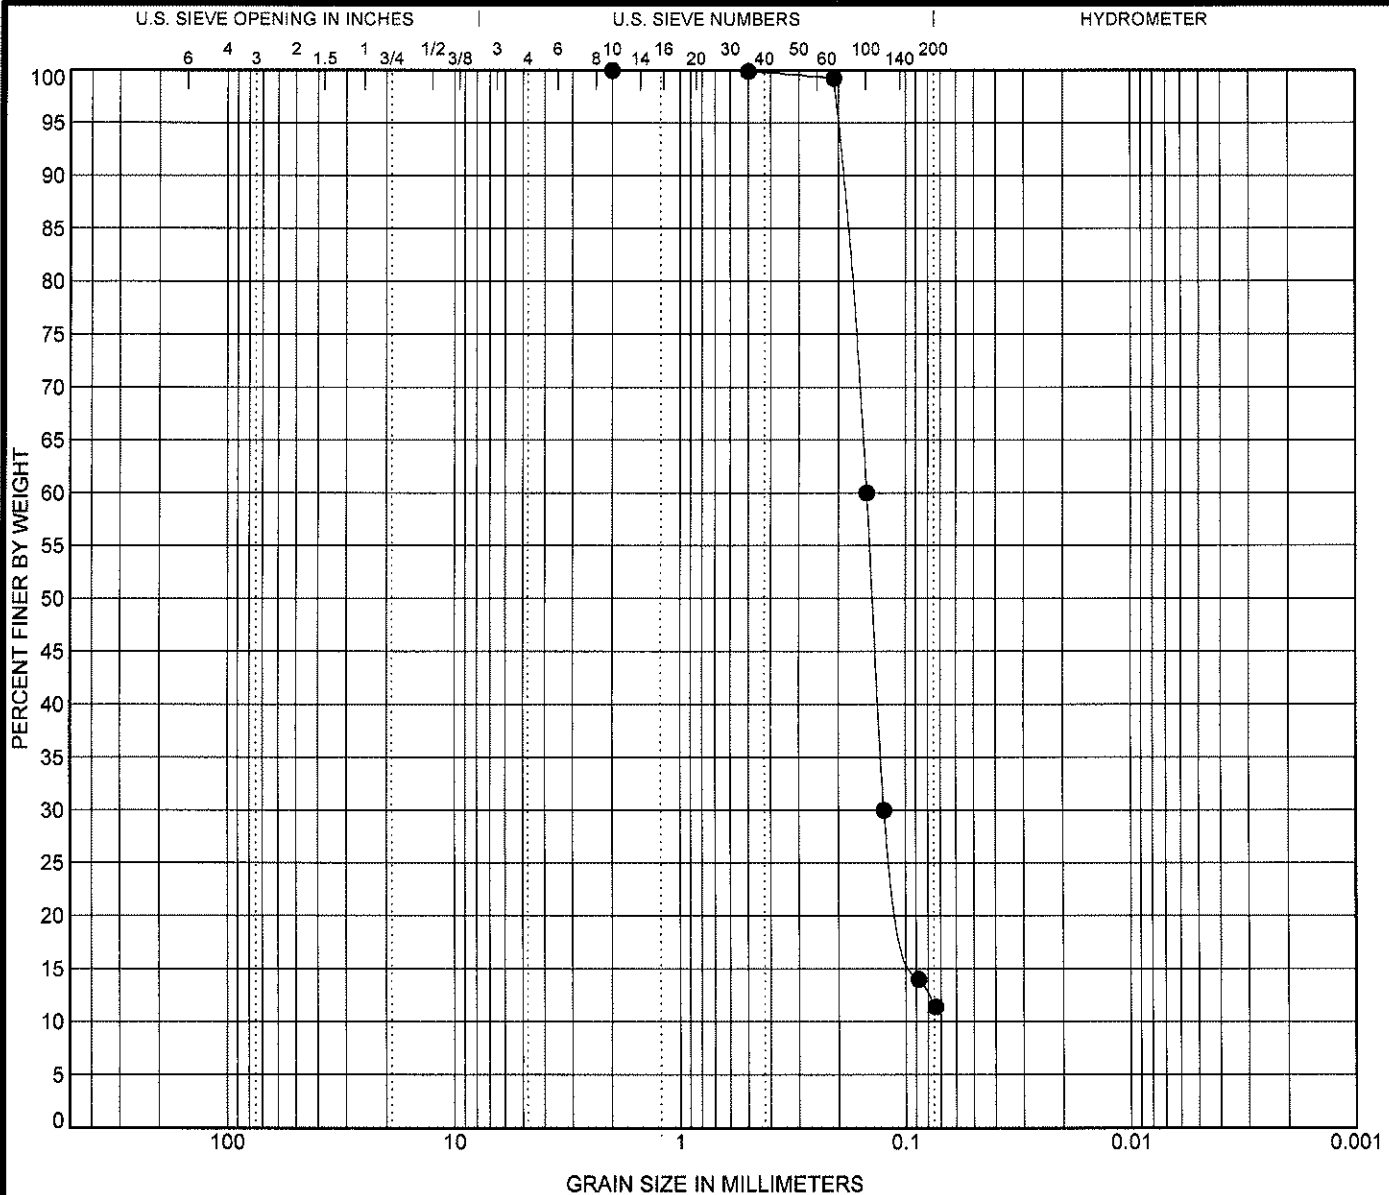

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● AA-07	(-35' to -36' NAVD)	Borrow Area (-35' to -36' NAVD)				1.55	2.21

Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● AA-07	(-35' to -36' NAVD)	2	0.149	0.125		0.0			



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Anchorage Basin Sand Source Investigation
Location: Anchorage Basin; Galveston, Texas
Number: G109112

LOG OF BORING AA-07

SHEET 1 OF 1



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

CLIENT: HDR Engineering, Inc.

PROJECT: Anchorage Basin Sand Source Investigation

LOCATION: Anchorage Basin; Galveston, Texas

NUMBER: G109112

DATE(S) DRILLED: 03/13/09 - 03/13/09

DRILLING METHOD(S):

Vibracore

GROUNDWATER INFORMATION:

SURFACE ELEVATION: -26' NAVD

DESCRIPTION OF STRATUM

POORLY GRADED SAND with shell fragments, brown and gray.

Same as above.

Same as above.

POORLY GRADED SAND with clay and shell fragments, gray.

Same as above.

Same as above.

POORLY GRADED SAND with shell fragments, gray.

Same as above.

Same as above, with clay.

POORLY GRADED SAND with clay and shell fragments, gray.

Boring was extended to an elevation of -36-feet NAVD during the drilling operations.

N - STANDARD PENETRATION TEST RESISTANCE
P - POCKET PENETROMETER RESISTANCE
T - POCKET TORVANE SHEAR STRENGTH

REMARKS:

Boring depth and location was determined by HDR Engineering, Inc. Boring operations were performed by Ocean Surveys, Inc.
GPS Coord. N. 13,697,972' E. 3,317,029'

LOG OF BORING G109112 PROP. ANCHORAGE BASIN SAND SOURCE G.P.I. ROCK ETL GDT 4/28/09