




COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-4 7.0						


Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-4 7.0	4.75	2.096	0.448		0.0	74.0	21.0	

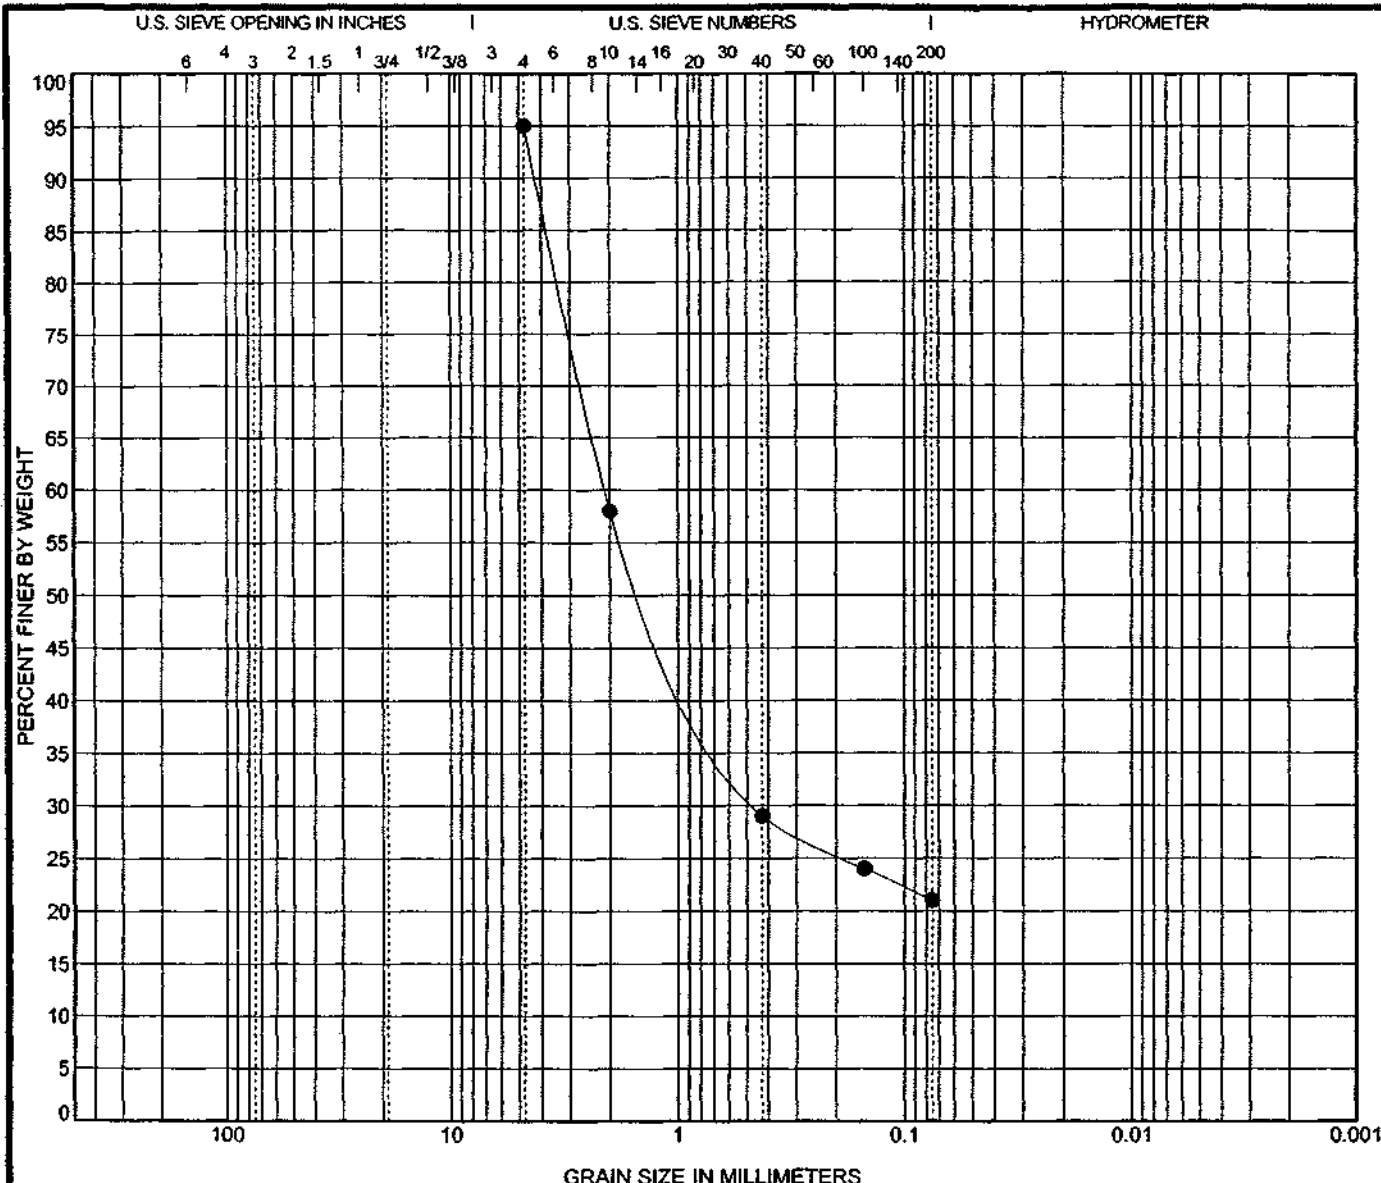

Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
Location: Corpus Christi, Texas
Number: C0200586

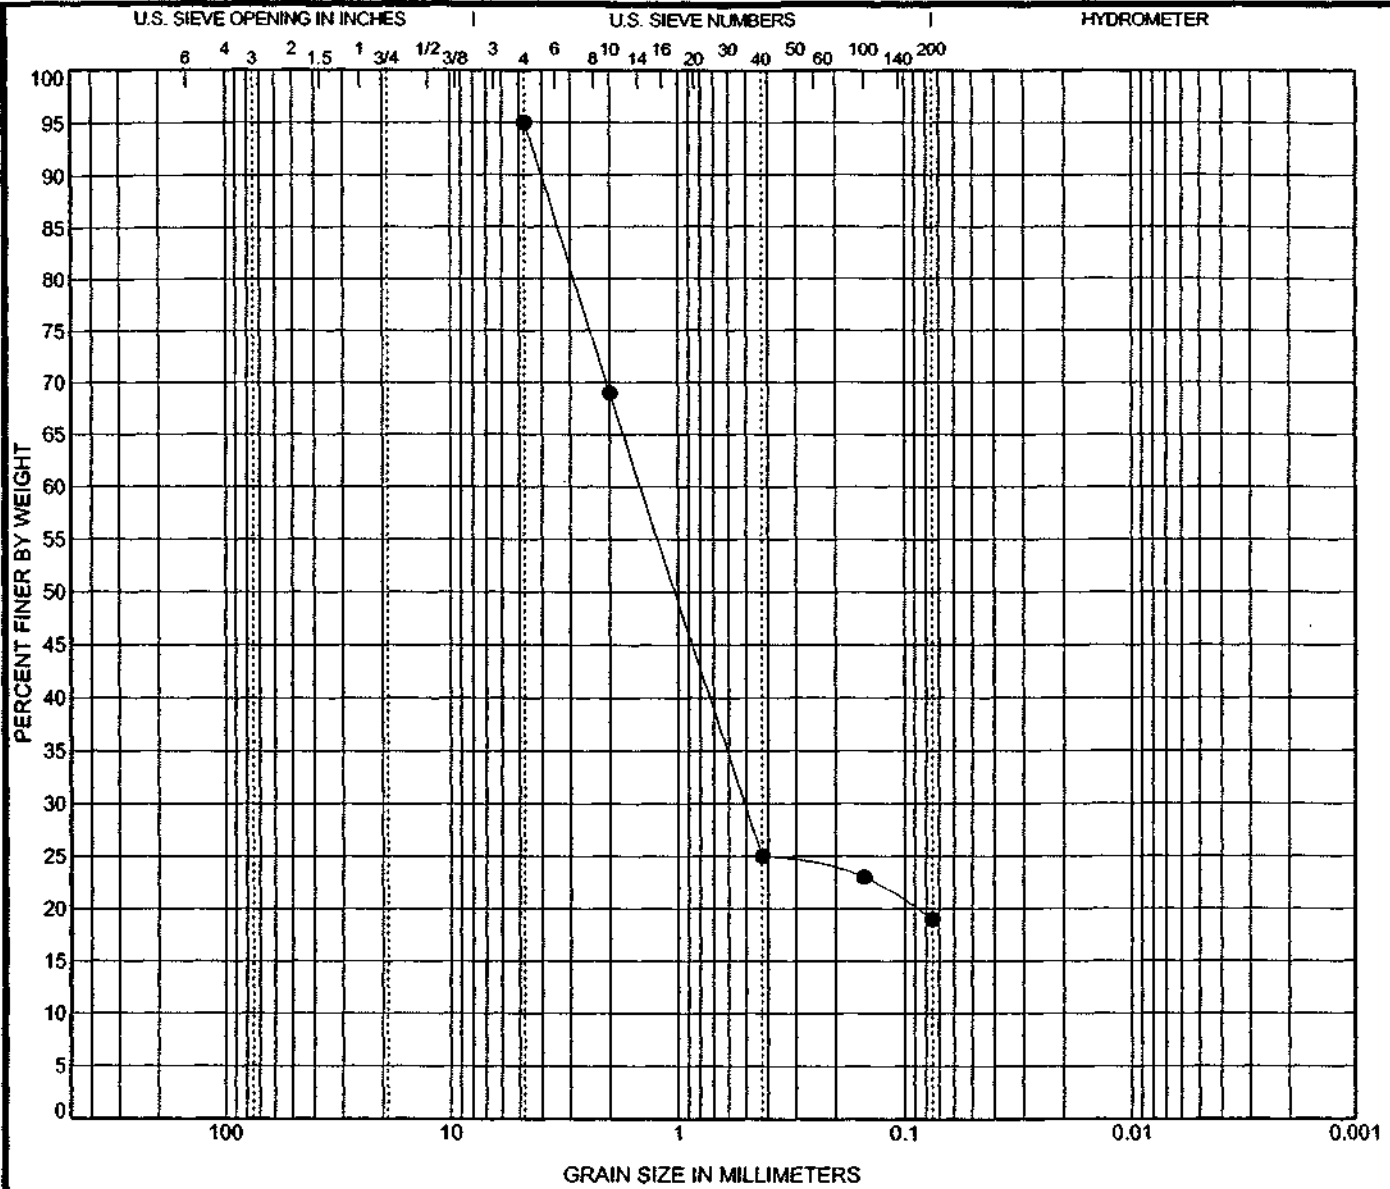

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-4 8.0						

Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-4 8.0	4.75	1.457	0.507		0.0	76.0	19.0	




Rock Engineering and Testing Laboratory, Inc.
 4910 Neptune Street
 Corpus Christi, Texas 78405
 Telephone: (361) 883-4555
 Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
 Location: Corpus Christi, Texas
 Number: C0200586

U.S. GRAIN SIZE C02586.GPJ U.S. LAB.GDT 9/9/02

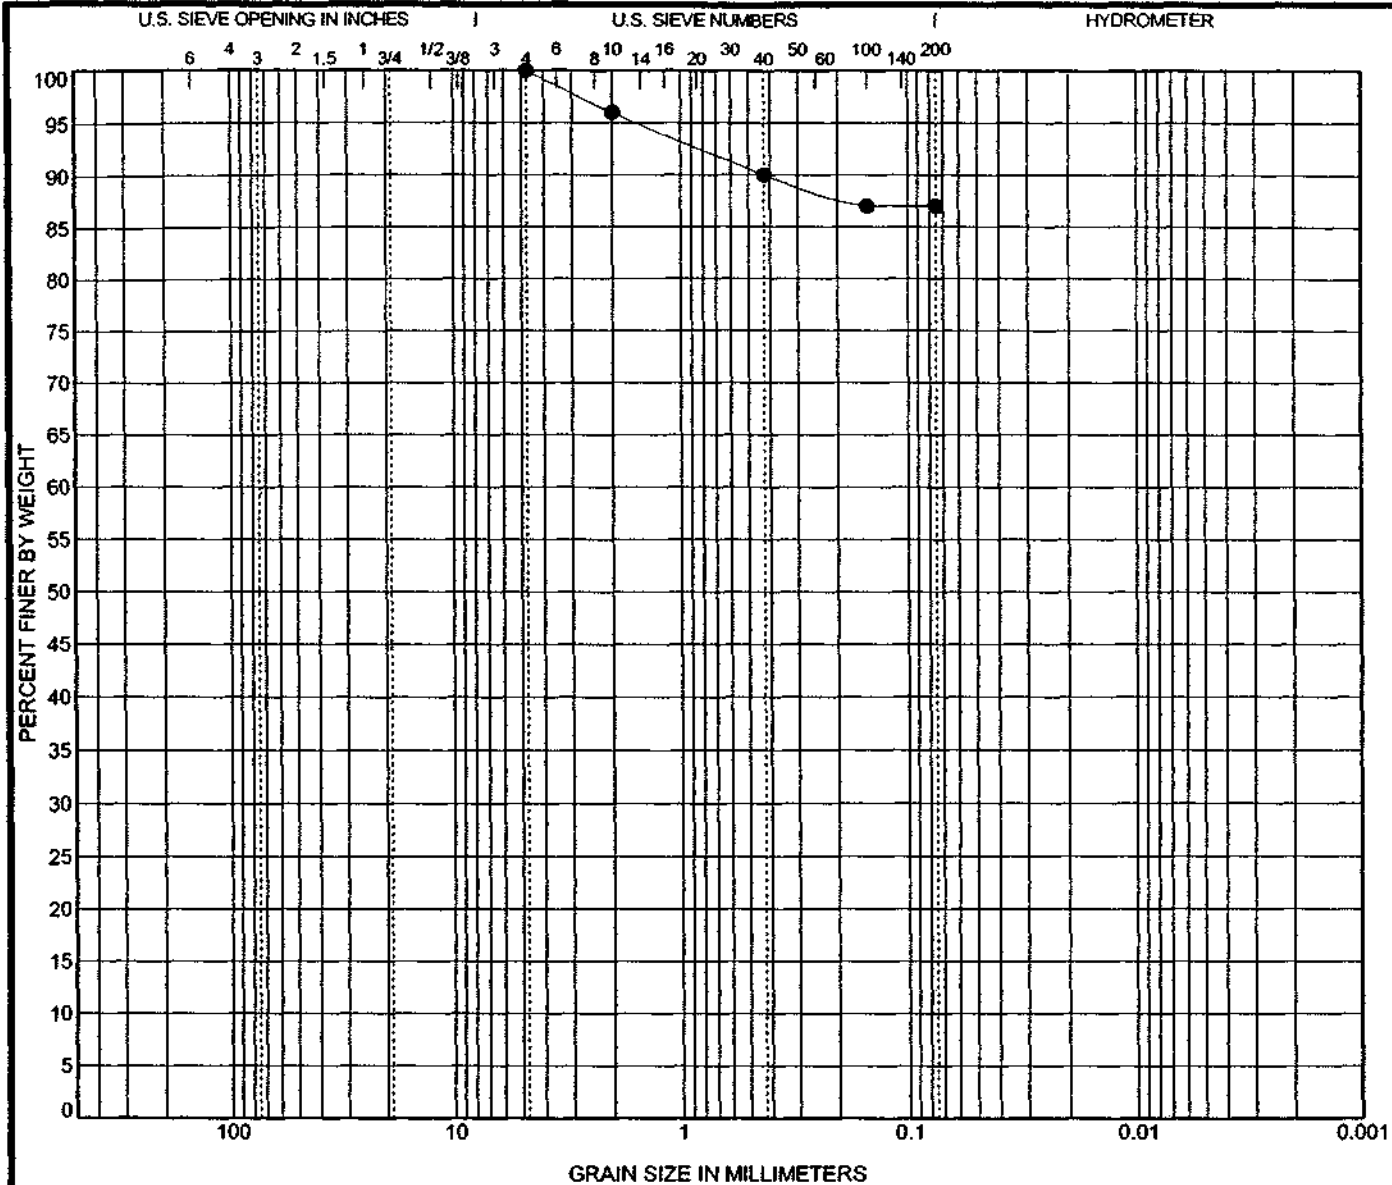

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-4 9.0						

Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-4 9.0	4.75				0.0	13.0	87.0	



Rock Engineering and Testing Laboratory, Inc.
 4910 Neptune Street
 Corpus Christi, Texas 78405
 Telephone: (361) 883-4555
 Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
 Location: Corpus Christi, Texas
 Number: C0200586

U.S. GRAIN SIZE C02586.GPJ, US LAB.GDT 9/9/02