

LOG OF BORING A-4

SHEET 1 of 1



Rock Engineering & Testing Laboratory
6817 Leopard Street
Corpus Christi, TX 78409-1703
Telephone: 361-883-4555
Fax: 361-883-4711

CLIENT: LP Galveston, Inc.
PROJECT: Pepper Cove Project
LOCATION: Laguna Drive; Galveston, TX
NUMBER: G115231

DATE(S) DRILLED: 12/8/15 - 12/8/15

DRILLING METHOD(S):

Hollow Stem Auger

GROUNDWATER INFORMATION:

Groundwater (GW) was encountered at a depth of 3-feet during drilling.
Wet and Caved at 5-feet upon completion.
24-Hour Delayed Readings: GW at 2-feet and Caved at 2½-feet.

SURFACE ELEVATION: N/A

DESCRIPTION OF STRATUM

POORLY GRADED SAND, brown, moist, loose.

Same as above.

Same as above.

POORLY GRADED SAND, brown, moist, loose.

Same as above, very loose.

SILTY SAND with clay, gray, moist, very loose.

Same as above.

Same as above, with trace clay, loose.

SILTY SAND with trace clay, gray, moist, loose.

Same as above.

Same as above, very loose.

CLAYEY SAND with shell, gray, moist, very soft.

SANDY FAT CLAY, dark brown, moist, very soft.

Same as above.

Same as above.

SANDY FAT CLAY, dark brown, moist, very soft.

Same as above, firm.


Boring was terminated at a depth of 25½-feet.

N - STANDARD PENETRATION TEST RESISTANCE
P - POCKET PENETROMETER RESISTANCE
T - POCKET TORVANE SHEAR STRENGTH

REMARKS:

Boring location and depth were determined by Jones | Carter. Drilling operations were performed by RETL at GPS Coordinates N 29° 8' 1.80" W 95° 3' 33.19".

LOG OF BORING G115231 PEPPER COVE PROJECT.GPJ ROCK ETI.LGDT 1/28/16

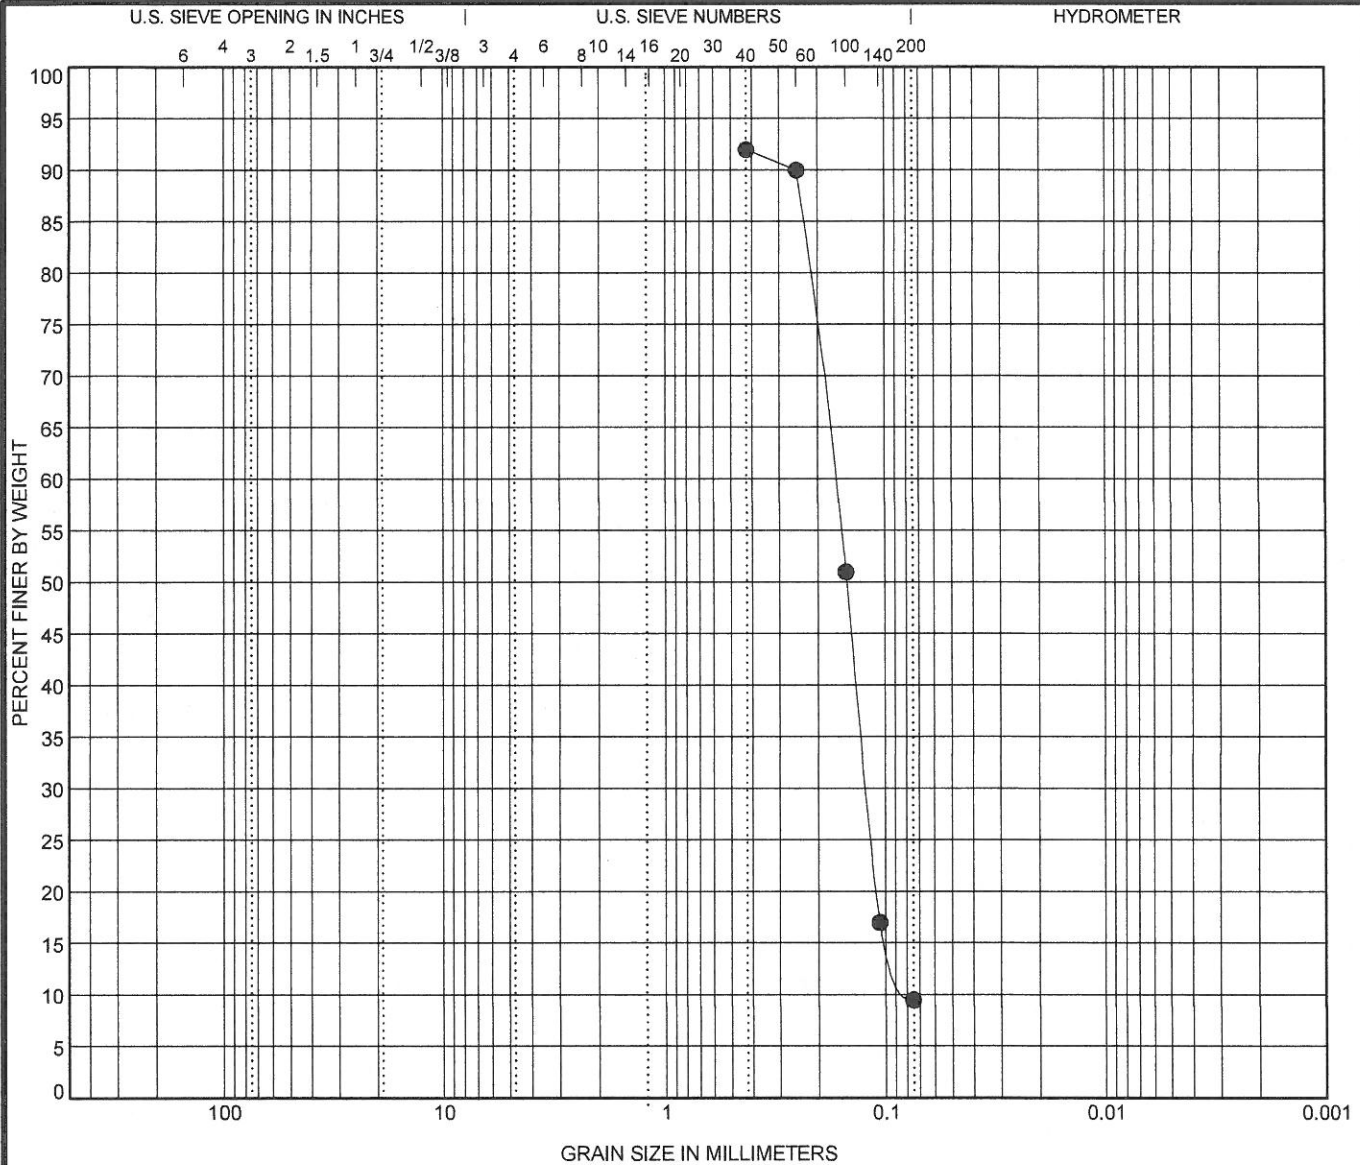

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID		Depth	Classification				LL	PL	PI	Cc	Cu
●	A-4	1-17'								1.13	2.20
Specimen ID		Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay	
●	A-4	1-17'	0.425	0.169	0.121	0.077	0.0	82.5	9.5		




Rock Engineering & Testing Laboratory
6817 Leopard Street
Corpus Christi, TX 78409-1703
Telephone: 361-883-4555
Fax: 361-883-4711

GRAIN SIZE DISTRIBUTION

Project: Pepper Cove Project

Location: Laguna Drive; Galveston, TX

Number: G115231

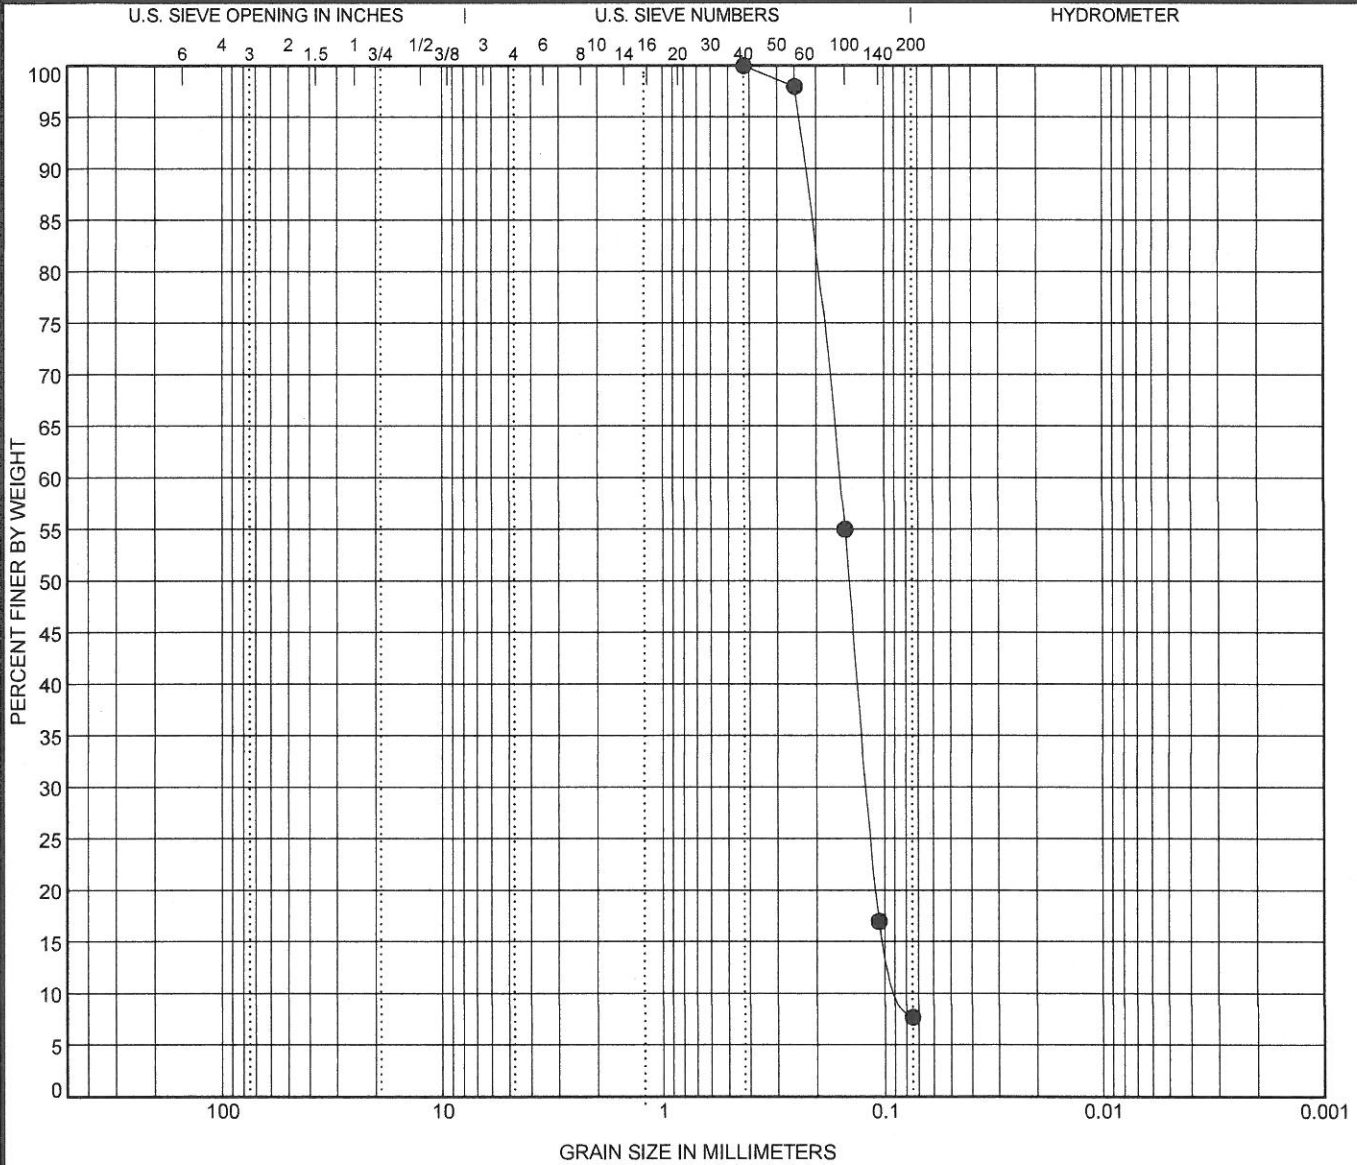

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID		Depth	Classification					LL	PL	PI	Cc	Cu
●	A-4	1-17'									1.10	1.95
Specimen ID		Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay		
●	A-4	1-17'	0.425	0.159	0.119	0.082	0.0	92.3	7.7			




Rock Engineering & Testing Laboratory
6817 Leopard Street
Corpus Christi, TX 78409-1703
Telephone: 361-883-4555
Fax: 361-883-4711

GRAIN SIZE DISTRIBUTION

Project: Pepper Cove Project

Location: Laguna Drive; Galveston, TX

Number: G115231

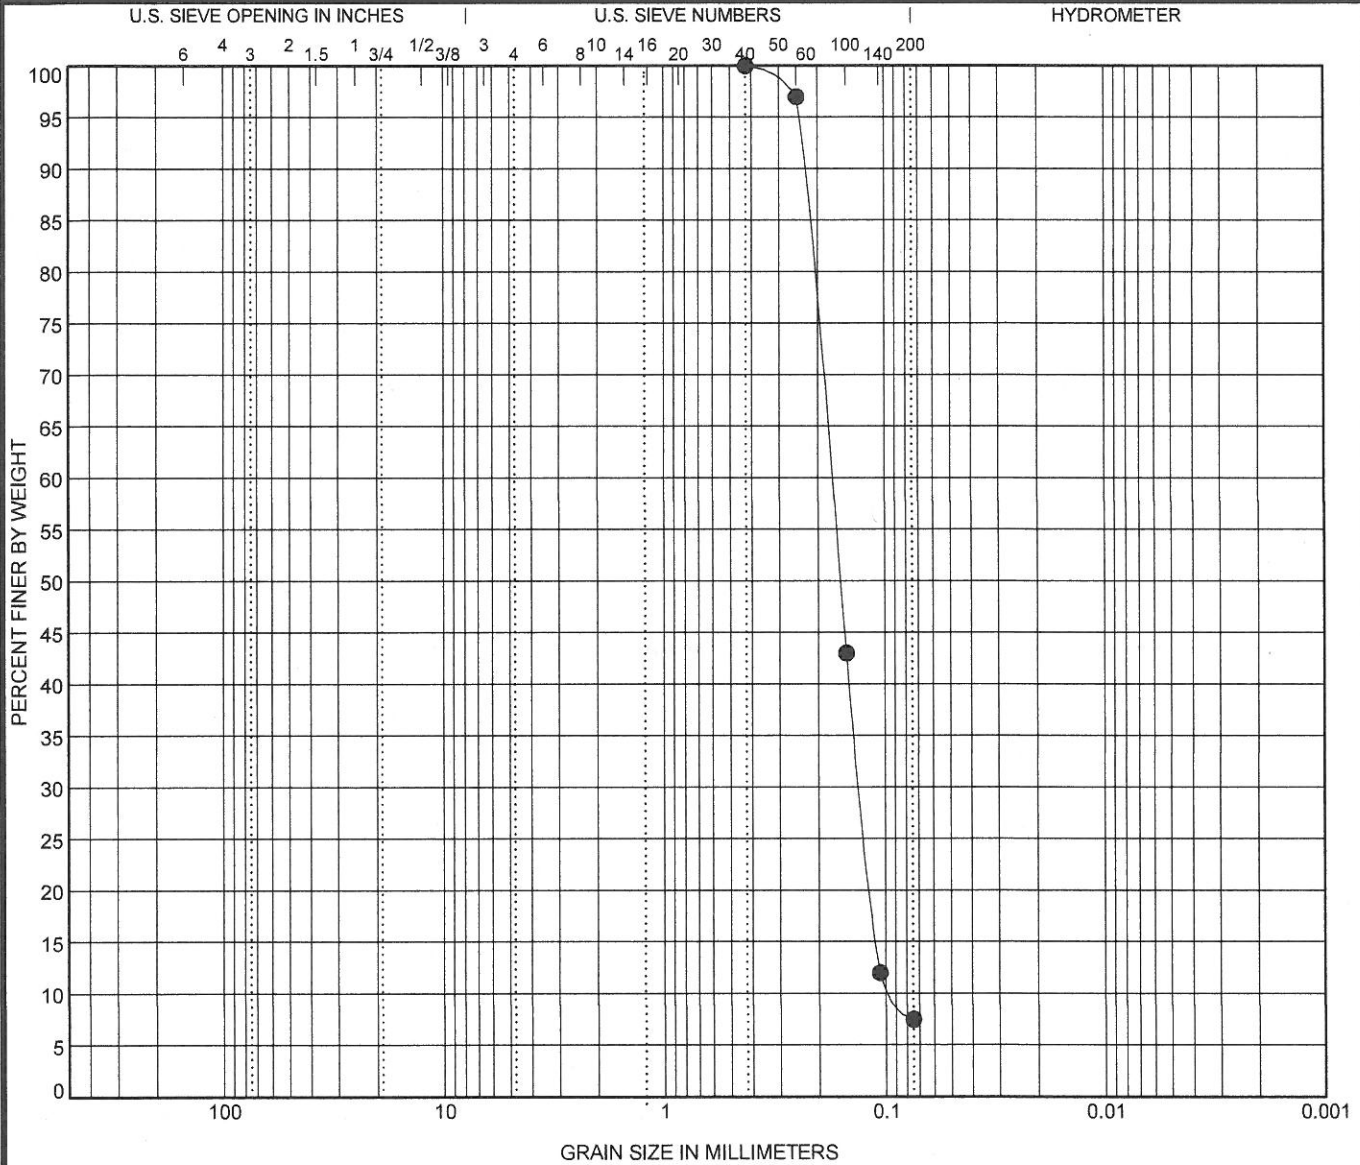

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification					LL	PL	PI	Cc	Cu
● A-4	1 1/2-7 1/2'									1.05	1.94

Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● A-4	1 1/2-7 1/2'	0.425	0.176	0.13	0.091	0.0	92.5	7.5	



Rock Engineering & Testing Laboratory
6817 Leopard Street
Corpus Christi, TX 78409-1703
Telephone: 361-883-4555
Fax: 361-883-4711

GRAIN SIZE DISTRIBUTION

Project: Pepper Cove Project

Location: Laguna Drive; Galveston, TX

Number: G115231