




COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification			Classification	LL	PL	PI	Cc	Cu
●	B-7B	6.5	POORLY GRADED SAND with GRAVEL(SP)				0.89	7.00


Specimen Identification		D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
●	B-7B	6.5	4.75	2.21	0.79	0.316	0.0	79.0	4.0

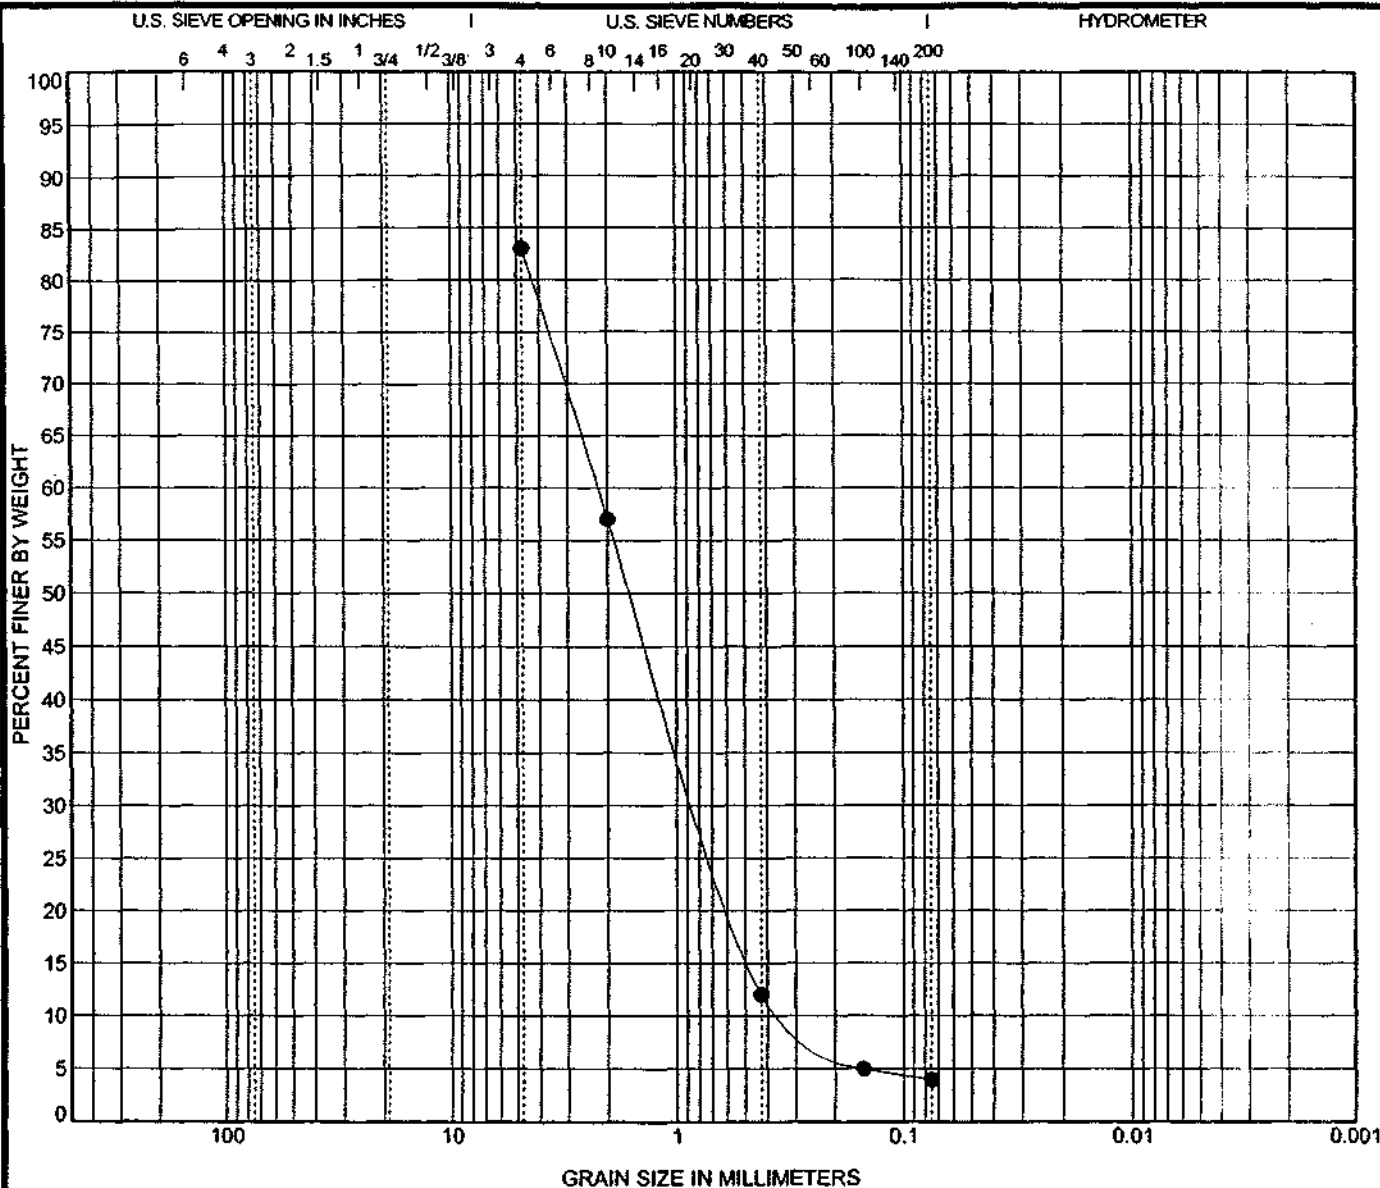

Rock Engineering and Testing Laboratory, Inc.
 4910 Neptune Street
 Corpus Christi, Texas 78405
 Telephone: (361) 883-4555
 Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
 Location: Corpus Christi, Texas
 Number: C0200586

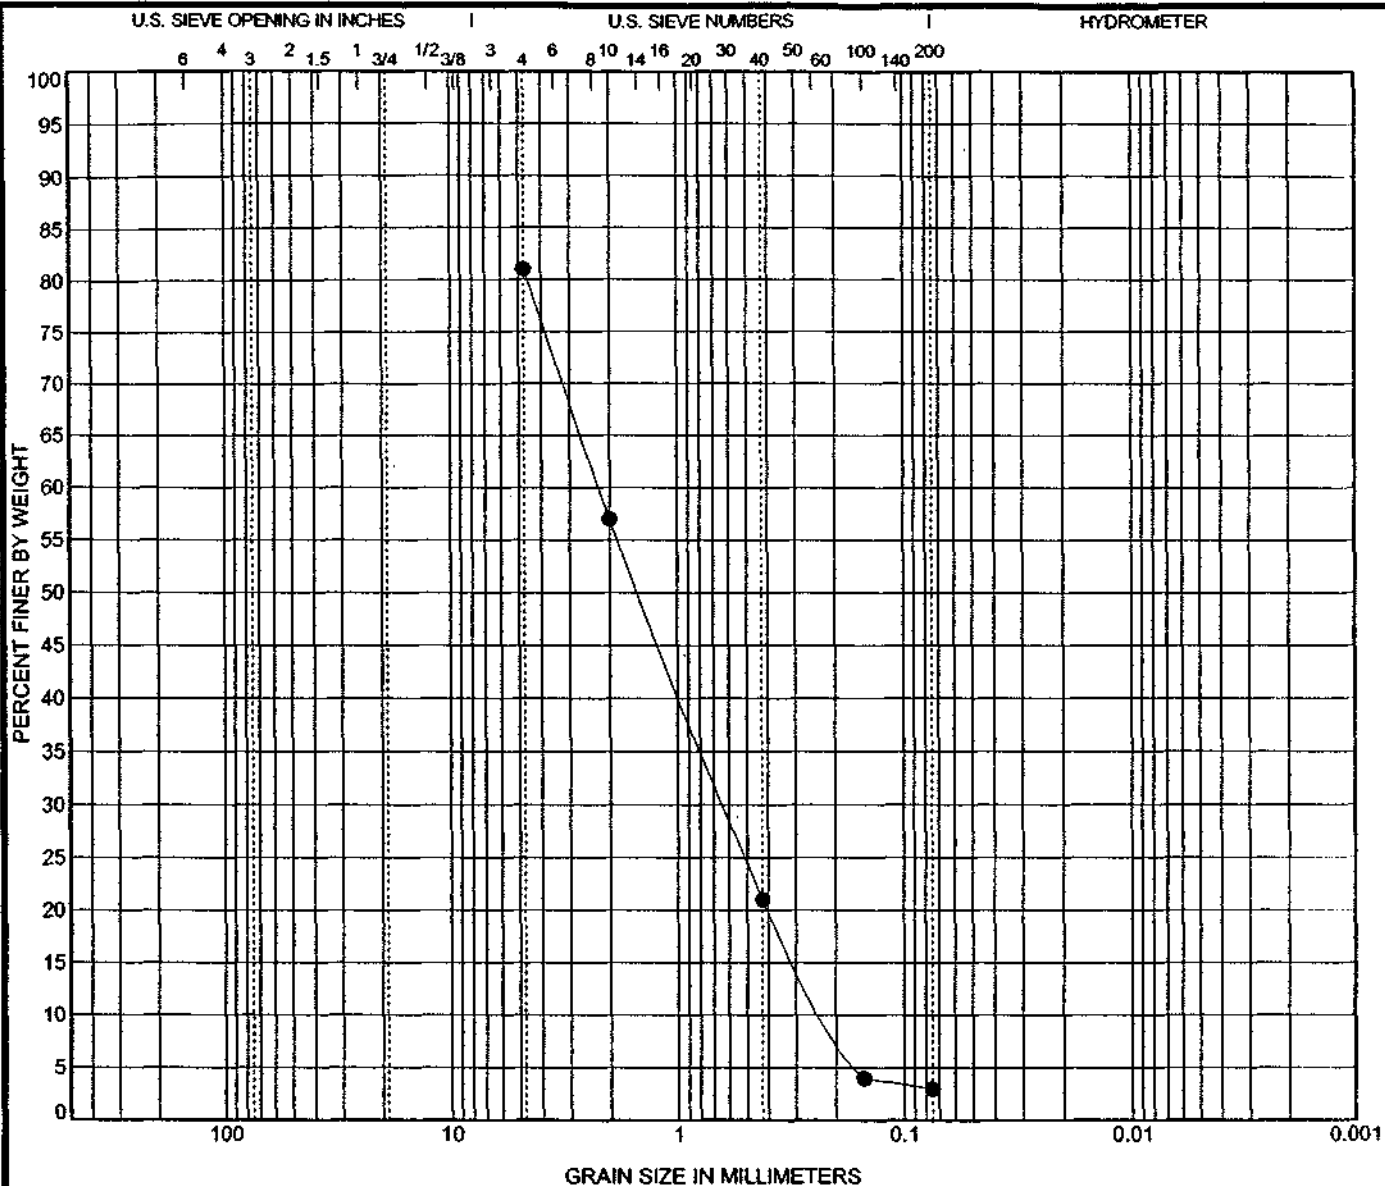

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification		Classification				LL	PL	PI	Cc	Cu	
●	B-7B	7.5	POORLY GRADED SAND with GRAVEL(SP)							0.81	10.29
Specimen Identification		D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay		
●	B-7B	7.5	4.75	2.228	0.626	0.217	0.0	78.0	3.0		




Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration

Location: Corpus Christi, Texas

Number: C0200586

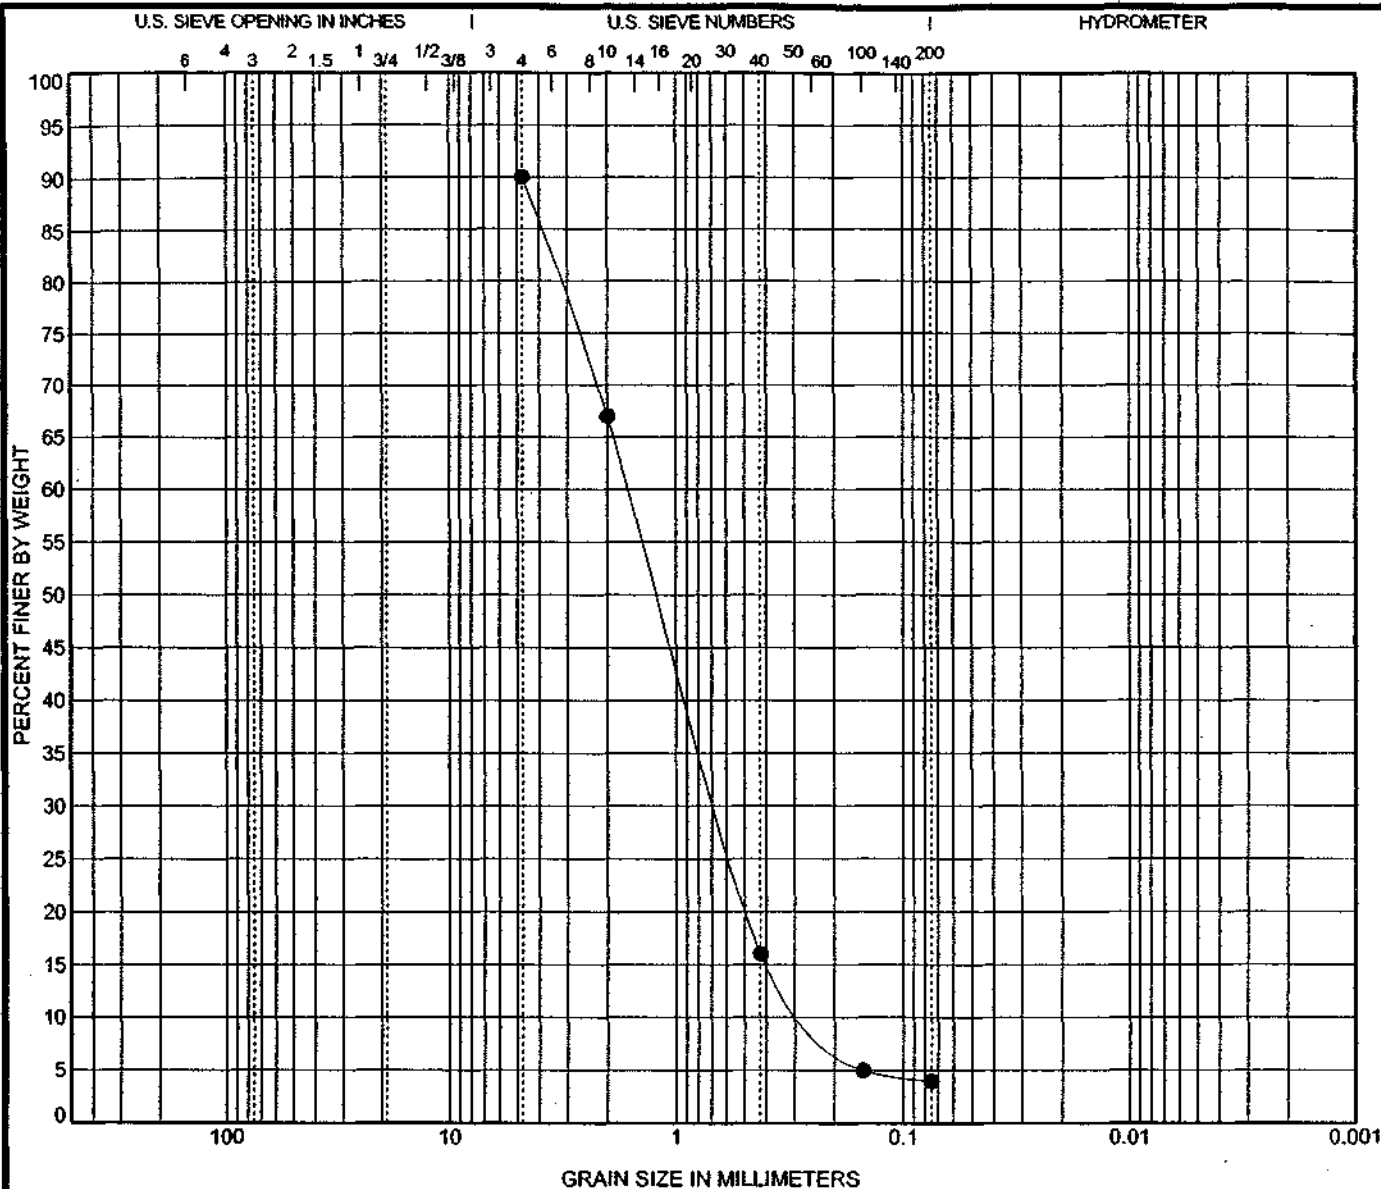

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-7B 8.5	WELL-GRADED SAND(SW)				1.09	6.71

Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-7B 8.5	4.75	1.617	0.65	0.241	0.0	86.0		4.0




Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration

Location: Corpus Christi, Texas

Number: C0200586

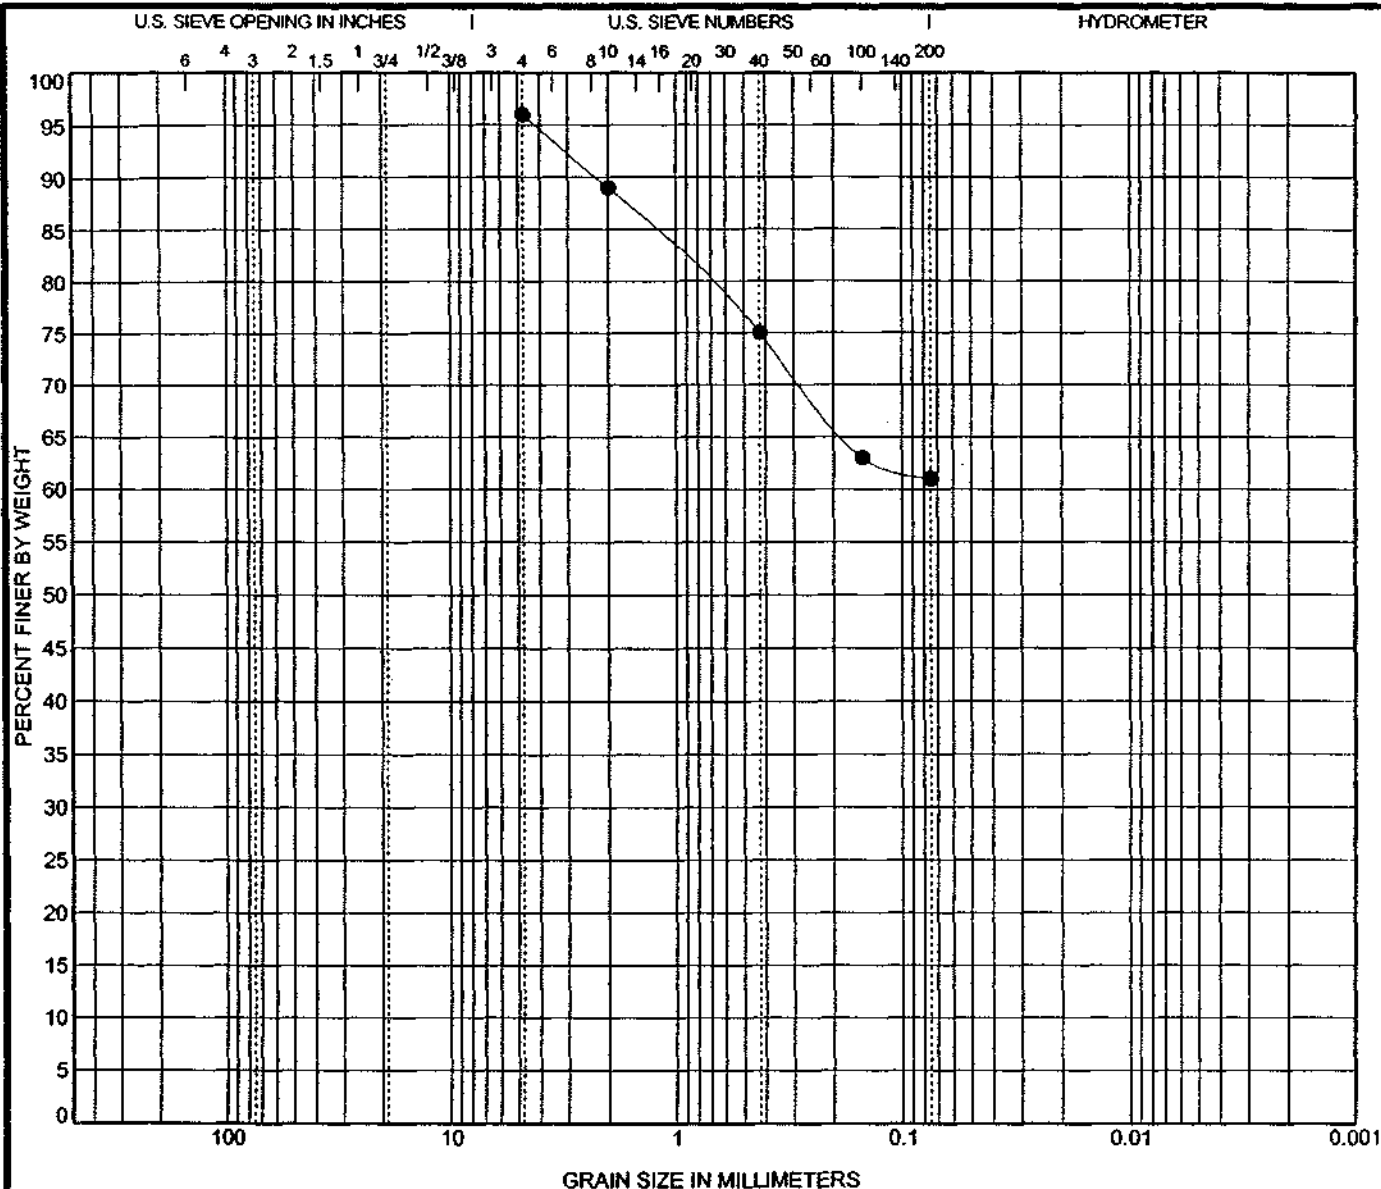

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-7B 9.5						

Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-7B 9.5	4.75				0.0	35.0	61.0	



Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
Location: Corpus Christi, Texas
Number: C0200586