

LOG OF BORING B-3

SHEET 1 of 1



Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

CLIENT: Shiner Moseley & Associates, Inc.
PROJECT: Delehide Cove Wetlands Restoration
LOCATION: Galveston County, Texas
NUMBER: C0100637

DATE(S) DRILLED: 10/01/01 - 10/01/01

FIELD DATA

LABORATORY DATA

DRILLING METHOD(S):

Hollow Stem Auger

GROUNDWATER INFORMATION:

Water depth approximately 5'

SURFACE ELEVATION: N/A

DESCRIPTION OF STRATUM

POORLY GRADED SAND, with clay, gray, very loose. Qc= 3

Qc= 2

Same as above. Qc= 2

Qc= 6


Same as above. Qc= 6


Boring terminated at a depth of 5.5-feet.

REMARKS:

Boring location was determined by Shiner Moseley and Associates, Inc. and boring was performed by RETL at Northing: 13650995 Easting: 3259704.

N - STANDARD PENETRATION TEST RESISTANCE
P - POCKET PENETROMETER RESISTANCE
T - POCKET TORVANE SHEAR STRENGTH

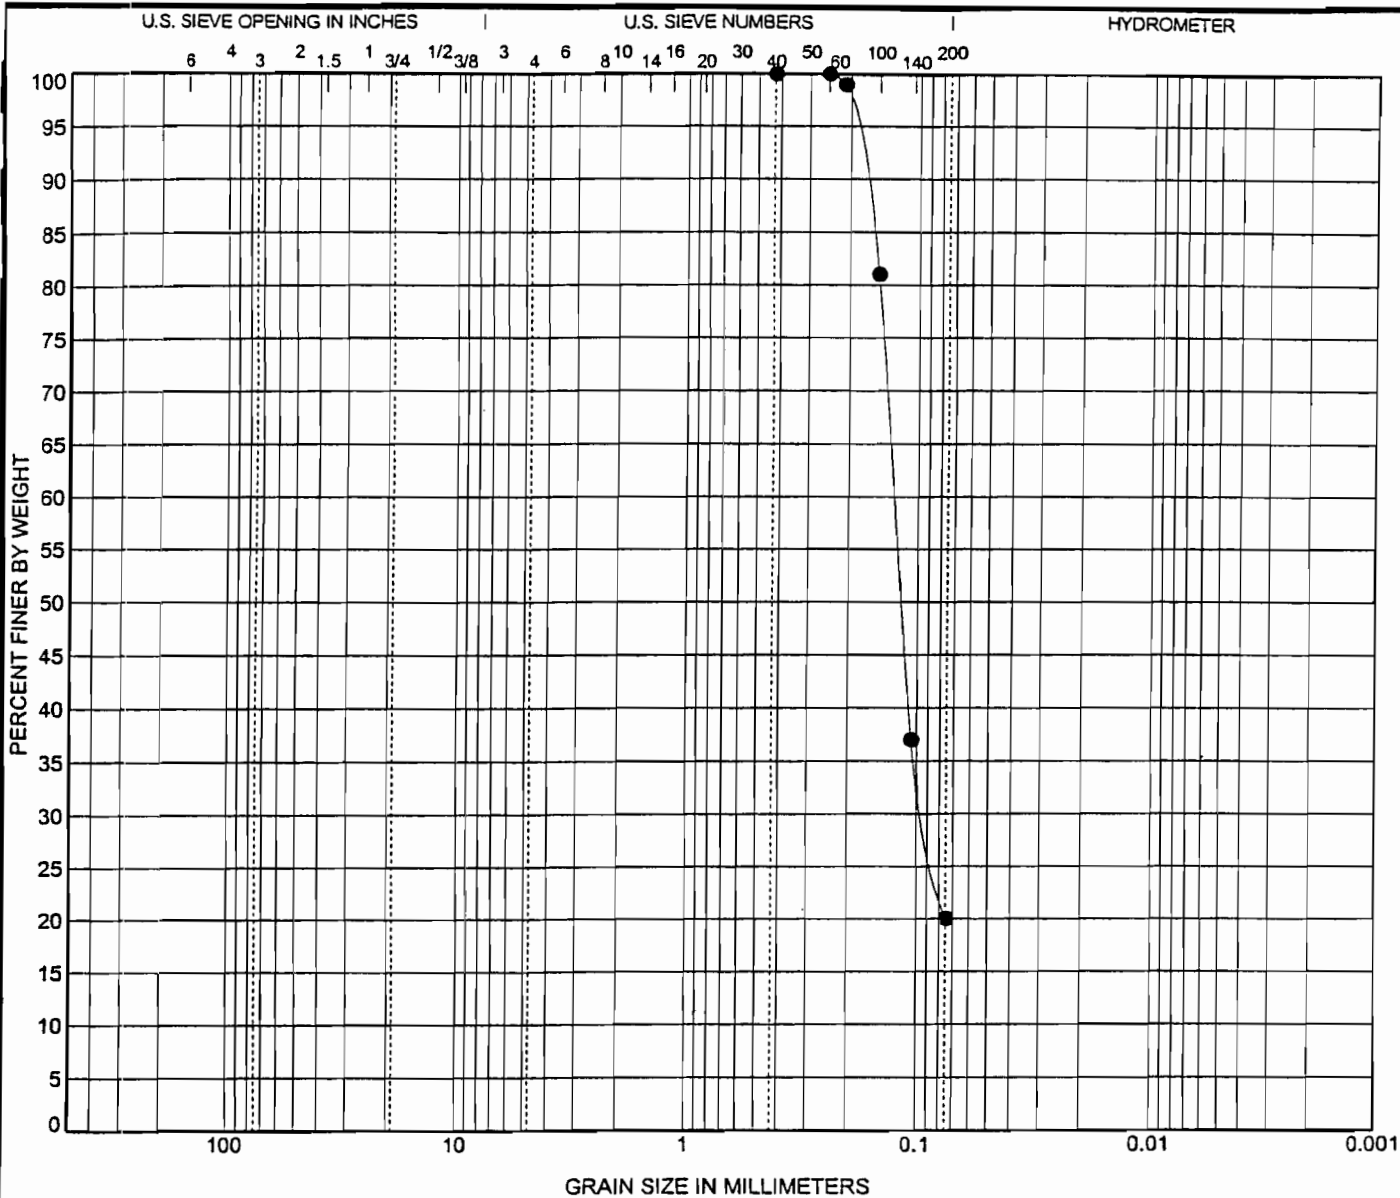

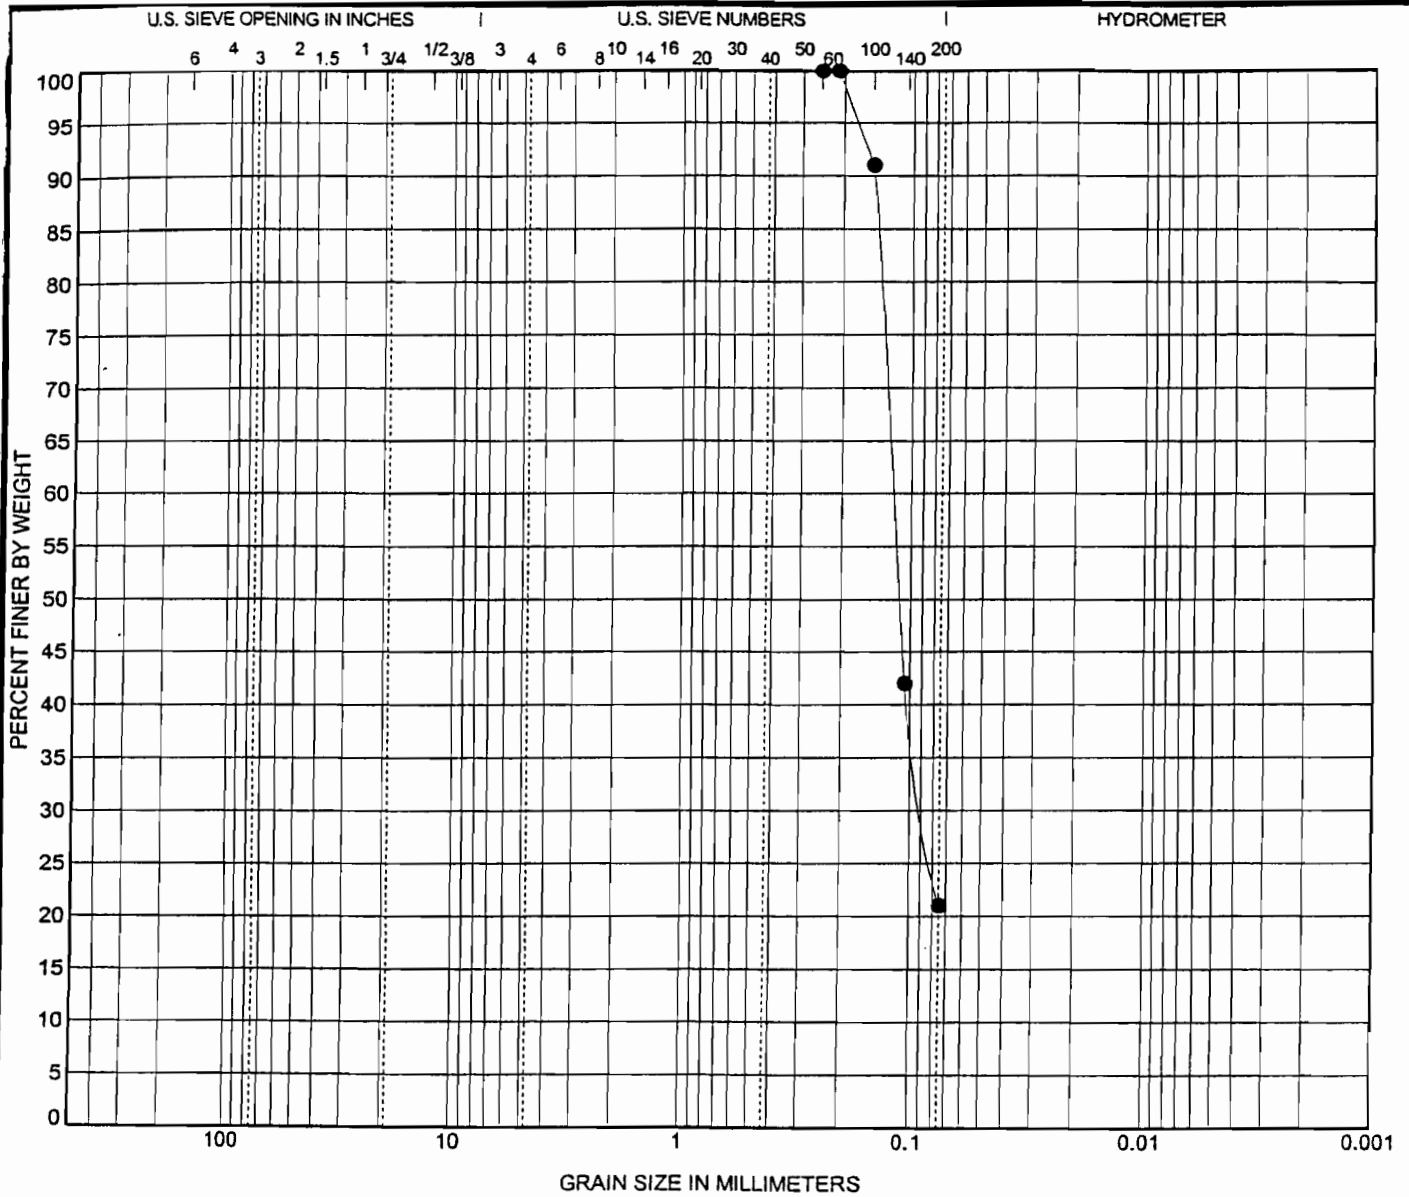

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-3 4.0						

Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-3 4.0	0.25	0.12	0.087		0.0	79.0	21.0	



Rock Engineering and Testing Laboratory, Inc.
 4910 Neptune Street
 Corpus Christi, Texas 78405
 Telephone: (361) 883-4555
 Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Delehide Cove Wetlands Restoration

Location: Galveston County, Texas

Number: C0100637