



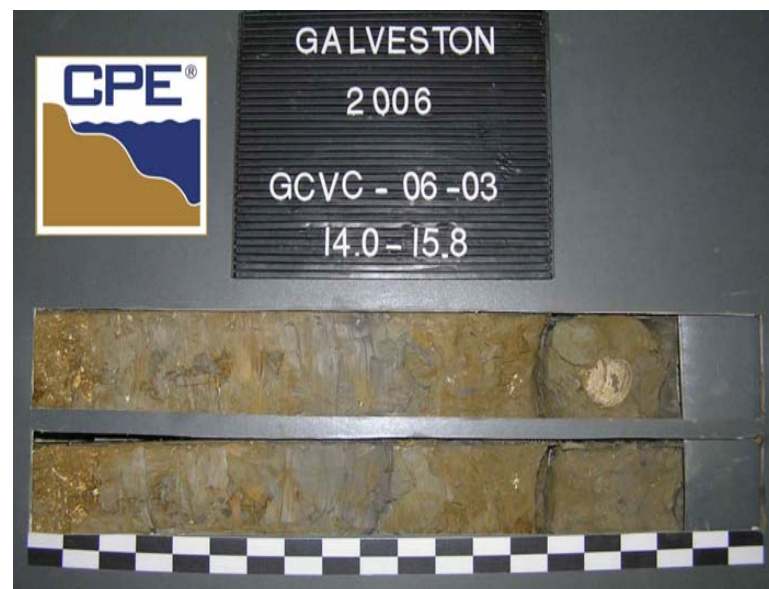

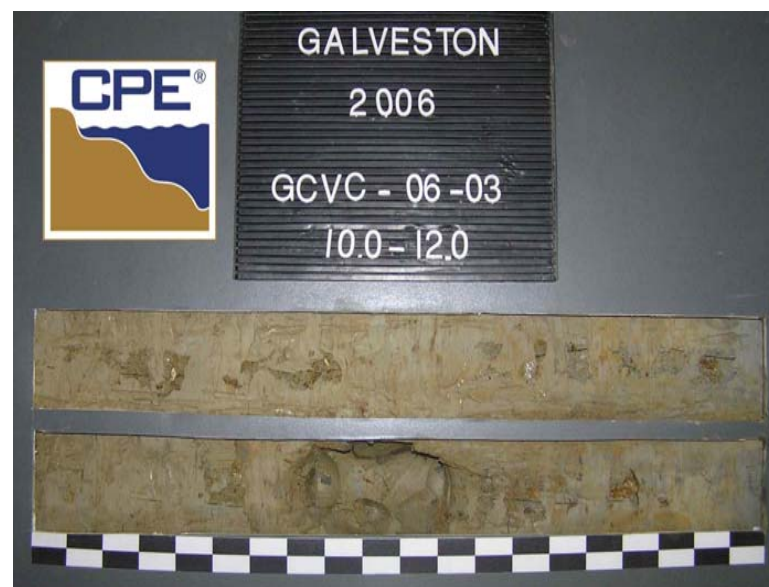

DRILLING LOG		DIVISION	INSTALLATION	SHEET 1 OF 1 SHEETS
1. PROJECT Texas Geotechnical Sand Search Galveston County Texas			9. SIZE AND TYPE OF BIT 3.0 In.	
2. BORING DESIGNATION GCVC-06-03			10. COORDINATE SYSTEM/DATUM Texas South Central	
3. DRILLING AGENCY Alpine Ocean Seismic Survey, Inc.			11. MANUFACTURER'S DESIGNATION OF DRILL ☐ AUTO HAMMER ☐ MANUAL HAMMER	
4. NAME OF DRILLER Charles Dill			12. TOTAL SAMPLES DISTURBED UNDISTURBED (UD)	
5. DIRECTION OF BORING ☒ VERTICAL ☐ INCLINED			13. TOTAL NUMBER CORE BOXES	
6. THICKNESS OF OVERBURDEN 0.0 Ft.			14. ELEVATION GROUND WATER	
7. DEPTH DRILLED INTO ROCK 0.0 Ft.			15. DATE BORING 10-06-06 16:01	
8. TOTAL DEPTH OF BORING 17.3 Ft.			16. ELEVATION TOP OF BORING -30.3 Ft.	
			17. TOTAL RECOVERY FOR BORING 15.8 Ft.	
			18. SIGNATURE AND TITLE OF INSPECTOR ML	

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS Depths and elevations based on measured values	% REC.	BOX OR SAMPLE	REMARKS
-30.3	0.0					
-32.5	2.2		Silty CLAY, trace shell hash, soft, dark gray (5Y-4/1), (ML-CL).			
-34.5	4.2		CLAY, stiff, olive (5Y-5/3), (CL).			
-37.6	7.3		CLAY, stiff, gray (5Y-5/1), (CL).			
-43.1	12.8		CLAY, stiff, 0.4" stiff clay layer, gray (5Y-5/1) @ 11.9', olive (5Y-5/3), (CL).			
-44.5	14.2		Silty CLAY, some shell fragments, some whole shell, whole shell up to (1.0"x 1.0"); shell fragments up to (1.0"x 1.0"), olive (5Y-5/4), (CL).			
-46.1	15.8		CLAY, stiff, (1.5" x 1.0") shell fragments @ 15.8', olive (5Y-5/3), (CL).			
-47.6	17.3		No Recovery.			
			End of Boring			

FLORIDA DEP ROSS GALVESTON VIBRACORES 2006.GPJ FL DEP ROSS.GDT 12/14/06