


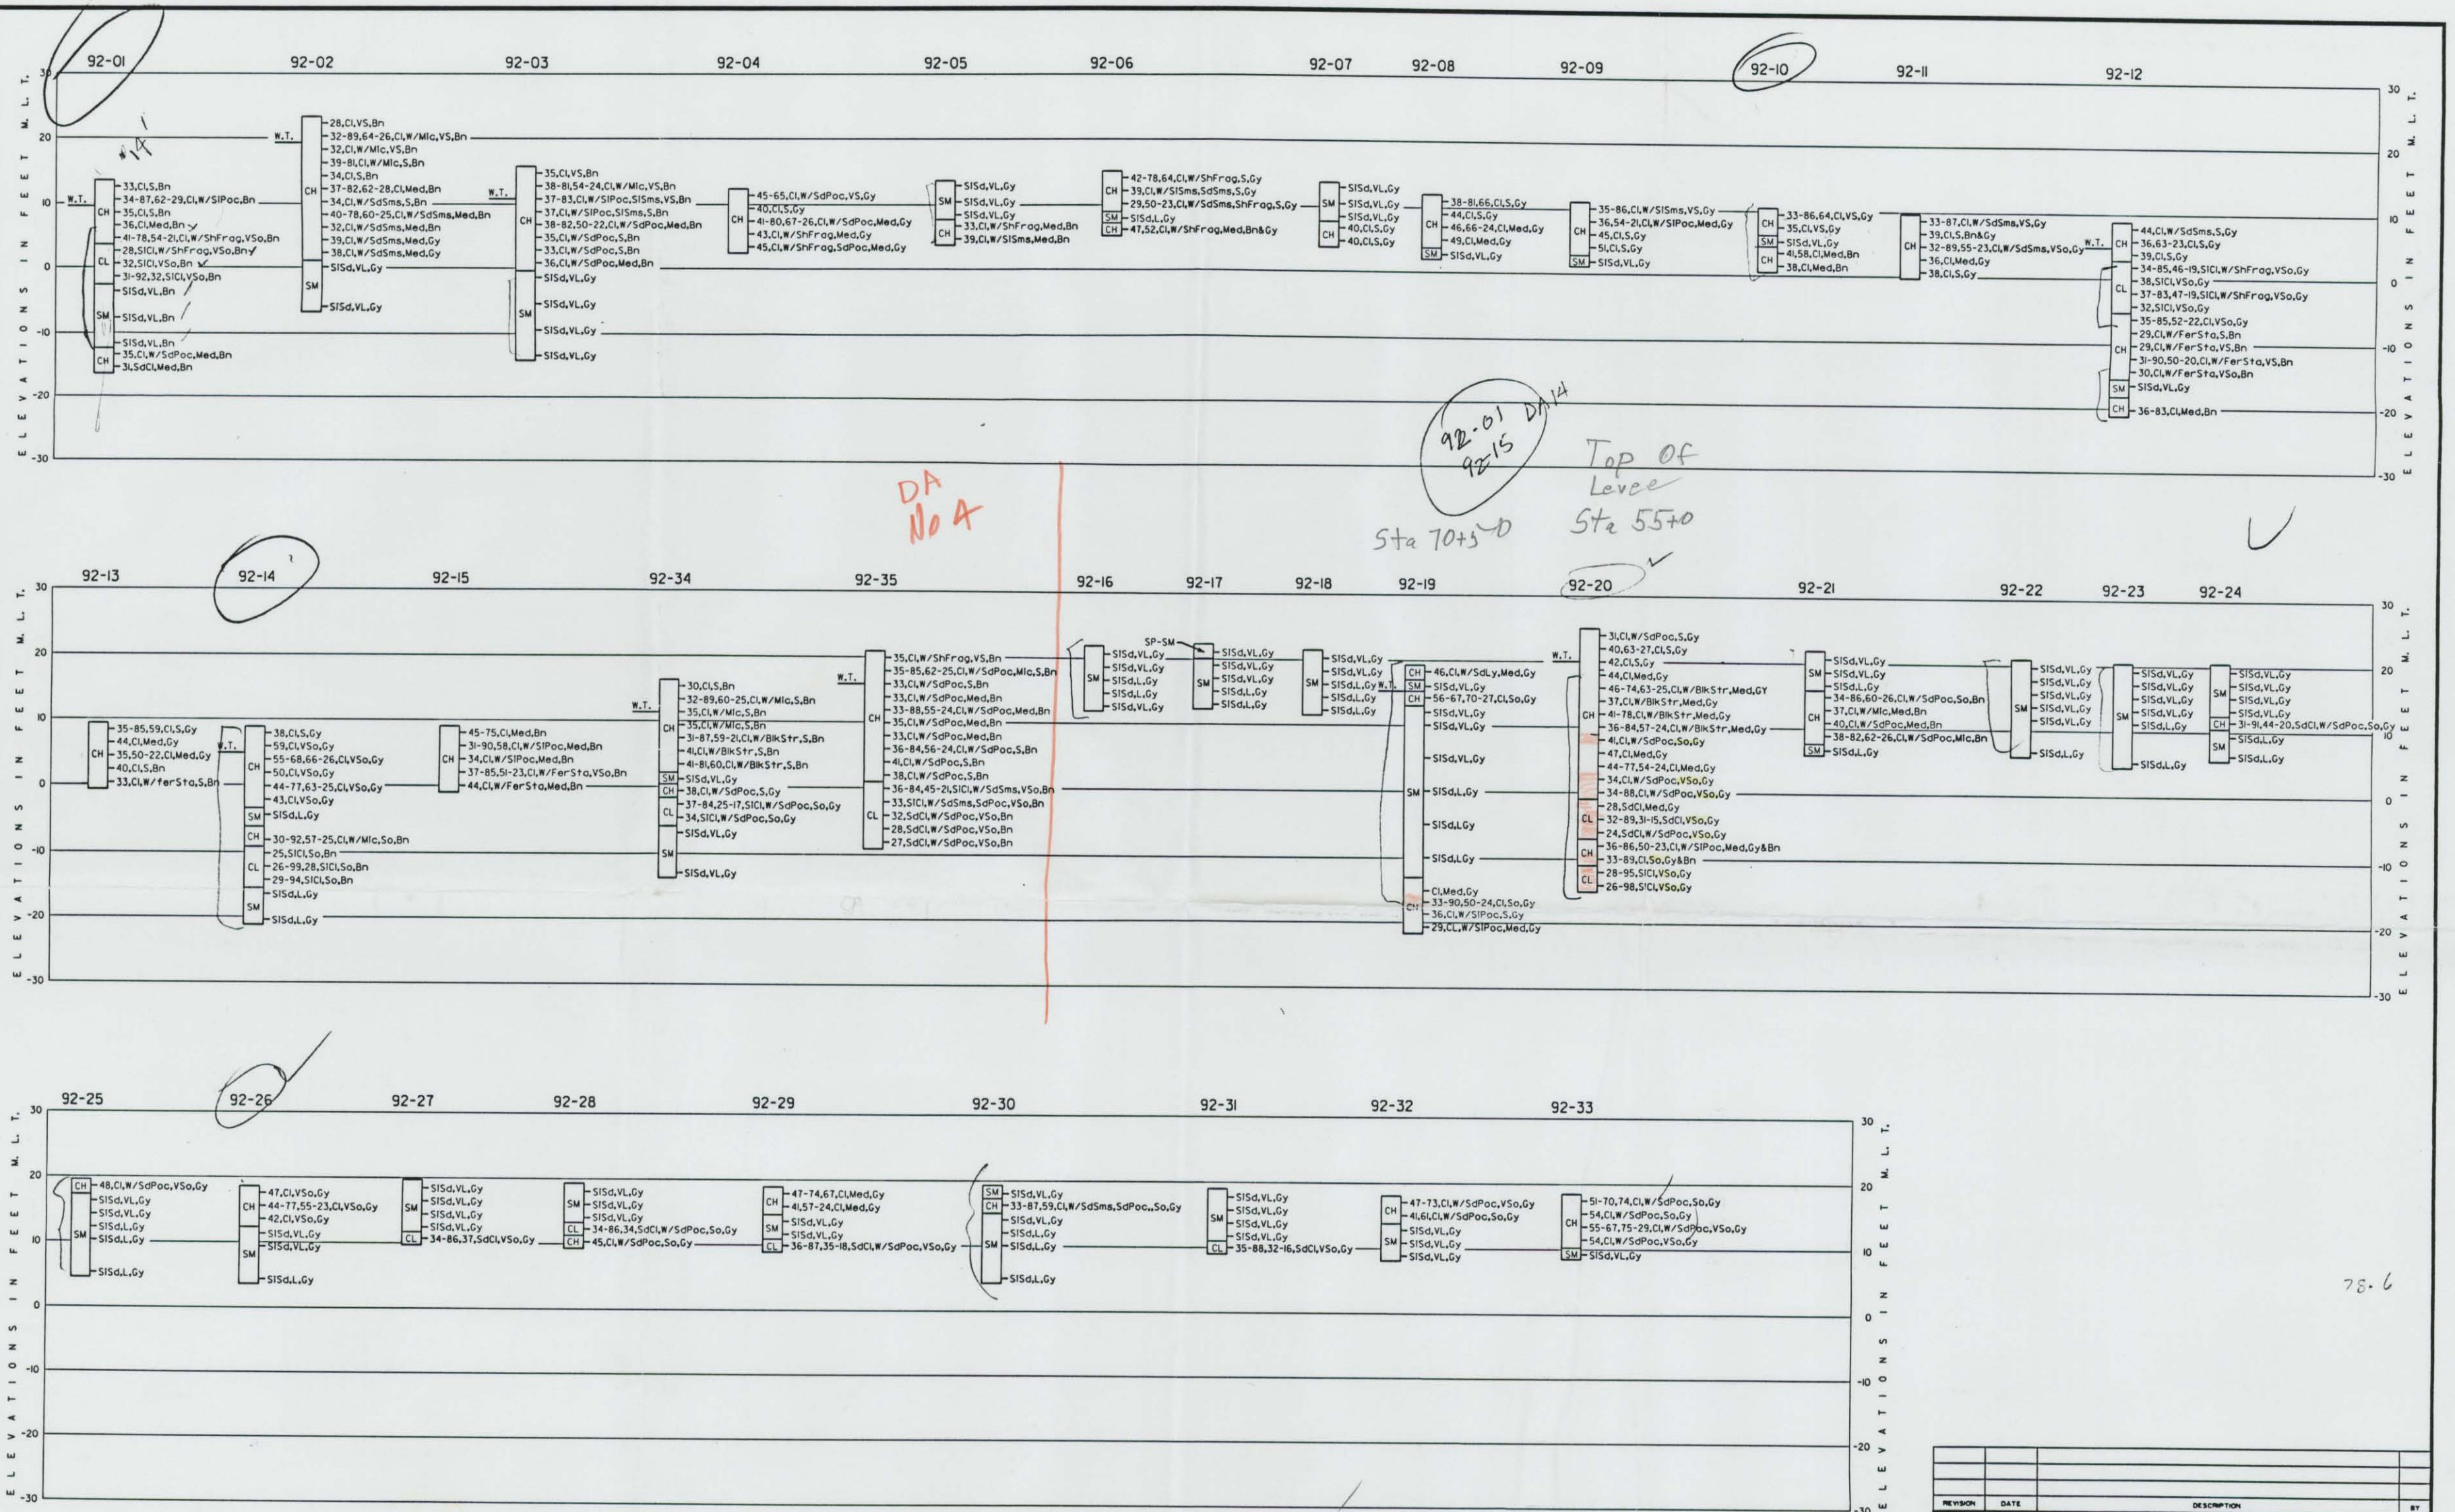

NOTE: SEE DRAWING NUMBER F-6 FOR SOILS NOTES.

REVISION		DATE	DESCRIPTION	BY
OFFICE OF THE DISTRICT ENGINEER U.S. ARMY ENGINEER DISTRICT, GALVESTON CORPS OF ENGINEERS GALVESTON, TEXAS				
DRAWN BY: P.B.S.		Brazos Island Harbor, Texas Brownsville Channel Dredging Inshore Reach No. 1 DISPOSAL AREAS Nos. 2 & 4 BORING LOGS		
CHECKED BY: J.T.F.		DATE: MAY 1992		
SUBMITTED BY: [Signature]		APPROVED BY: [Signature]		
Prepared under the direction of Brink P. Miller, Col., C.E., District Engineer		SCALE: AS SHOWN SPEC. DATE: DRAWING NUMBER F-7 SHEET 14 OF 17 FILE NO. RID 901-240		

U.S. ARMY CORPS OF ENGINEERS

DEPTH, FEET		SAMPLE	SAMPLE NO.	PEN./TORVANE	SPT.-BLOW COUNT	BORING NO. <u>92-18</u> DATE: BEGIN <u>3-17-92</u> PAGE <u>1 / 1</u> JOB NO. <u>146535</u> COMPLETE <u>3-17-92</u> Thin Walled Tube PROJECT <u>Brownsville Disp. Area #2</u> ☒ 3" ☐ 6" LOCATION <u>"</u> <u>Ship Channel</u> ELEVATION OF HOLE _____ MANUFACTURER'S DESIGNATION OF DRILL RIG <u>ARDCO-C-1000</u> GROUNDWATER: DEPTH <u>Day</u> ft., ELEV. _____ ft., at end of Drilling WEATHER <u>Cloudy - WARM - T. Showers</u> DRILLER <u>D. Mitchell</u> LOGGER <u>J. Berg</u>				
						COLOR	MATERIAL TYPE	CONSISTENCY	SECONDARY CONSTITUENTS	STRUCTURAL FEATURES AND COMMENTS
0	☒	1	1 1/1			Tan	Sand	very loose	shell	So. at Surface
	☒	2	4 1/2			"	"	"		
5	☒	3	1 1/2			"	"	Loose		
	☒	4	1 1/3			"	"	Loose		
10	☒	5	3 2/3			Gray	"	"		
										Bottom of 92-18
										10'
15										
20										
25										
30										
35										

SUMMARY OF LABORATORY TEST RESULTS

92-18

Geotest Engineering, Inc.