




COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cu	Cu
● B-6 6.0					0.99	10.78


Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-6 6.0	4.75	2.228	0.674	0.207	0.0	83.0	5.0	

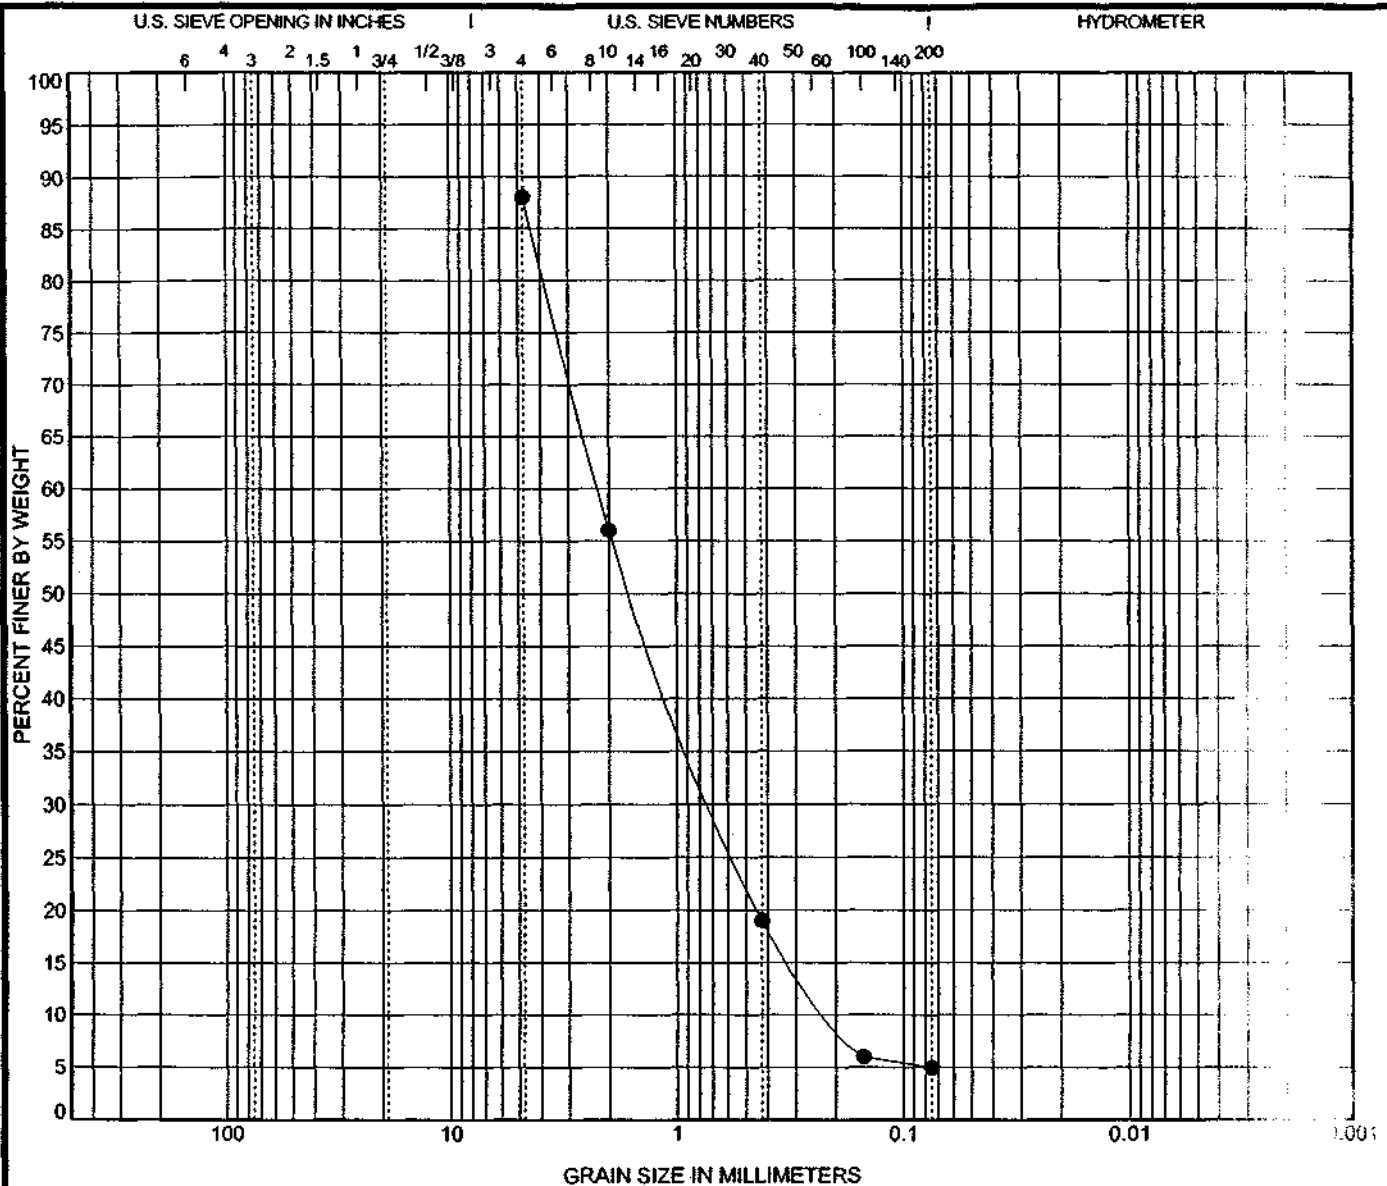

Rock Engineering and Testing Laboratory, Inc.
 4910 Neptune Street
 Corpus Christi, Texas 78405
 Telephone: (361) 883-4555
 Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
 Location: Corpus Christi, Texas
 Number: C0200586

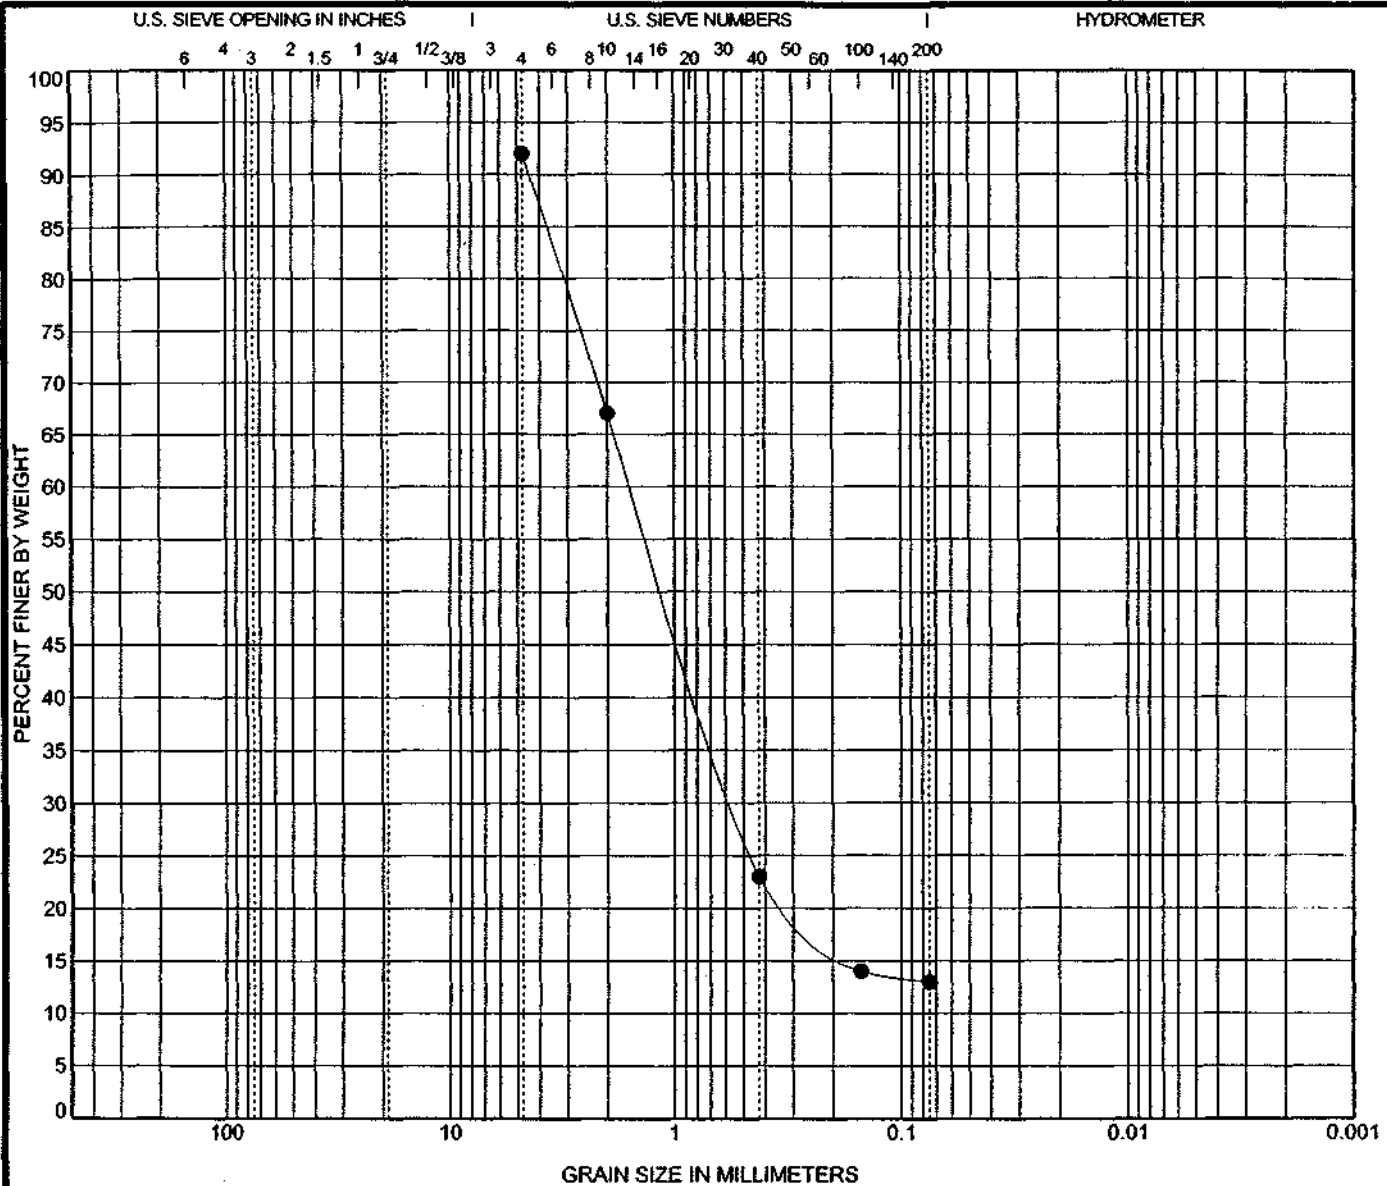

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-6 7.0						


Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-6 7.0	4.75	1.563	0.544		0.0	79.0	13.0	



Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
Location: Corpus Christi, Texas
Number: C0200586

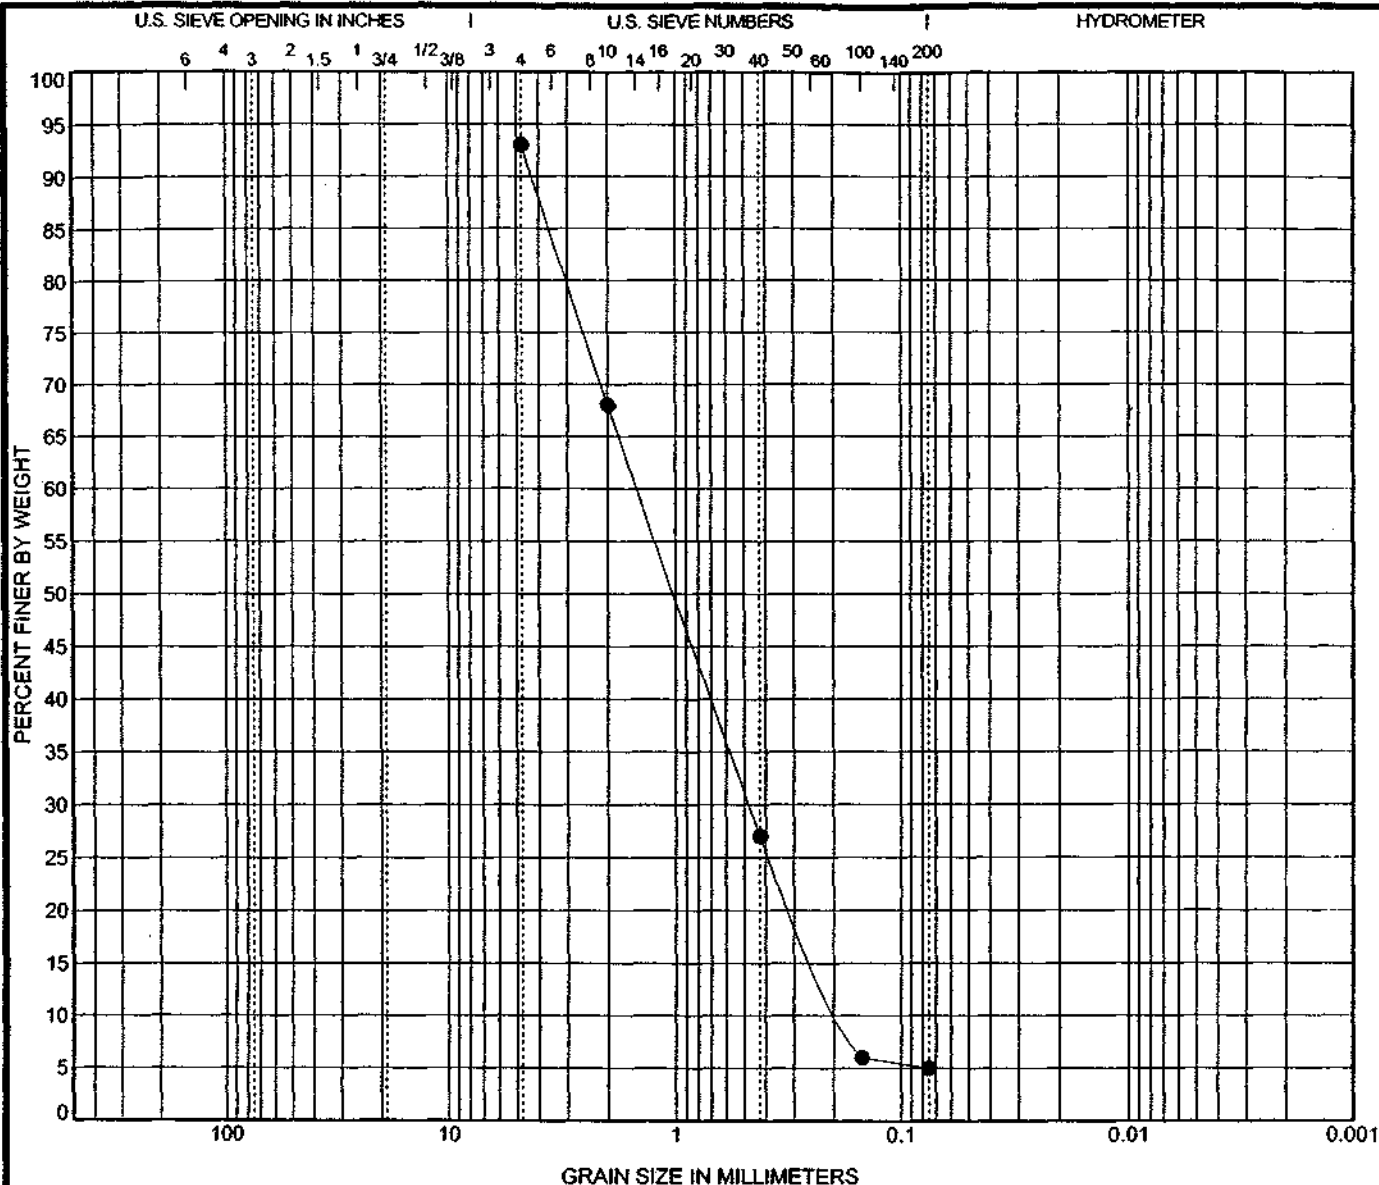

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-6 8.0					0.84	8.08


Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-6 8.0	4.75	1.478	0.476	0.183	0.0	88.0	5.0	



Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
Location: Corpus Christi, Texas
Number: C0200586

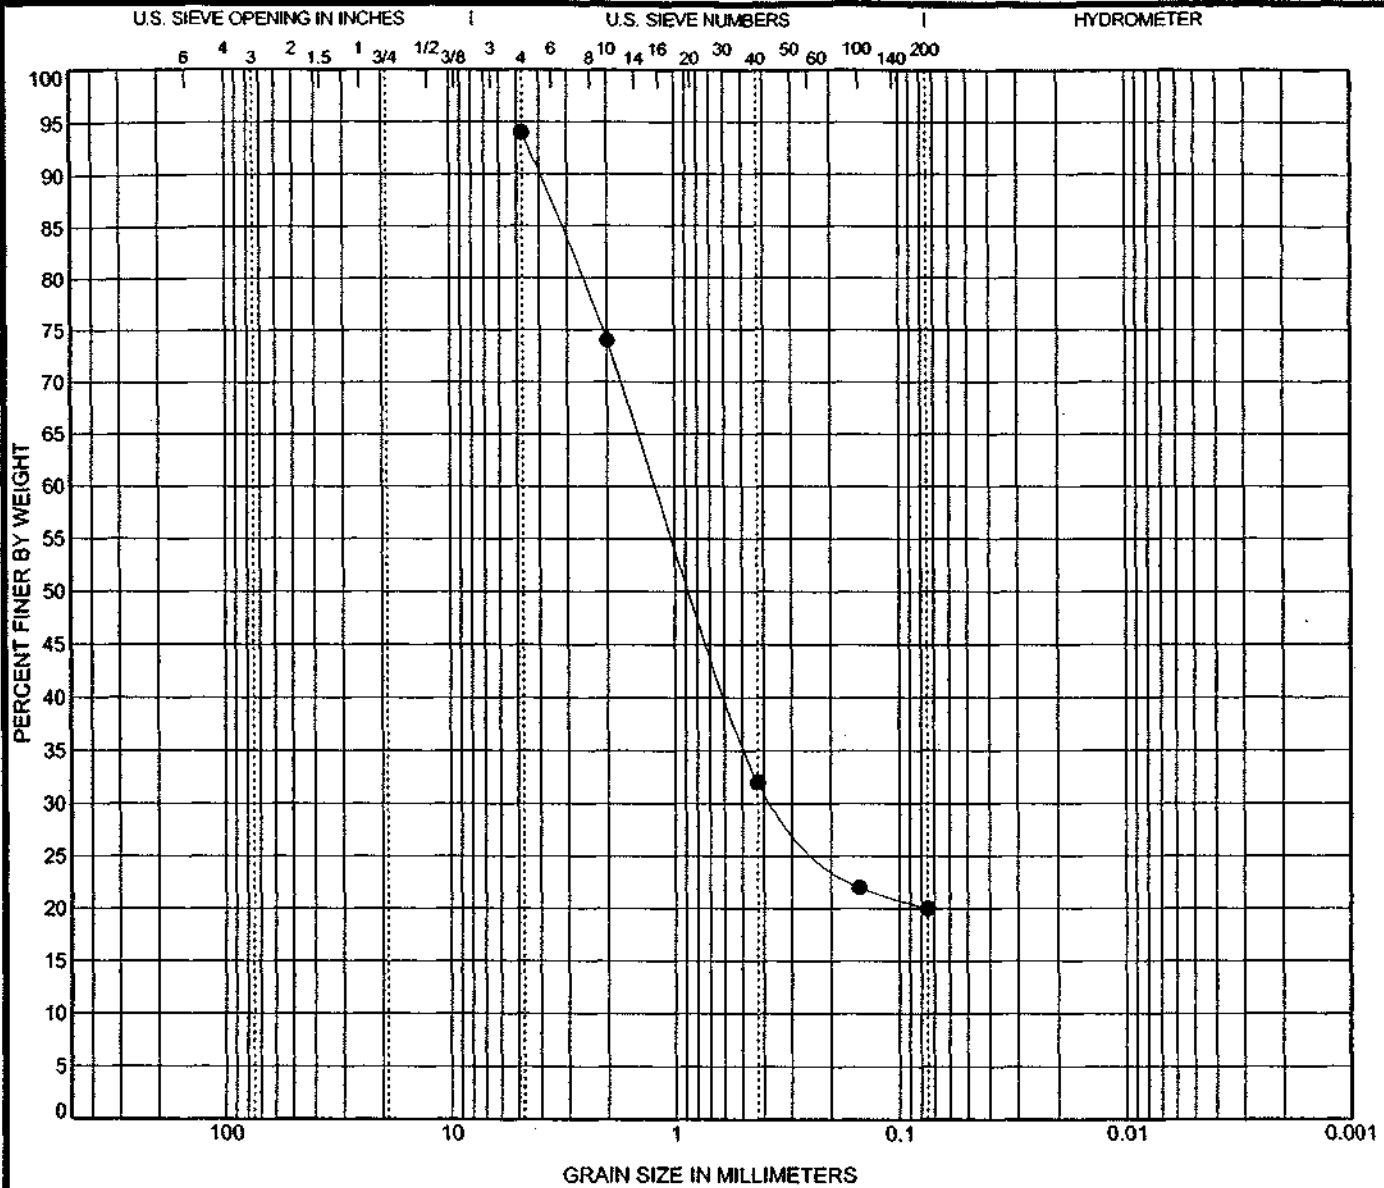

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-6 9.0						


Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-6 9.0	4.75	1.193	0.345		0.0	74.0	20.0	



Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
Location: Corpus Christi, Texas
Number: C0200586

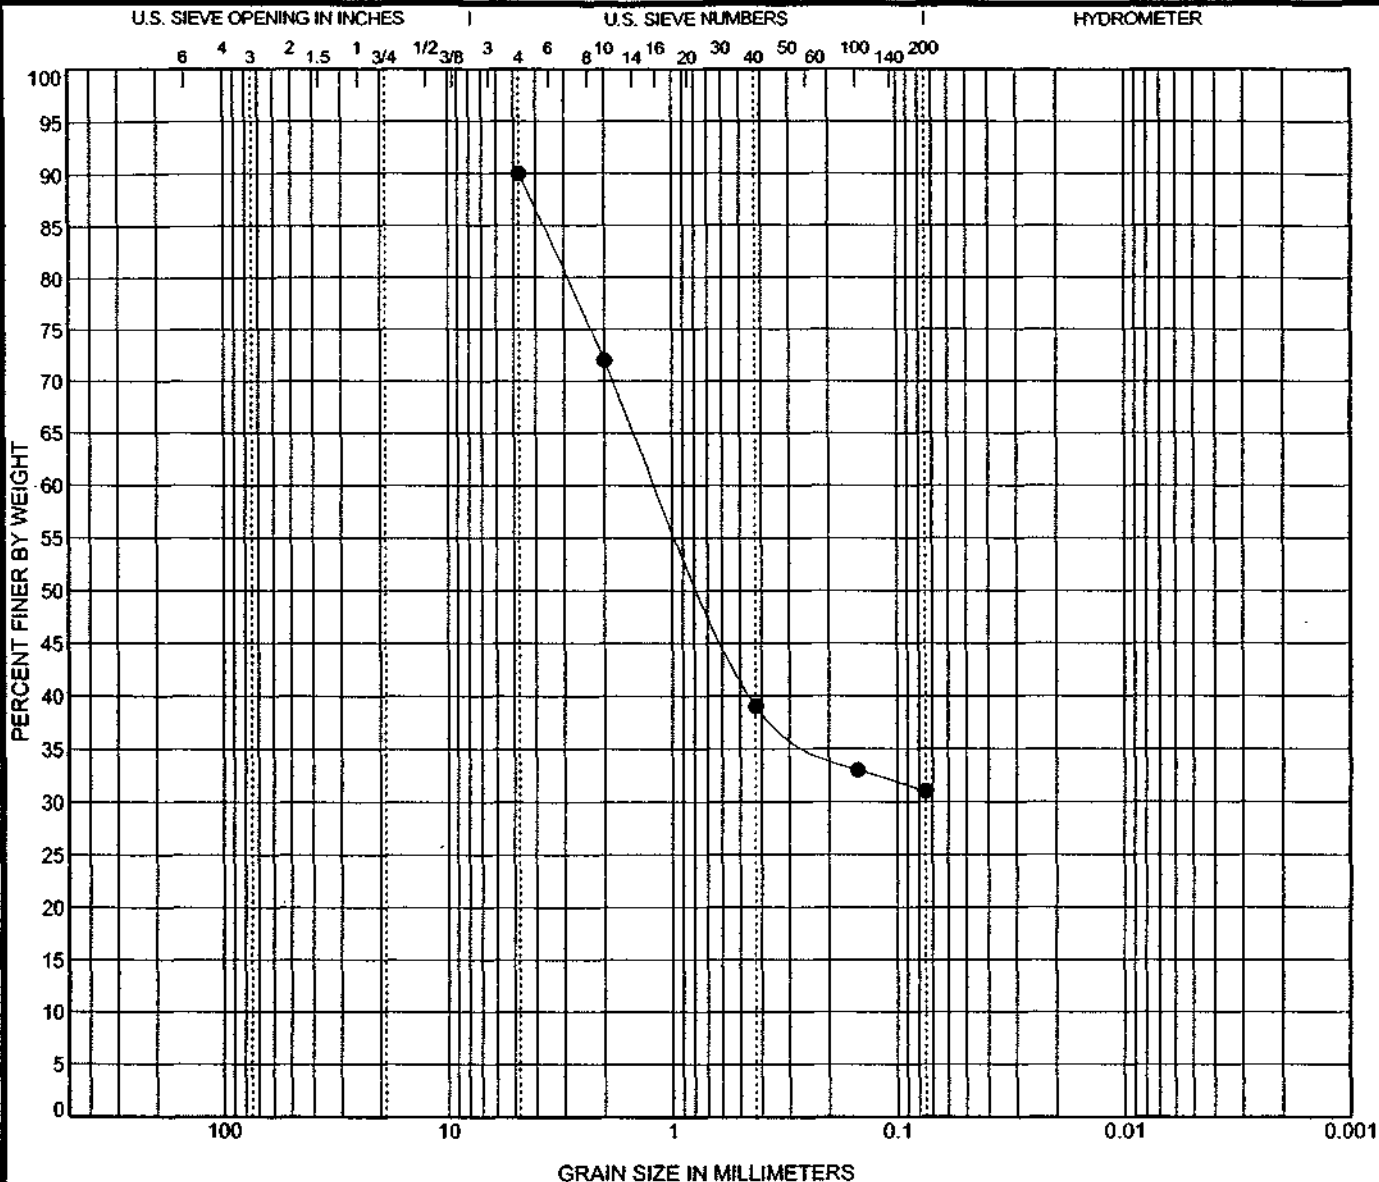

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen Identification	Classification	LL	PL	PI	Cc	Cu
● B-6 10.0						

Specimen Identification	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● B-6 10.0	4.75	1.139			0.0	59.0	31.0	



Rock Engineering and Testing Laboratory, Inc.
4910 Neptune Street
Corpus Christi, Texas 78405
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Sunfish Island/McGee Beach Restoration
Location: Corpus Christi, Texas
Number: C0200586