


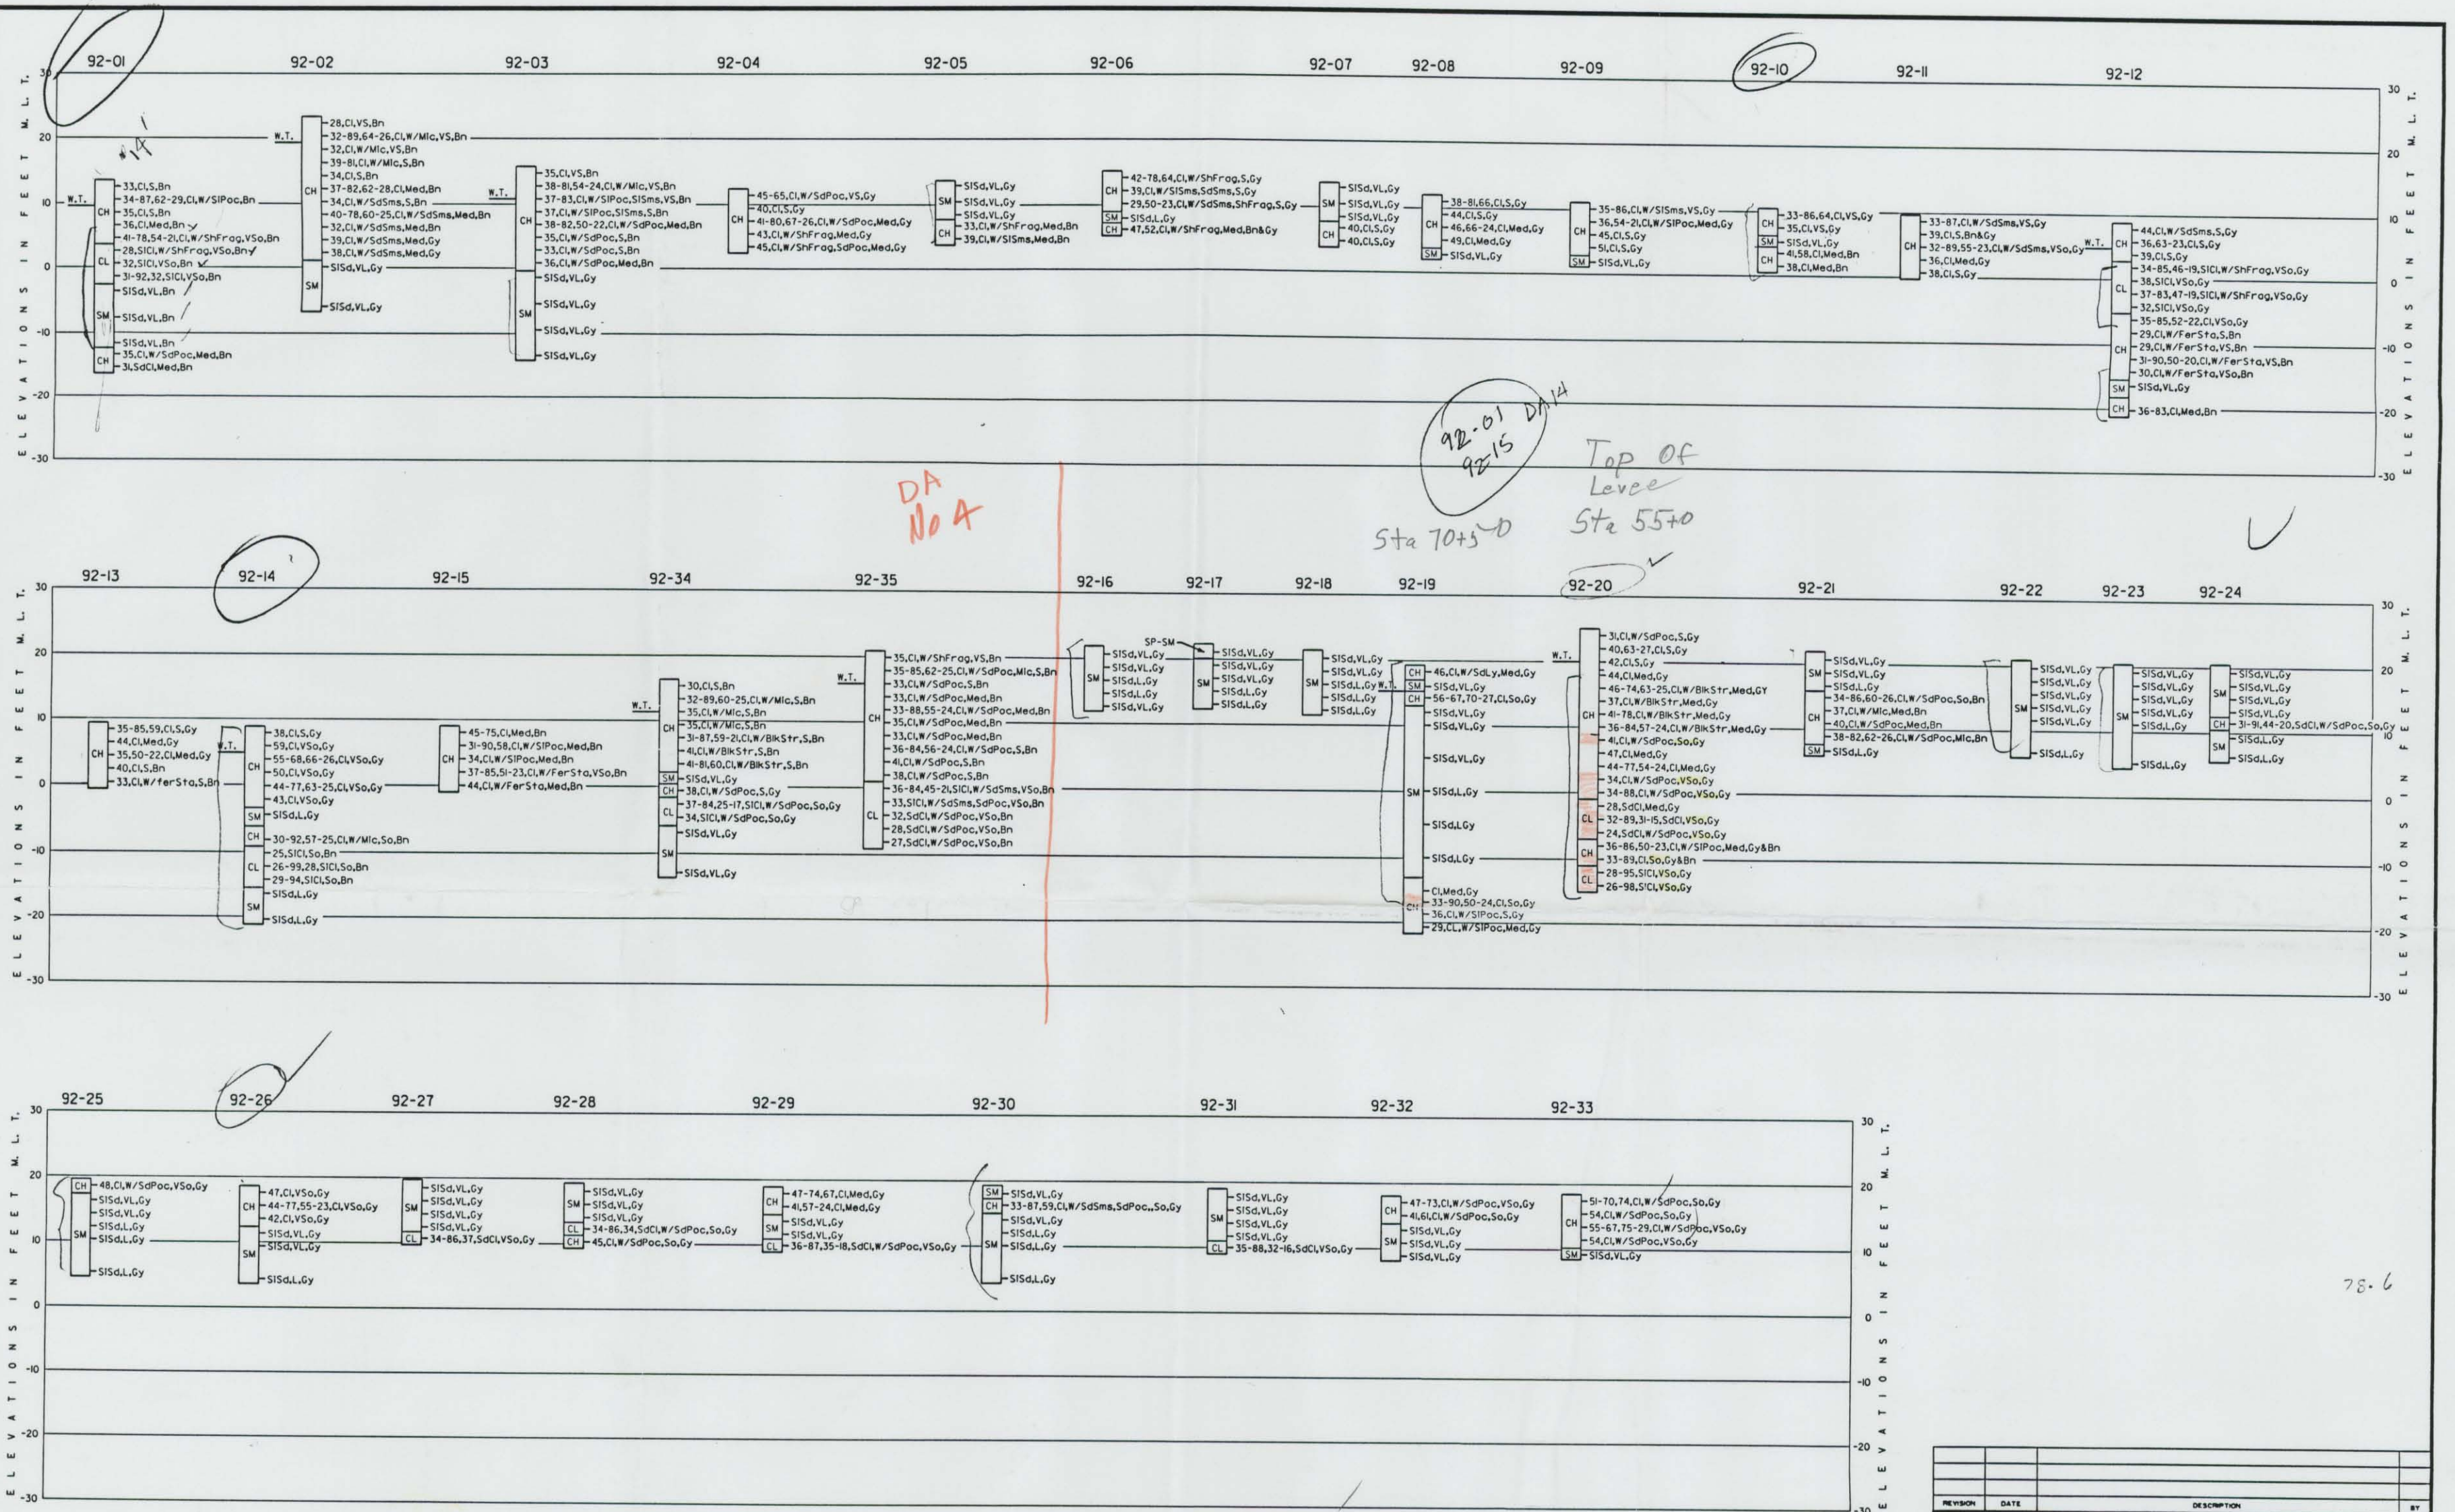

NOTE: SEE DRAWING NUMBER F-6 FOR SOILS NOTES .

REVISION		DATE	DESCRIPTION	BY
OFFICE OF THE DISTRICT ENGINEER U.S. ARMY ENGINEER DISTRICT, GALVESTON CORPS OF ENGINEERS GALVESTON, TEXAS				
DRAWN BY: P.B.S.		Brazos Island Harbor, Texas Brownsville Channel Dredging Inshore Reach No. 1 DISPOSAL AREAS Nos. 2 & 4 BORING LOGS		
CHECKED BY: J.T.F.		DATE: MAY 1992		
SUBMITTED BY: [Signature]		APPROVED BY: [Signature]		
Prepared under the direction of Brink P. Miller, Col., C.E., District Engineer		SCALE: AS SHOWN SPEC. DATE: DRAWING NUMBER F-7 SHEET 14 OF 17 FILE NO. RID 901-240		

U.S. ARMY CORPS OF ENGINEERS

DEPTH, FEET		SAMPLE	SAMPLE NO.	PEN./TORVANE	SPT.-BLOW COUNT	BORING NO. <u>92-23</u> DATE: BEGIN <u>3-17-92</u> PAGE <u>111</u> JOB NO. <u>146535</u> COMPLETE <u>3-17-92</u> Thin Walled Tube PROJECT <u>Brownsville Disp. Area #2</u> ☒ 3" ☐ 6" LOCATION <u>Ship Channel</u> ELEVATION OF HOLE _____ MANUFACTURER'S DESIGNATION OF DRILL RIG <u>ARDCO-C-1000</u> GROUNDWATER: DEPTH <u>Pay</u> ft., ELEV. _____ ft., at end of Drilling WEATHER <u>Cloudy - Warm - T-Shewees</u> DRILLER <u>D. Mitchell</u> LOGGER <u>J. Berg</u>				
		COLOR	MATERIAL TYPE	CONSISTENCY	SECONDARY CONSTITUENTS	STRUCTURAL FEATURES AND COMMENTS				
0	☒	1	1/4"	TAN	SAND	VERY LOOSE	SA. AT Surface			
	☒	2	1/4"	GRAY	"	"				
5	☒	3	1/4"	TAN	"	"				
	☒	4	1/2"	"	"	"				
10	☒	5	1/2"	GRAY	"	Loose Clay				
15	☒	6	1/2"	TAN	SAND	Loose	W/ shell Frag.			
							Bottom of 92-23			
							15'			
20										
25										
30										
35										

SUMMARY OF LABORATORY TEST RESULTS

E1 20.4

[illegible]

q_u : Unconfined Compressive Strength, W_{OH} : Weight of hammer, W_{OP} : Weight of pipe

Geotest Engineering, Inc.