



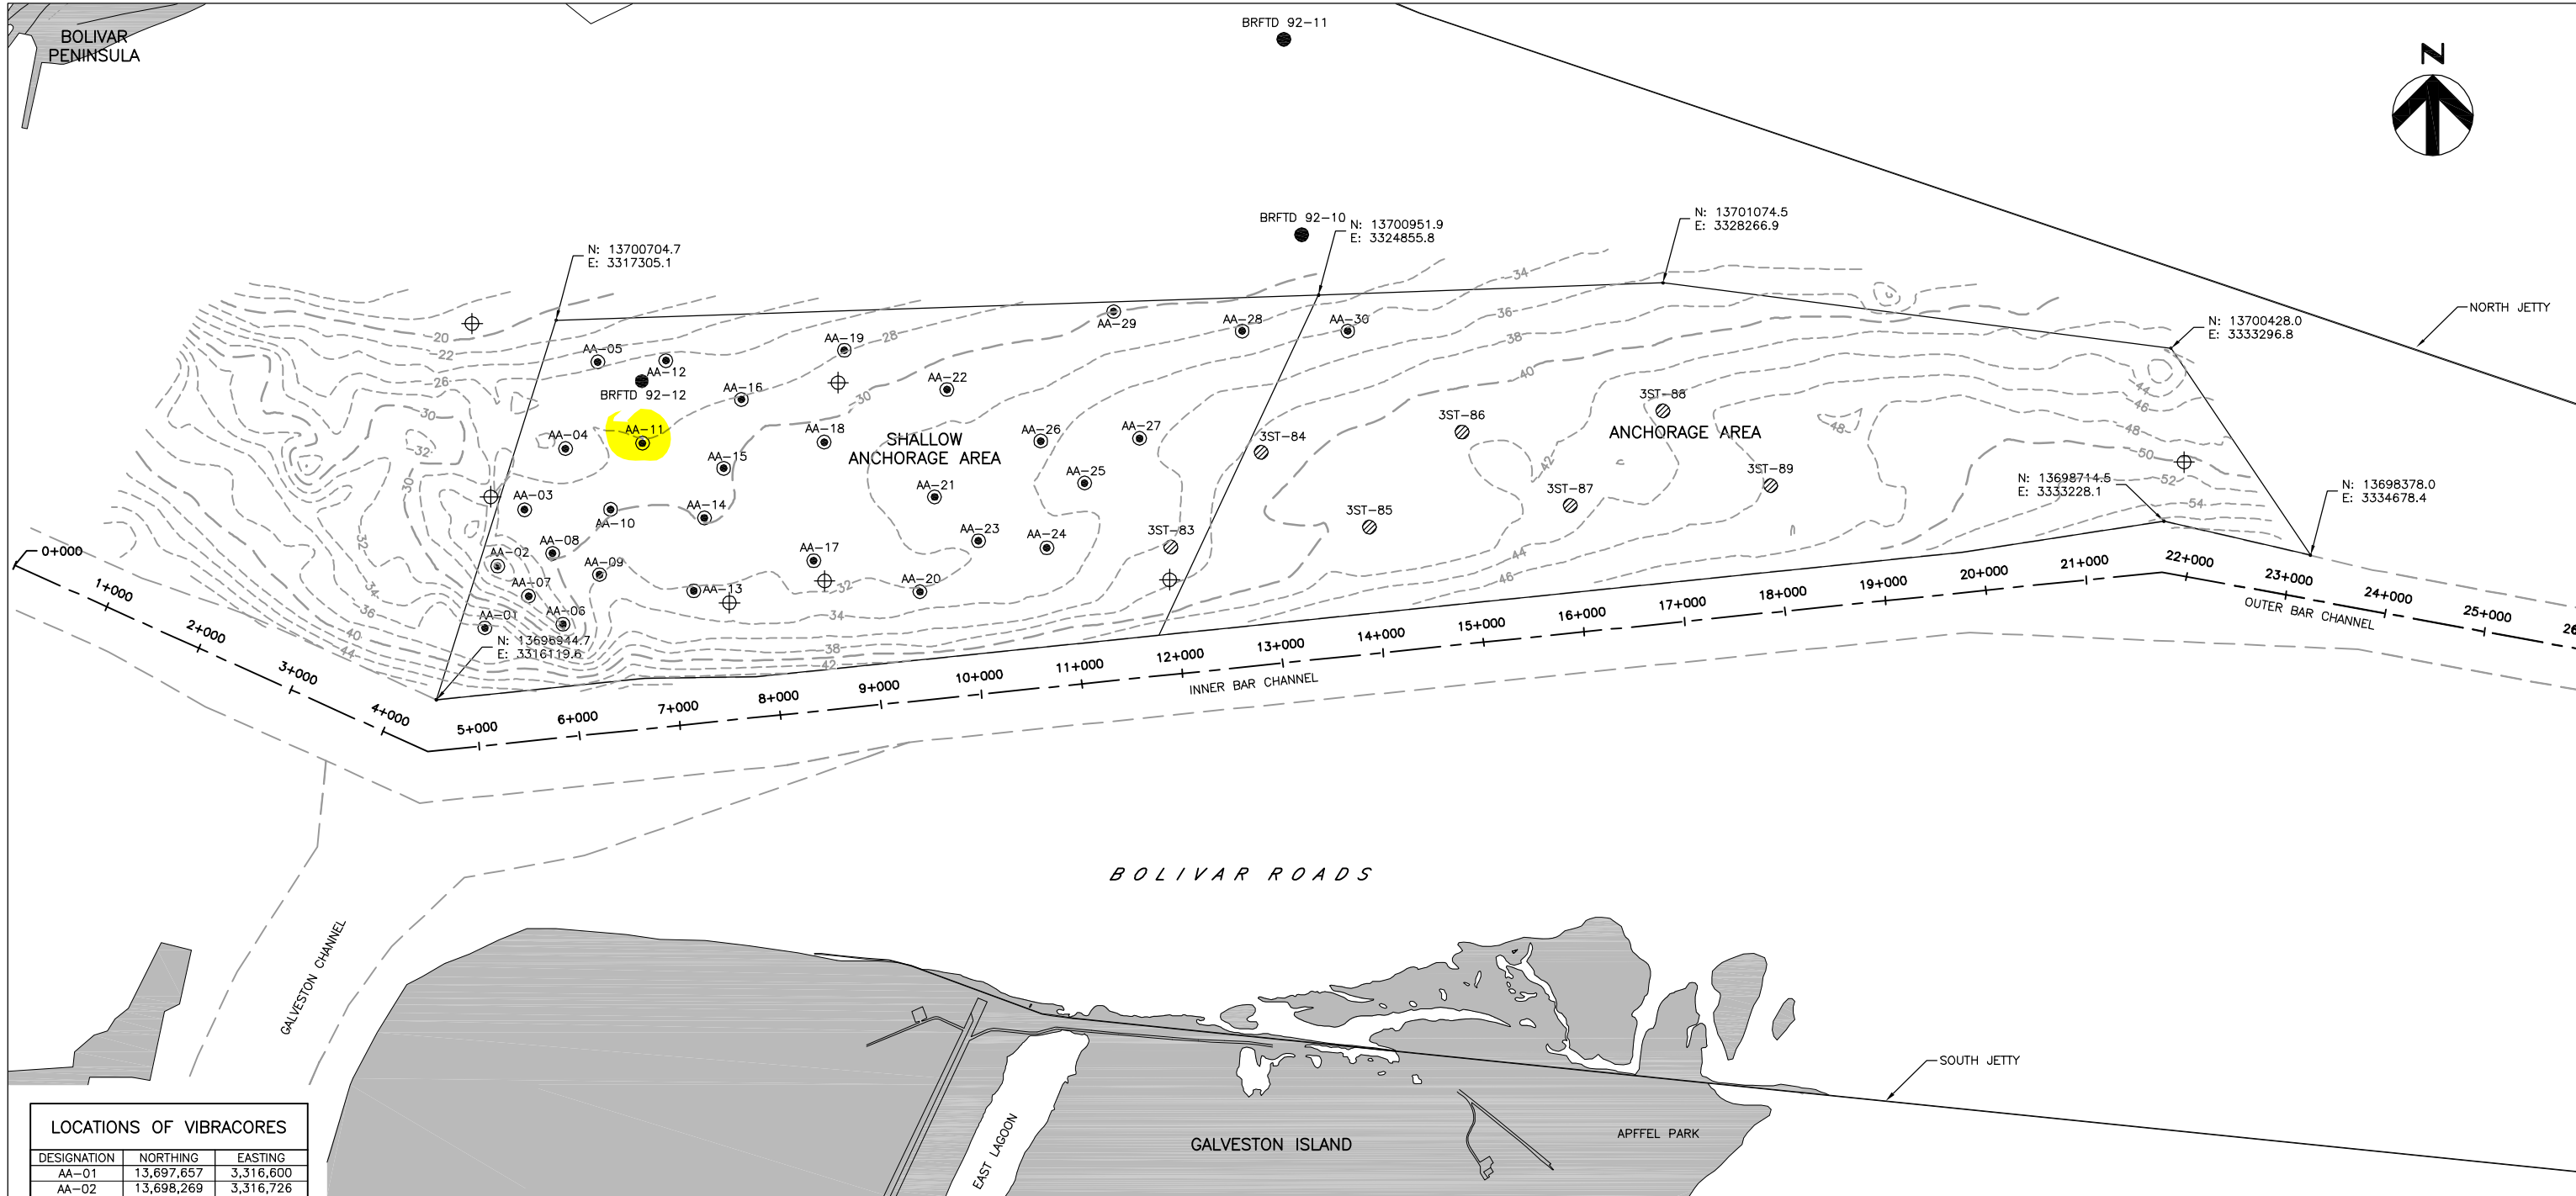

LOCATIONS OF VIBRACORES		
DESIGNATION	NORTHING	EASTING
AA-01	13,697,657	3,316,600
AA-02	13,698,269	3,316,726
AA-03	13,698,827	3,316,994
AA-04	13,699,433	3,317,399
AA-05	13,700,291	3,317,718
AA-06	13,697,693	3,317,373
AA-07	13,697,973	3,317,033
AA-08	13,698,395	3,317,271
AA-09	13,698,185	3,317,736
AA-10	13,698,831	3,317,845
AA-11	13,699,487	3,318,161
AA-12	13,700,304	3,318,392
AA-13	13,698,024	3,318,669
AA-14	13,698,746	3,318,774
AA-15	13,699,238	3,318,965
AA-16	13,699,919	3,319,140
AA-17	13,698,323	3,319,857
AA-18	13,699,497	3,319,959
AA-19	13,700,407	3,320,159
AA-20	13,698,016	3,320,908
AA-21	13,698,954	3,321,053
AA-22	13,700,018	3,321,176
AA-23	13,698,519	3,321,488
AA-24	13,698,450	3,322,165
AA-25	13,699,092	3,322,539
AA-26	13,699,507	3,322,105
AA-27	13,699,534	3,323,083
AA-28	13,700,598	3,324,099
AA-29	13,700,790	3,322,827
AA-30	13,700,598	3,325,145

- NOTES:
- NORTHINGS AND EASTINGS ARE STATE PLANE GRID, NAD'83, TEXAS SOUTH CENTRAL ZONE IN U.S. FEET. GEOGRAPHIC COORDINATES (LAT/LONG) ARE IN NAD'83.
 - ELEVATION CONTOURS ARE IN NAVD'88 DATUM.
 - ELEVATION CONTOURS BASED ON INFORMATION PROVIDED BY THE U.S. ARMY CORPS OF ENGINEERS, GALVESTON DISTRICT. SURVEY DATE WAS OCTOBER 2008. ELEVATIONS WERE CONVERTED FROM USACE MLT TO NAVD '88 USING THE FOLLOWING CORRELATION: 0 NAVD '88 = 1.42' MLT.
 - APPROXIMATE LOCATIONS OF POTENTIAL OBSTRUCTIONS BASED ON NOAA CHART 11324. HDR DOES NOT GUARANTEE ACCURACY OR COMPLETENESS OF THESE LOCATIONS. ADDITIONAL OBSTRUCTIONS ARE LIKELY TO EXIST.

- LEGEND:
- HISTORICAL BORING LOCATIONS FROM USACE (1966)
 - VIBRACORE LOCATIONS
 - APPROXIMATE LOCATION OF POTENTIAL OBSTRUCTION (SEE NOTE 4)
 - VIBRACORE LOCATION FROM RICE UNIVERSITY



TEXAS GENERAL LAND OFFICE
WEST GALVESTON ISLAND
END OF SEAWALL NOURISHMENT
EXHIBIT A – GALVESTON ANCHORAGE AREA

DATE
4/22/09
FIGURE
EX A

April 20, 2009
Attn.: Mr. Daniel Heilman, P.E.
RETL Job No.: G109112

ANCHORAGE BASIN SAND SOURCE INVESTIGATION

Anchorage Basin
Galveston Island, Texas

BORING NO.	GPS COORDINATES	
	Northing (Ft.)	Easting (Ft.)
AA-01	13,697,653	3,316,595
AA-02	13,698,267	3,316,725
AA-03	13,698,824	3,316,993
AA-04	13,699,436	3,317,401
AA-05	13,700,293	3,317,717
AA-06	13,697,692	3,317,372
AA-07	13,697,972	3,317,029
AA-08	13,698,396	3,317,267
AA-09	13,698,183	3,317,733
AA-10	13,698,835	3,317,844
AA-11	13,699,483	3,318,163
AA-12	13,700,304	3,318,392
AA-13	13,698,028	3,318,672
AA-14	13,698,747	3,318,773
AA-15	13,699,240	3,318,962
AA-16	13,699,918	3,319,141
AA-17	13,698,322	3,319,855
AA-18	13,699,496	3,319,957
AA-19	13,700,406	3,320,164
AA-20	13,698,014	3,320,905
AA-21	13,698,958	3,321,049
AA-22	13,700,020	3,321,179
AA-23	13,698,522	3,321,488
AA-24	13,698,450	3,322,163
AA-25	13,699,095	3,322,545
AA-26	13,699,510	3,322,110
AA-27	13,699,532	3,323,082
AA-28	13,700,599	3,324,100
AA-29	13,700,790	3,322,827
AA-30	13,700,597	3,325,148

LABORATORY TESTING PROGRAM

In addition to the field investigation, a laboratory testing program was conducted to determine additional pertinent engineering characteristics of the subsurface materials necessary in analyzing the behavior of the subsurface soils for the proposed project.





- Geotechnical Engineering
- Construction Materials Testing

PROJECT NAME: Anchorage Basin Sand Source Investigation

CLIENT: HDR Engineering, Inc.


BORING ID.: AA-11

DESCRIPTION: Anchorage Basin Borrow Source Area

PERCENT SHELL BY WEIGHT (BASED ON #10 SIEVE)				
-28' to -29' NAVD	-30' to -31' NAVD	-31' to -32' NAVD	-33' to -34' NAVD	-36' to -37' NAVD
0.19	0.12	0.08	0.00	0.00

ASTM MESH	% FINER BY WEIGHT AFTER REMOVING SHELL				
	-28' to -29' NAVD	-30' to -31' NAVD	-31' to -32' NAVD	-33' to -34' NAVD	-36' to -37' NAVD
#10	100.00	100.00	100.00	100.00	100.00
#18	99.45	99.82	99.82	99.97	100.00
#35	98.62	99.78	99.60	99.86	99.90
#60	94.72	99.43	98.89	99.43	98.82
#70	89.78	98.87	97.33	96.58	94.13
#100	78.43	86.52	47.34	34.35	23.06
#120	73.60	68.61	29.50	21.36	8.74
#170	67.75	52.79	22.09	16.41	2.34
#200	61.64	47.19	20.49	14.77	1.65
STATISTICS (EXCLUDING SHELL)					
MEDIAN GRAIN SIZE (mm)	N/A	0.08	0.17	0.17	0.18
MEAN GRAIN SIZE (mm)	N/A	N/A	N/A	0.14	0.18
SORTING (σ)	N/A	N/A	N/A	N/A	0.25

*The -#10 material was utilized as the total sample for Grain Size Distribution Curve calculations.

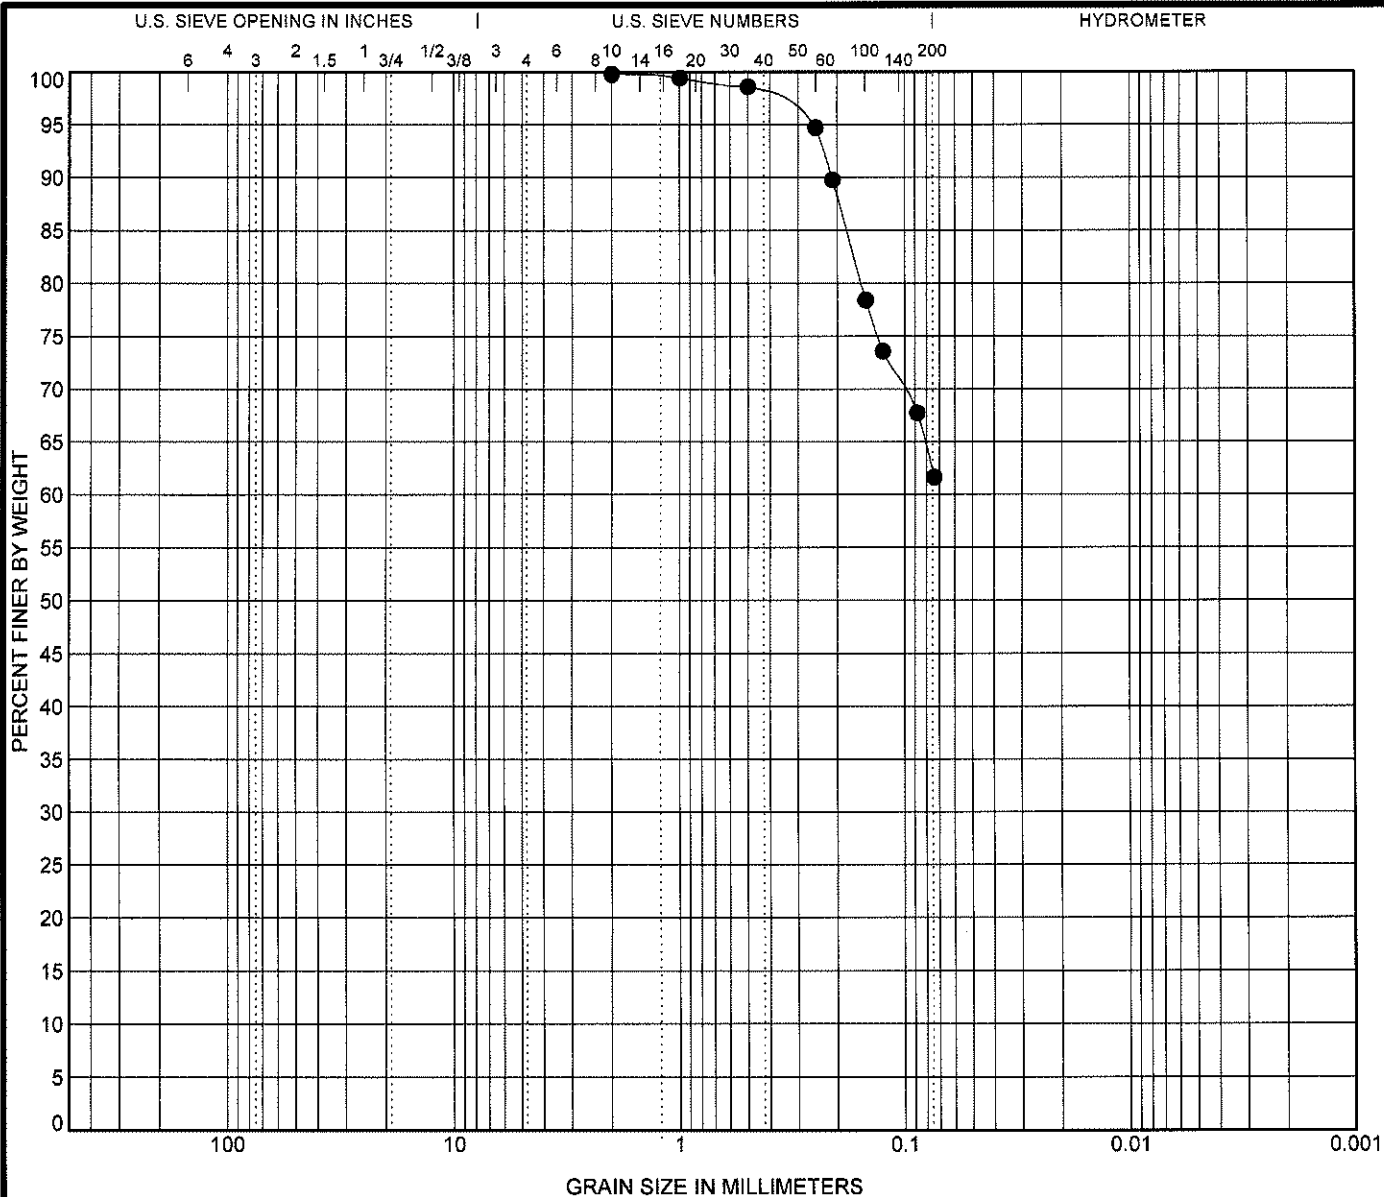

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● AA-11 (-28' to -29' NAVD)		Borrow Area (-28' to -29' NAVD)					


Specimen ID	Depth	D100	D60	D30	D10	%Gravel	%Sand	%Silt	%Clay
● AA-11 (-28' to -29' NAVD)		2				0.0			



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Anchorage Basin Sand Source Investigation
Location: Anchorage Basin; Galveston, Texas
Number: G109112

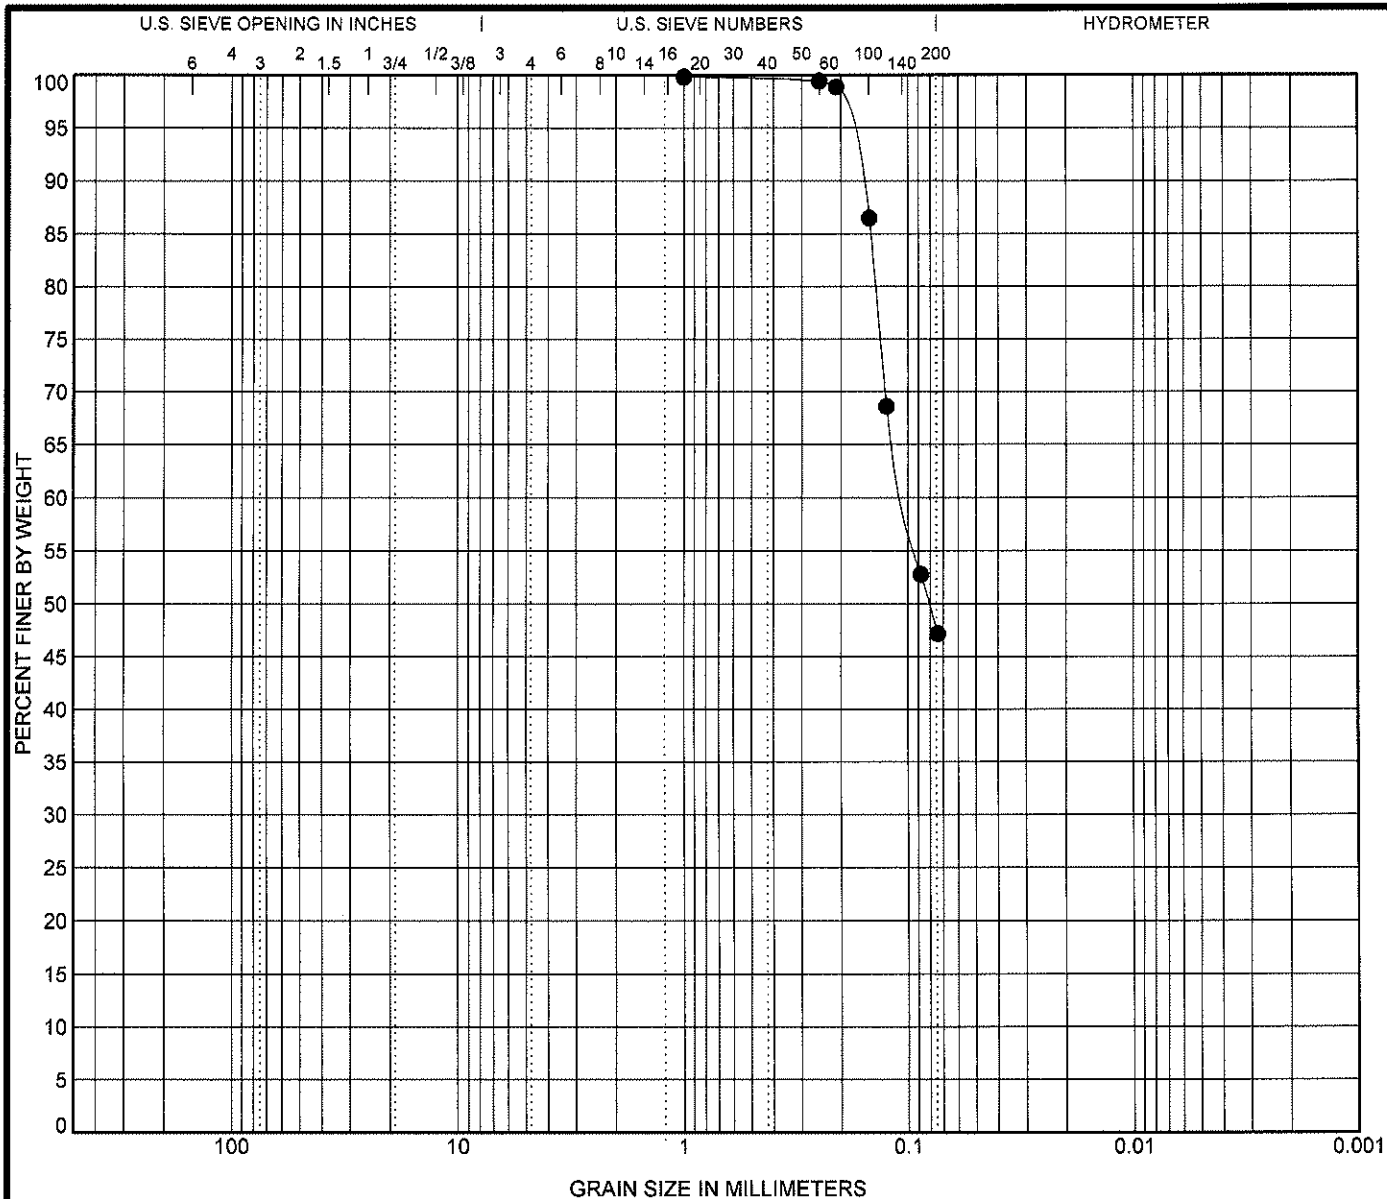

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● AA-11 (-30' to -31' NAVD)		Borrow Area (-30' to -31' NAVD)					

[illegible]


Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Anchorage Basin Sand Source Investigation

Location: Anchorage Basin; Galveston, Texas

Number: G109112

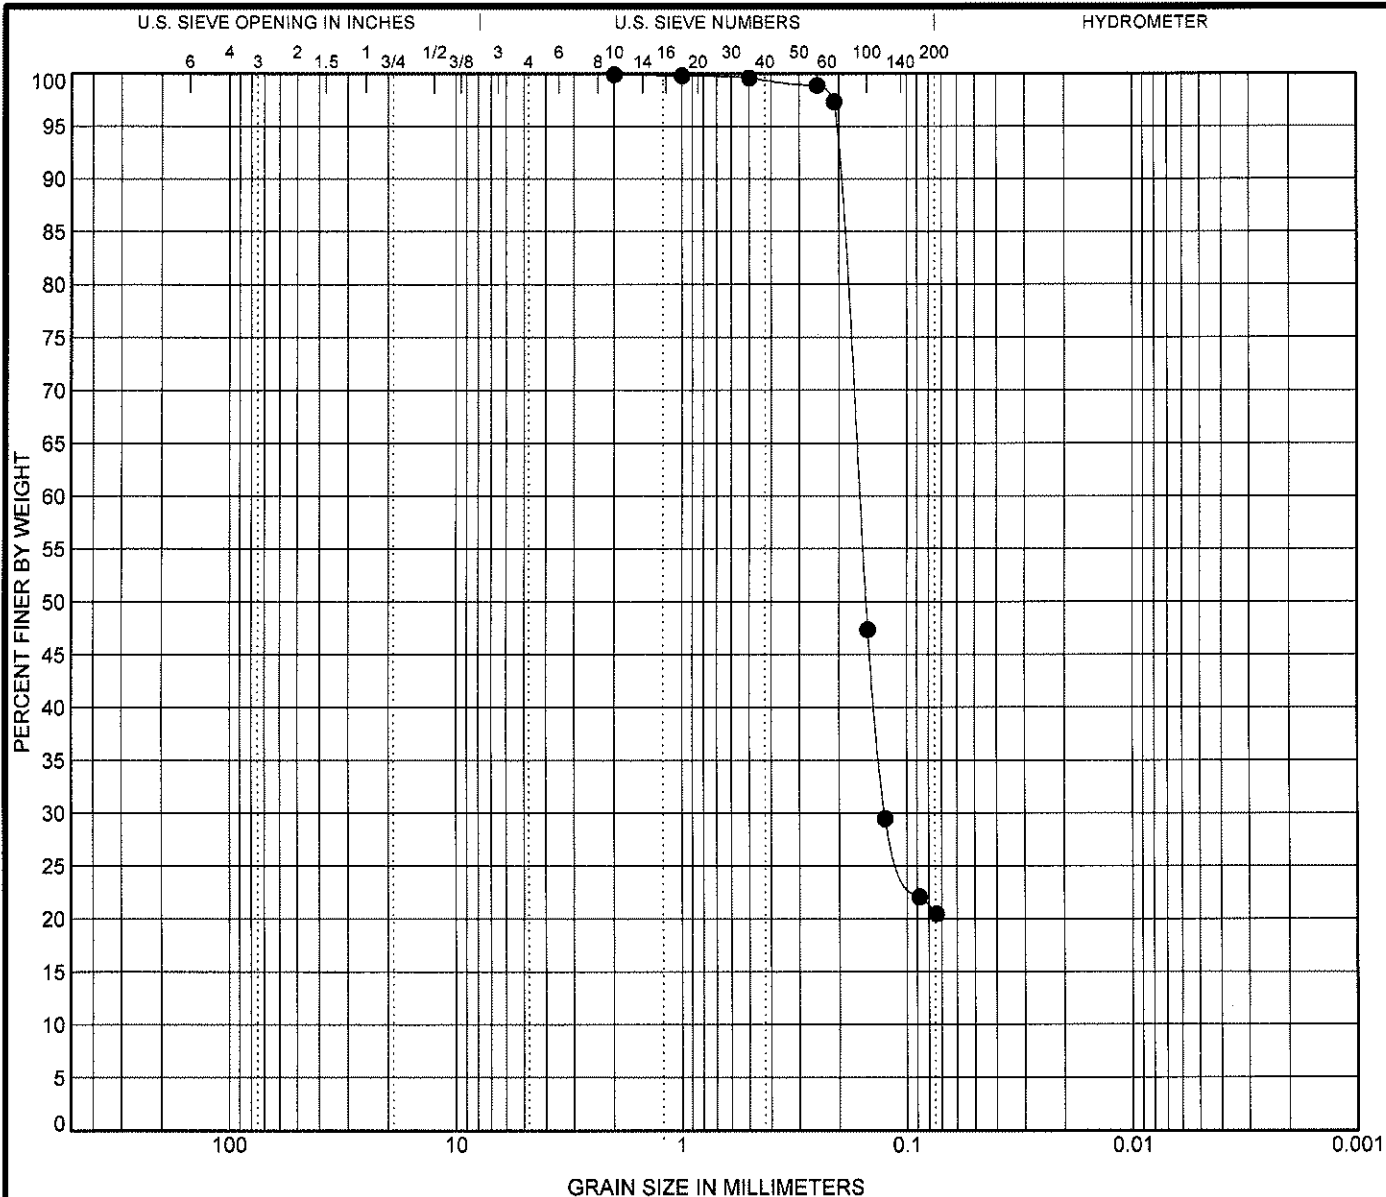

COBBLES	GRAVEL		SAND			SILT OR CLAY
	coarse	fine	coarse	medium	fine	

Specimen ID	Depth	Classification	LL	PL	PI	Cc	Cu
● AA-11 (-31' to -32' NAVD)		Borrow Area (-31' to -32' NAVD)					

[illegible]

Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

GRAIN SIZE DISTRIBUTION

Project: Anchorage Basin Sand Source Investigation
Location: Anchorage Basin; Galveston, Texas
Number: G109112



COBBLES

GRAVEL

SAND

SILT OR CLAY

Specimen ID	Depth
-------------	-------

Depth

Classification

LLPLPICcCt

● AA-11 (-33' to -34' NAVD)

Borrow Area (-33' to -34' NAVD)

Specimen ID	Depth
-------------	-------


Depth

D100D6CD30D10%Gravel

and	
-----	--

	%C
1	100
2	100
3	100
4	100
5	100
6	100
7	100
8	100
9	100
10	100
11	100
12	100
13	100
14	100
15	100
16	100
17	100
18	100
19	100
20	100
21	100
22	100
23	100
24	100
25	100
26	100
27	100
28	100
29	100
30	100
31	100
32	100
33	100
34	100
35	100
36	100
37	100
38	100
39	100
40	100
41	100
42	100
43	100
44	100
45	100
46	100
47	100
48	100
49	100
50	100
51	100
52	100
53	100
54	100
55	100
56	100
57	100
58	100
59	100
60	100
61	100
62	100
63	100
64	100
65	100
66	100
67	100
68	100
69	100
70	100
71	100
72	100
73	100
74	100
75	100
76	100
77	100
78	100
79	100
80	100
81	100
82	100
83	100
84	100
85	100
86	100
87	100
88	100
89	100
90	100
91	100
92	100
93	100
94	100
95	100
96	100
97	100
98	100
99	100
100	100

● **AA-11** (-33' to -34' NAVD)

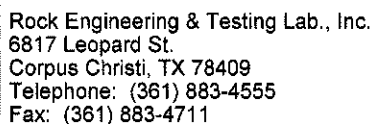
20.1720.140.0

Project: Anchorage Basin Sand Source Investigation

Location: Anchorage Basin; Galveston, Texas

Number: G109112

US GRAIN SIZE G109112 PROP ANCHORAGE BASIN SAND SOURCE GPJ US LAB GDT 4/6/09

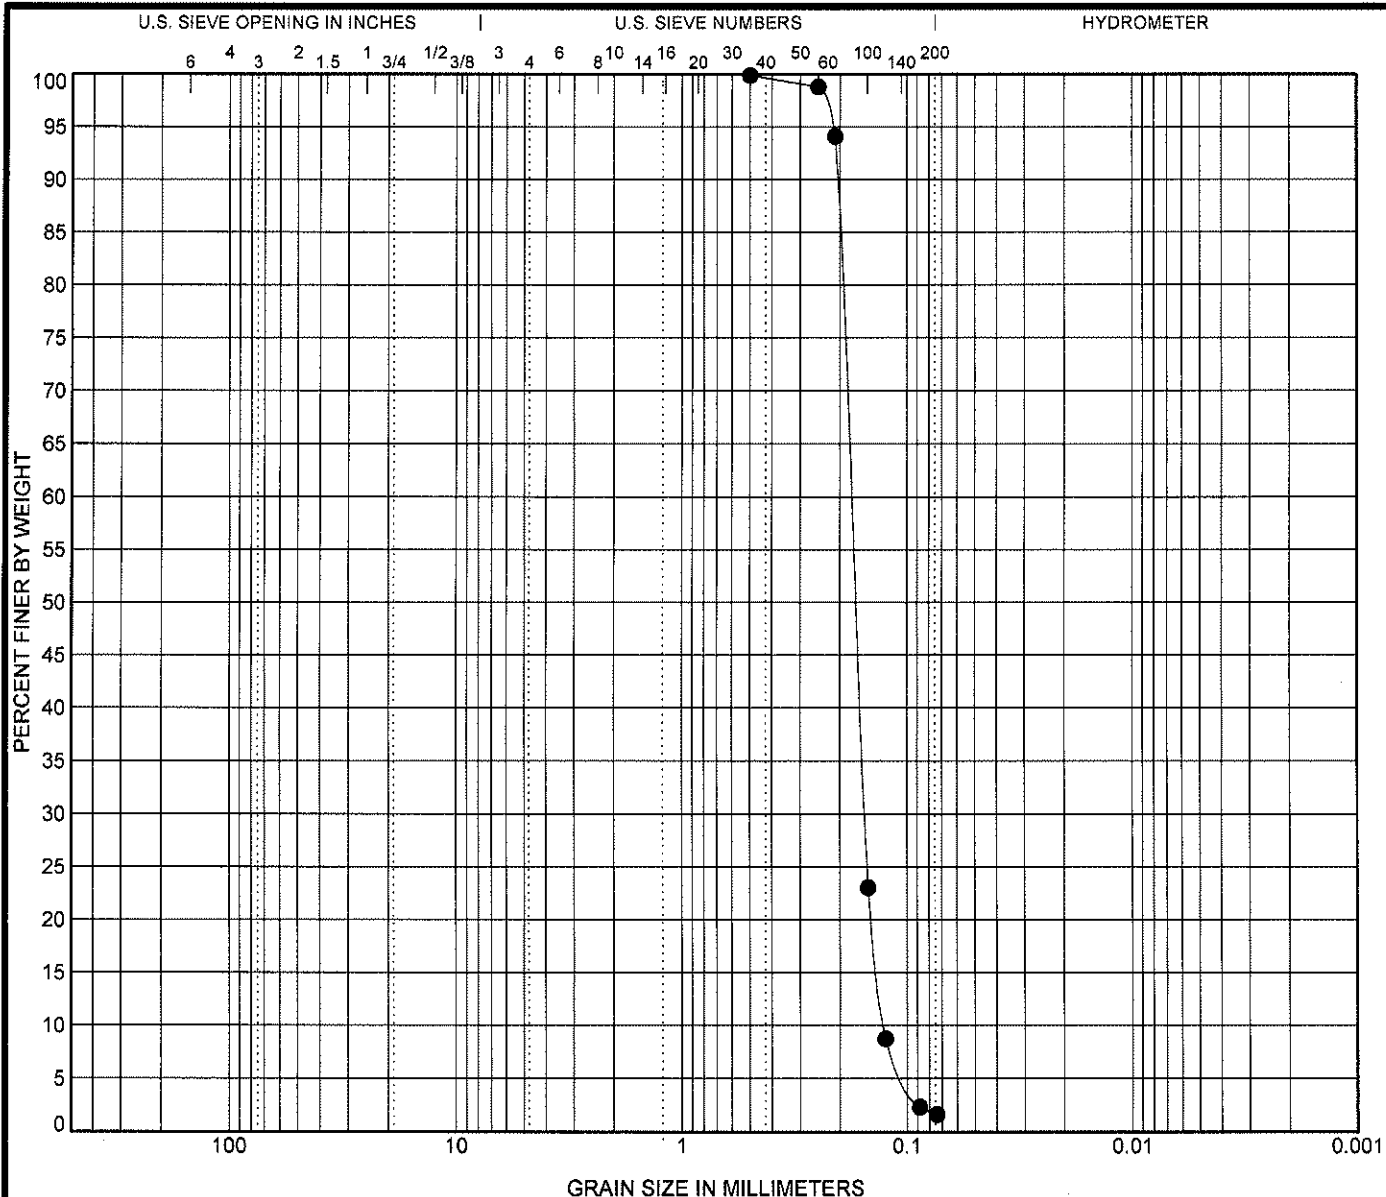

LOG OF BORING AA-11

SHEET 1 OF 1



Rock Engineering & Testing Lab., Inc.
6817 Leopard St.
Corpus Christi, TX 78409
Telephone: (361) 883-4555
Fax: (361) 883-4711

CLIENT: HDR Engineering, Inc.

PROJECT: Anchorage Basin Sand Source Investigation

LOCATION: Anchorage Basin; Galveston, Texas

NUMBER: G109112

DATE(S) DRILLED: 03/12/09 - 03/12/09

DRILLING METHOD(S):

Vibracore

GROUNDWATER INFORMATION:

SURFACE ELEVATION: -28' NAVD

DESCRIPTION OF STRATUM

SOIL SYMBOL	FIELD DATA				LABORATORY DATA						
	Elevation, Ft. [NAVD]	SAMPLE NUMBER	SAMPLES	N: BLOWS/FT P: TONS/SQ FT T: TONS/SQ FT PERCENT RECOVERY/ ROCK QUALITY DESIGNATION	MOISTURE CONTENT (%)	ATTERBERG LIMITS			DRY DENSITY POUNDS/CU.FT	COMPRESSIVE STRENGTH (TONS/SQ.FT)	MINUS NO. 200 SIEVE (%)
						LIQUID LIMIT LL	PLASTIC LIMIT PL	PLASTICITY INDEX PI			
	21										
	22										
	23										
	24										
	25										
	26										
	27										
	28										
	29	S-1									62
	30	S-2									
	31	S-3									47
	32	S-4									21
	33	S-5									
	34	S-6									15
	35	S-7									
	36	S-8									
	37	S-9									2
	38	S-10									

SANDY CLAY, with shell fragments, gray.**SILTY CLAYEY SAND**, with shell fragments, gray.**CLAYEY SAND**, gray.**SILTY CLAYEY SAND**, gray.

Same as above.

Same as above.

POORLY GRADED SAND, gray.

Same as above.

Same as above.

POORLY GRADED SAND, gray.

Boring was extended to an elevation of -38-feet NAVD during the drilling operations.

N - STANDARD PENETRATION TEST RESISTANCE
P - POCKET PENETROMETER RESISTANCE
T - POCKET TORVANE SHEAR STRENGTH

REMARKS:

Boring depth and location was determined by HDR Engineering, Inc. Boring operations were performed by Ocean Surveys, Inc.
GPS Coord. N. 13,699,483' E. 3,318,163'

LOG OF BORING G109112 PROP. ANCHORAGE BASIN SAND SOURCE GPJ ROCK ETL GDT 4/28/09